

INSTRUCTION MANUAL

4003

DIGITAL MULTIMETER

RACAL-DANA

RACAL

The Electronics Group



4003

DIGITAL MULTIMETER

RACAL-DANA

RACAL-DANA INSTRUMENTS INC.

4 Goodyear Street , Irvine, CA 92714

Telephone: 714/859-8999, TWX: 910-595-1136, TLX: 67-8341

RACAL-DANA INSTRUMENTS LTD.

Duke Street, Windsor, Berkshire SL4 1SB, United Kingdom

Telephone: Windsor (07535) 69811, TLX: 847013

RACAL-DANA INSTRUMENTS S.A.

18 Avenue Dutartre, 78150 Le Chesnay, France

Telephone: (3) 955-8888, TLX: 697 215

RACAL-DANA INSTRUMENTS GmbH.

Hermannstrasse 29, D-6078 Neu Isenburg, Federal Republic of Germany

Telephone: 06102-2861/2, TLX: 412896

RACAL-DANA INSTRUMENTS ITALIA srl.

20161 Milano, Via Angeloni 8, Italy

Telephone: (02) 6459558/6468189, TLX: 315697

RACAL

PUBLICATION DATE: DECEMBER 1980

WARRANTY

Within one year of purchase, Racal-Dana will repair or replace your instrument, at our option, if in any way it is defective in material or workmanship. The instrument must be returned to the country of purchase, unless prior arrangement has been made, and Racal-Dana Instruments will pay all parts and labor charges. Just call Racal-Dana Product Service at (714) 859-8999 in U.S.A., Windsor (07535) 69811 in England, (3) 955-8888 in France, 06102-2861/2 in Germany or (02) 6459558/6468189 in Italy for assistance. We will advise you of the proper shipping address for your prepaid shipment. Your instrument will be returned to you freight prepaid.

PROPRIETARY NOTICE

This document and the technical data herein disclosed, are proprietary to Racal-Dana Instruments, Inc., and shall not, without express written permission of Racal-Dana Instruments, Inc., be used, in whole or in part to solicit quotations from a competitive source or used for manufacture by anyone other than Racal-Dana Instruments, Inc. The information herein has been developed at private expense, and may only be used for operation and maintenance reference purposes or for purposes of engineering evaluation and incorporation into technical specifications and other documents which specify procurement of products from Racal-Dana Instruments, Inc.

FOR YOUR SAFETY

Before undertaking any maintenance procedure, whether it be a specific troubleshooting or maintenance procedure described herein or an exploratory procedure aimed at determining whether there has been a malfunction, read the applicable section of this manual and note carefully the WARNING and CAUTION notices contained therein.

The equipment described in this manual contains voltage hazardous to human life and safety and which is capable of inflicting personal injury. The cautionary and warning notes are included in this manual to alert operator and maintenance personnel to the electrical hazards and thus prevent personal injury and damage to equipment.

If this instrument is to be powered from the AC line (mains) through an autotransformer (such as a Variac or equivalent) ensure that the common connector is connected to the neutral (earthed pole) of the power supply.

Before operating the unit ensure that the protective conductor (green wire) is connected to the ground (earth) protective conductor of the power outlet. Do not defeat the protective feature of the third protective conductor in the power cord by using a two conductor extension cord or a three-prong/two-prong adaptor.

Maintenance and calibration procedures contained in this manual sometimes call for operation of the unit with power applied and protective covers removed. Read the procedures carefully and heed Warnings to avoid "live" circuit points to ensure your personal safety.

Before operating this instrument:

1. Ensure that the instrument is configured to operate on the voltage available at the power source. See Installation Section.
2. Ensure that the proper fuse is in place in the instrument for the power source on which the instrument is to be operated.
3. Ensure that all other devices connected to or in proximity to this instrument are properly grounded or connected to the protective third-wire earth ground.

If at any time the instrument:

- Fails to operate satisfactorily
- Shows visible damage
- Has been stored under unfavorable conditions
- Has sustained stress

It should not be used until its performance has been checked by qualified personnel.

CONTENTS

Section	Page
CONTENTS.	
ILLUSTRATIONS	
1. GENERAL INFORMATION	1-1
1-1. INTRODUCTION	1-1
1-2. WARRANTY INFORMATION.	1-1
1-3. CHANGE NOTICE	1-1
SPECIFICATIONS	1-2
2. OPERATION	2-1
2-1. GENERAL	2-1
2-2. INSPECTION	2-1
2-3. PREPARATION FOR USE	2-1
2-4. OPERATION ON LINE POWER	2-1
2-5. OPERATION ON BATTERY PACK POWER	2-1
2-6. BATTERY CHARGING	2-1
2-7. OPERATING INSTRUCTIONS.	2-5
2-8. ZERO ADJUSTMENTS	2-6
2-9. DC VOLTAGE MEASUREMENT.	2-6
2-10. AC VOLTAGE MEASUREMENT	2-8
2-11. RESISTANCE (Ω) MEASUREMENT.	2-9
2-12. DC CURRENT MEASUREMENT	2-11
2-13. AC CURRENT MEASUREMENT.	2-11
2-14. TRMS MEASUREMENT (AC & DC)	2-12
2-15. ANALOG OUTPUT	2-12
3. PERFORMANCE VERIFICATION	3-1
3-1. GENERAL	3-1
3-2. RECOMMENDED TEST EQUIPMENT	3-1
3-3. ENVIRONMENTAL CONDITIONS.	3-1
3-4. PERFORMANCE VERIFICATION PROCEDURE	3-1
4. ACCESSORIES	4-1
4-1. POWER OPTIONS	4-1
5. OPERATING INSTRUCTIONS.	5-1
5-1. GENERAL	5-1
5-2. OVERALL OPERATION	5-2
5-3. AC CONVERTER	5-3
5-4. DC SIGNAL CONDITIONING.	5-4
5-5. OHMS CONVERSION	5-6
5-6. ANALOG OUTPUT	5-7
5-7. CLOCK	5-7
5-8. A/D CONVERTER	5-8
5-9. DISPLAY	5-8
5-10. AC POWER SUPPLY	5-8
5-11. OPTION 06 BATTERY PACK	5-8
6. MAINTENANCE	6-1
6-1. GENERAL	6-1

INSTRUCTION MANUAL

Digital Multimeter

Model 4003

CONTENTS (CON'T)

Section	Page
6-2. RECOMMENDED TEST EQUIPMENT.	6-1
6-3. ENVIRONMENTAL CONDITIONS	6-1
6-4. CALIBRATION PROCEDURE	6-1
6-5. TROUBLESHOOTING	6-5
6-6. TROUBLESHOOTING PROCEDURE	6-5
6-7. FRONT PANEL ZERO KNOB REMOVAL AND REPLACEMENT	6-15
6-8. FUSE REPLACEMENT.	6-16
7. REPLACEABLE PARTS	7-1
7-1. GENERAL	7-1
7-2. ORDERING INFORMATION	7-1
7-3. FACTORY SERVICE	7-1
7-4. SCHEMATICS	7-1
7-5. COMPONENT LAYOUT.	7-1
7-6. MAINTENANCE KIT	7-1

Illustrations

Figure No.	Illustrations	Page
1-1.	Model 4001 Front Panel	1-1
1-2.	Dimensional Data	1-3
1-3.	Tilt Bail Positions	1-4
2-1.	Rear View of Standard Line Voltage Instruments	2-2
2-2.	Rear View of Optional Line Voltage Instruments	2-2
2-3.	Battery Pack Installation	2-3
2-4.	Operational Controls	2-6
3-1.	Test Circuit For 20mV DC Accuracy Check	3-3
5-1.	Simplified Signal Flow Block Diagram	5-1
5-2.	Simplified Signal Conditioning	5-5
5-3.	A/D Converter Function (Sheet 1)	5-9
5-3.	A/D Converter Function (Sheet 2)	5-10
6-1.	Test Point Locations	6-3
6-2.	Integrator and Comparator Waveforms	6-9
6-3.	Front Panel Zero Knob Removal	6-15
7-1.	Covers and Panels	7-3

SECTION 1. GENERAL INFORMATION

1-1. INTRODUCTION. The Model 4003 Microvolt DMM is a versatile digital multimeter useful for measurement of ac and dc voltage, ac and dc current and resistance. Ranges and accuracies are listed in the Table of Specifications on Page 1-2. The instrument features include (a) 20,000 count accuracy with a 4-1/2 digit display; (b) resolution of $1\mu\text{V}/\text{digit}$ and $1\text{m}\Omega/\text{digit}$; (c) front panel zero compensation for lead resistance and thermal EMF's; (d) automatic indication of polarity; (e) and an Analog Output. Ranges and functions are selected with pushbuttons on the front of the instrument. The decimal point is properly positioned as the range is selected.

1-2. WARRANTY INFORMATION. The Warranty is given on the back of the title page of this Instruction Manual. If there is a need to exercise the Warranty, contact the Racal-Dana Representative in your area to determine the proper action to be taken. Racal-Dana maintains service facilities in the United Kingdom and France, as well as in the United States. A listing is included in the back of this manual.

1-3. CHANGE NOTICES. Improvements or changes to the instrument which occur after printing of the Instruction Manual will be explained on a Change Notice sheet attached to the inside back cover.

IMPORTANT

The  symbol can be found in various places in this Instruction Manual. Carefully read the associated CAUTION statements with regard to proper use and handling of the instrument. Damage to the instrument may occur if these precautions are ignored.

This  symbol can be found in various places in this Instruction Manual. This symbol indicates those areas on the instrument which are potential shock hazards. Carefully read the associated WARNING statements with regard to proper use and handling of the instrument. Serious personal injury may result if these precautions are ignored.

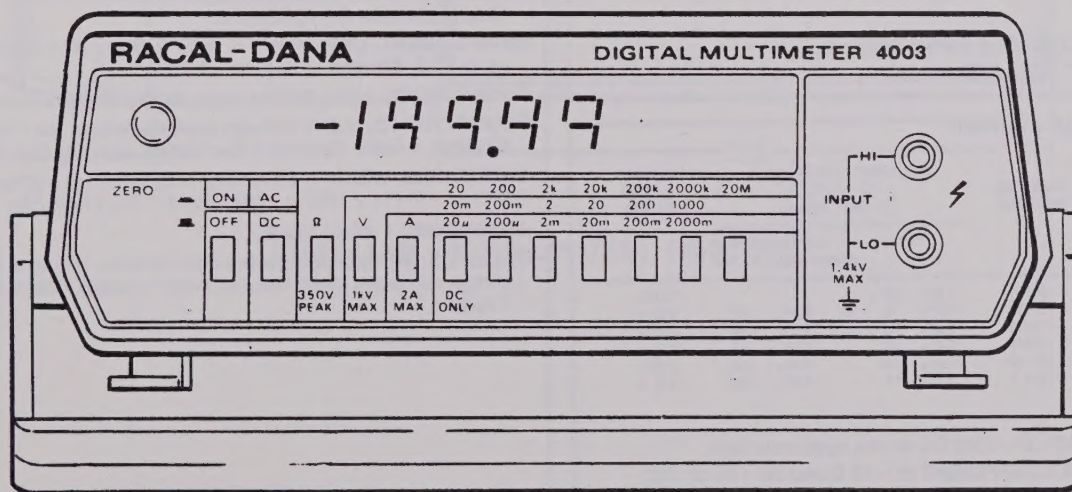


FIGURE 1-1. Model 4003 Front Panel.

TABLE 1-1

SPECIFICATIONS

DC VOLTAGE

RANGE	MAXIMUM READING	ACCURACY (12 months)		MAXIMUM ALLOWABLE INPUT
		18 - 28 C (% rdg + digits)	18 - 28 C (% rdg + digits)	
20mV*	19 999	0.04 % · 2d	0.04 % · 2d	1200V momentary
200mV*	199 99	0.04 % · 1d	0.04 % · 1d	1200V momentary
2 V	1 9999	0.03 % · 1d	0.03 % · 1d	1200V momentary
20 V	19 999	0.03 % · 1d	0.03 % · 1d	1200V
200 V	199 99	0.03 % · 1d	0.03 % · 1d	1200V
1200 V	1200 0	0.035 % · 1d	0.035 % · 1d	1200V

*Front panel zero

TEMPERATURE COEFFICIENT (0 - 18 C and 28 - 55 C): $\pm(0.005\% - 0.1 \text{ digit})/^\circ\text{C}$ except $\pm(0.005\% + 0.6 \text{ digit})/^\circ\text{C}$ on the 20mV range.

INPUT RESISTANCE: 10M Ω $\pm$ 0.5%.

NORMAL MODE REJECTION RATIO: Greater than 80dB on the 20mV range at 50Hz and 60Hz; greater than 60dB on all other ranges.

COMMON MODE REJECTION RATIO (1k Ω unbalance): Greater than 120dB at DC, 50Hz and 60Hz.

AC VOLTAGE

RANGE	MAXIMUM READING	ACCURACY (12 months)	
		18 - 28 C: 100Hz-10kHz (% rdg + digits)	(above 2000 counts) (% rdg + digits)
200mV	199 99	0.5 % · 15d	0.5 % · 15d
2 V	1 9999	0.5 % · 15d	0.5 % · 15d
20 V	19 999	0.5 % · 15d	0.5 % · 15d
200 V	199 99	0.5 % · 15d	0.5 % · 15d
1000 V	1000 0	0.5 % · 15d	0.5 % · 15d

EXTENDED FREQUENCY ACCURACY (45Hz-20kHz): $\pm(0.7\% + 15 \text{ digits})$

TEMPERATURE COEFFICIENT (0 - 18 C and 28 - 55 C; 45Hz-20kHz): $\pm(0.05\% + 2 \text{ digits})/^\circ\text{C}$

RESPONSE: True root mean square

CREST FACTOR: 3

INPUT IMPEDANCE: 1M Ω $\pm$ 1% shunted by less than 75pF.

MAXIMUM ALLOWABLE INPUT VOLTAGE: 1000V rms, 1400V peak, 10⁷V/Hz maximum.

COMMON MODE REJECTION RATIO (1k Ω unbalance): 60dB at DC, 50Hz and 60Hz.

RESISTANCE

RANGE	MAXIMUM READING	ACCURACY (12 months)		NOMINAL APPLIED CURRENT
		18 - 28 C (% rdg + digits)	TEMPERATURE COEFFICIENT 0 - 18 C and 28 - 55 C (% rdg + digits)/ $^\circ\text{C}$	
20 Ω *	19 999	0.05 % · 3d	0.004 % · 0.6d	1 mA
200 Ω *	199 99	0.05 % · 2d	0.004 % · 0.2d	1 mA
2k Ω	1 9999	0.04 % · 1d	0.004 % · 0.2d	1 mA
20k Ω	19 999	0.04 % · 1d	0.004 % · 0.2d	100 μA
200k Ω	199 99	0.04 % · 1d	0.004 % · 0.2d	10 μA
2000k Ω	1999 9	0.04 % · 1d	0.005 % · 0.2d	1 μA
20M Ω	19 999	0.10 % · 1d	0.02 % · 0.2d	0.1 μA

*Front panel zero

MAXIMUM ALLOWABLE INPUT: 350V peak

OPEN-CIRCUIT VOLTAGE: 5 volts

DC AND TRMS AC CURRENT

RANGE	MAXIMUM READING	ACCURACY (12 months) 18 – 28 C (% rdg + digits)		MAXIMUM VOLTAGE BURDEN
		DC*	AC 45Hz-10kHz (above 2000 counts)	
20μA	19 999	0.2% · 2d		0.02V
200μA	199 99	0.2% · 1d	0.8% · 15d	0.2 V
2mA	1 9999	0.2% · 1d	0.8% · 15d	0.2 V
20mA	19 999	0.2% · 1d	0.8% · 15d	0.2 V
200mA	199 99	0.2% · 1d	0.8% · 15d	0.25V
2000mA	1999 9	0.2% · 1d	0.8% · 15d	0.6 V

*Front panel zero

MAXIMUM INPUT: 2A, 250V DC or rms (fuse protected).

TEMPERATURE COEFFICIENT (0 - 18 C and 28 - 55 C): DC: $\pm(0.01\% + 0.2 \text{ digits})/^\circ\text{C}$ except $\pm(0.01\% + 0.6 \text{ digits})/^\circ\text{C}$ on the 20 μA range. AC: $\pm(0.07\% + 2 \text{ digits})/^\circ\text{C}$.

CREST FACTOR: 3

GENERAL

DISPLAY: Five 0.5" LED digits, appropriate decimal position and polarity indication.

CONVERSION PERIOD: 400 milliseconds.

OVERRANGE INDICATION: Display blinks all zeros above 19999 counts.

MAXIMUM COMMON MODE VOLTAGE: 1400V peak.

ANALOG OUTPUT: Output Voltage: 1V = 10000 counts.

Output Resistance: 5000 ohms.

ENVIRONMENT: Operating: 0 C to 55 C; 0% to 80% relative humidity up to 40 C. Storage: - 25 C to + 65 C.


CONNECTORS: Input: Binding posts. Output: Banana jacks.

POWER: 105-125 or 210-250 volts (switch selected), 90-110V available. 50-60Hz, 8 watts. Optional 6 hour battery pack, Option 06.

DIMENSIONS, WEIGHT: 85mm high x 235mm wide x 275mm deep (3 1/2 in. x 9 1/4 in. x 10 3/4 in.). Net weight: 1.7kg (4 pounds).

ACCESSORY AVAILABLE:

Option 06 Rechargeable Battery Pack: 6 hours operation from full charge, recharges within 14 hours. Field installable. Adds 0.9 kg. (2 lbs.), 7 watts

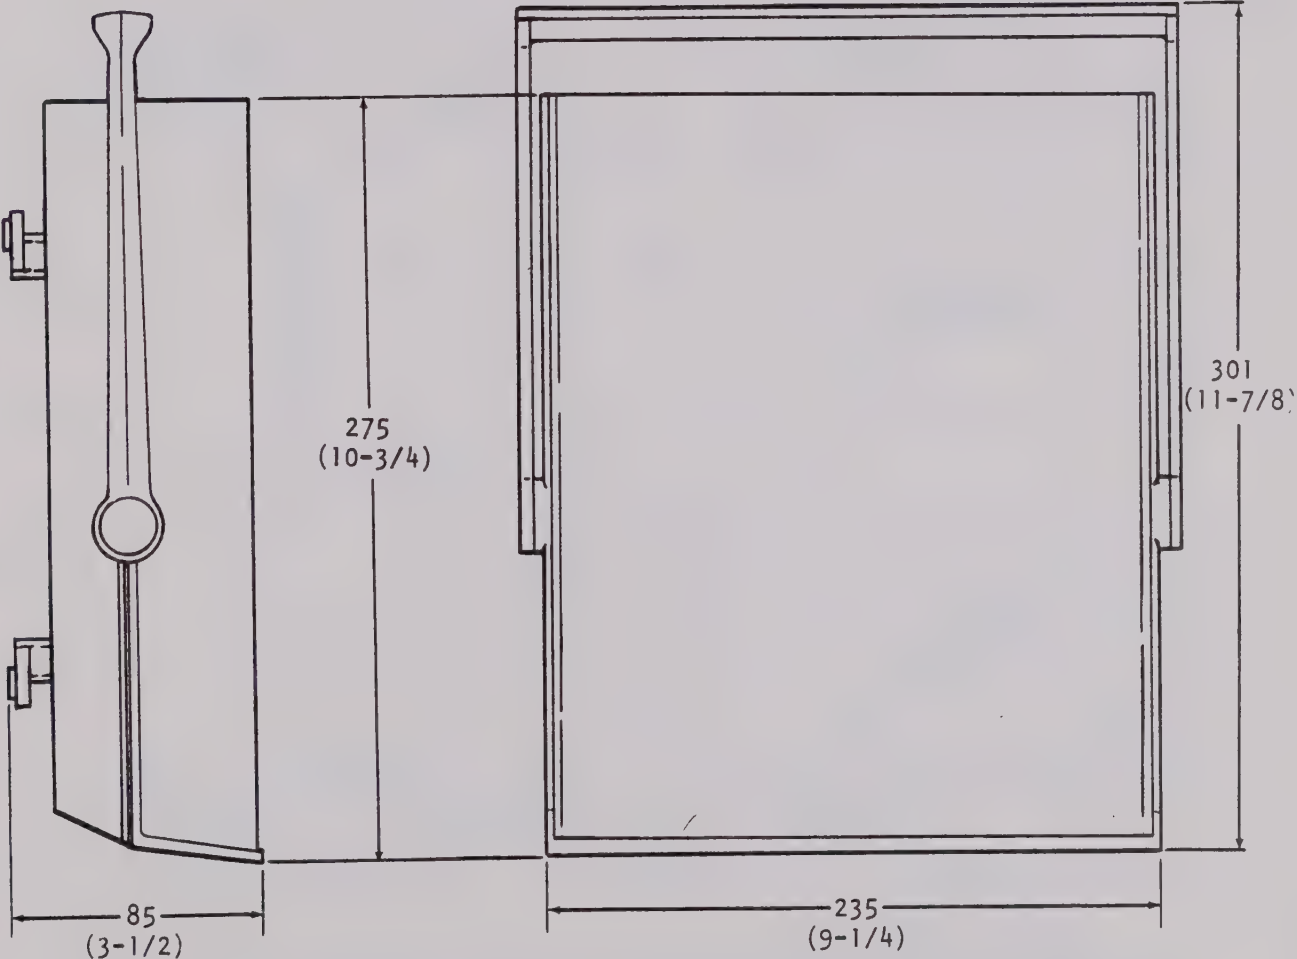

DIMENSIONS IN MILLIMETERS (INCHES)

FIGURE 1-2. Dimensional Data.

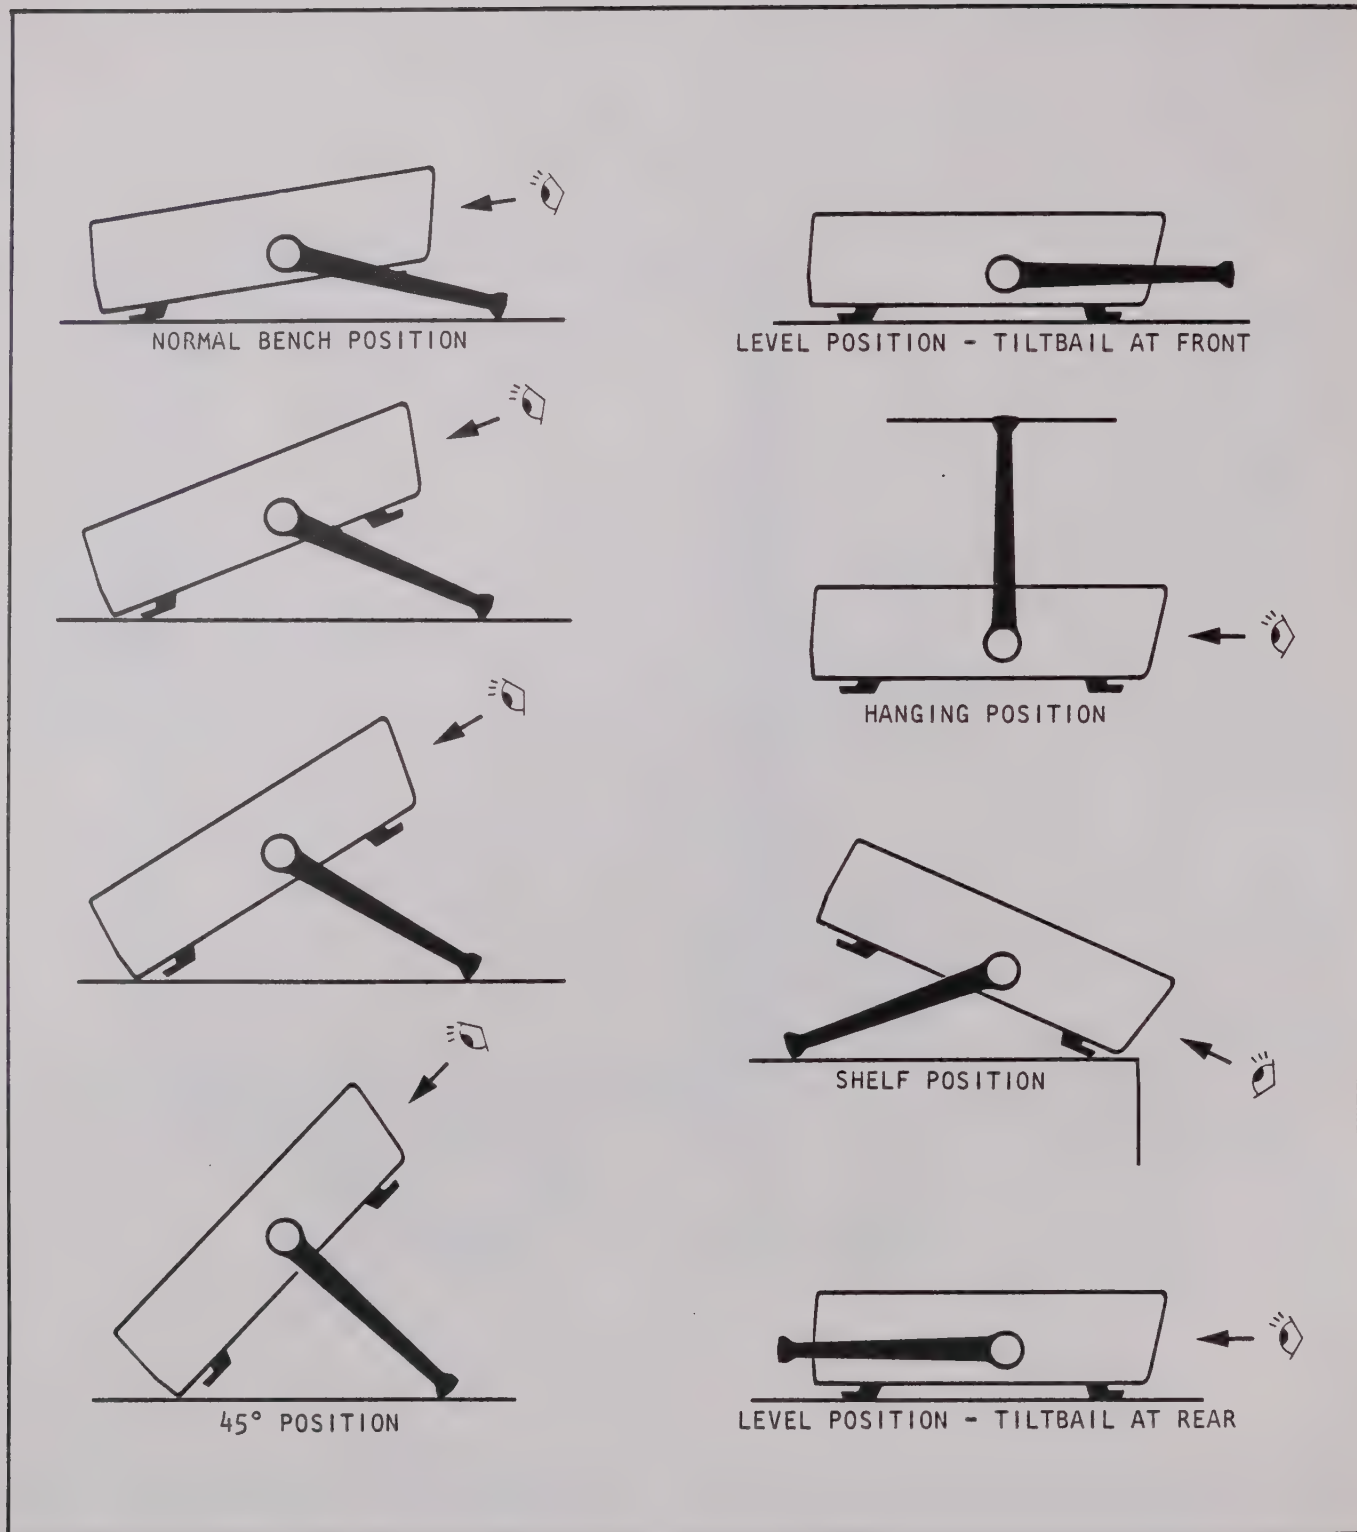


FIGURE 1-3. Tilt Bail Positions.

SECTION 2. OPERATION.

2-1. GENERAL. This section provides information needed for incoming inspection, preparation for use and operation of the Model 4003.

2-2. INSPECTION. The Model 4003 was carefully inspected both mechanically and electrically before shipment. Upon receiving the instrument, check for an obvious damage which may have occurred during transit. Report any damages to the shipping agent. To verify the electrical specifications, follow the procedures given in Section 3.

2-3. PREPARATION FOR USE. The Model 4003 is shipped ready-to-use on line power. The instrument may also be powered from rechargeable batteries (when the Option 06 Rechargeable Battery Set is installed.) See Paragraph 2-5 and 2-6 for installation and charging instructions.

2-4. OPERATION ON LINE POWER. The Model 4003 DMM is provided with a three-wire line cord which mates with third-wire grounded receptacles. Connect the instrument to ac line power as follows:

CAUTION



Connect only to the line voltage selected. Application of incorrect voltage can damage the instrument.

a. Set the LINE VOLTAGE switch on the back of the instrument to correspond to the line voltage available. Standard ranges are 105 to 125 volts and 210 to 250 volts ac as shown in Figure 2-1. Optional ranges of 90 to 110 volts and 180 to 220 volts ac are also available as shown in Figure 2-2. As indicated on their respective rear panels, the standard line voltage range instruments use an internal line fuse (F102) of 1/8A rating and the optional line voltage range instruments use a 3/16A fuse. The location of F102 is shown in Figure 2-3.

WARNING



Ground the instrument through a properly earth-grounded receptacle before operation. Failure to ground the instrument can result in severe injury or death in the event of short circuit or malfunction.

b. Plug the power cord into a properly grounded outlet. Operate the 4003 DMM as described in SECTION 2-7.

2-5. OPERATION ON BATTERY PACK POWER. The Model 4003 DMM may also be operated from rechargeable sealed lead-acid batteries contained in the Option 06 Battery Pack. The battery pack will operate the 4003 DMM for up to 6 hours. Circuits within the battery pack will automatically shut down the instrument when the battery charge is insufficient to maintain accurate readings. To install Option 06, refer to Figure 2-3 and perform the following procedure:

WARNING



Disconnect the line cord before removing the case cover.

a. Turn off the power and disconnect the line cord.

b. Turn the DMM bottom side up and loosen the four screws in the bottom cover. These screws are held captive by rubber O-rings.

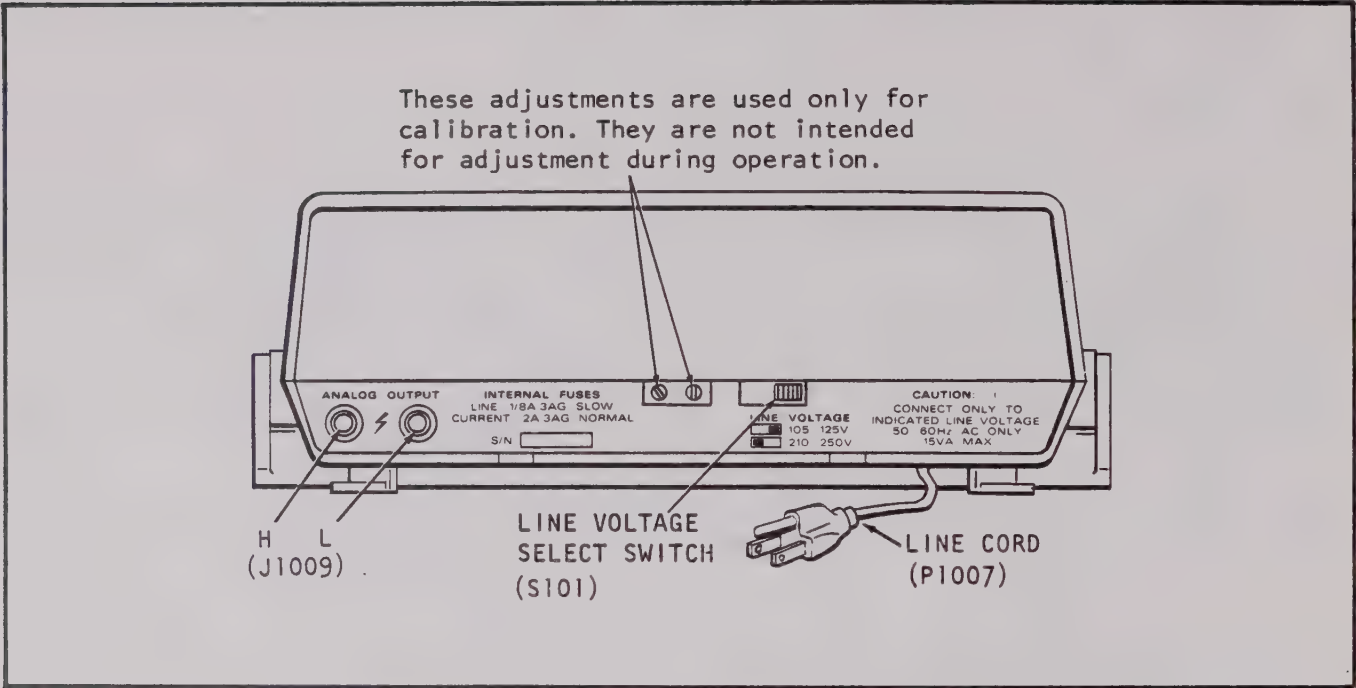


FIGURE 2-1. Rear View of Standard Line Voltage Instruments.

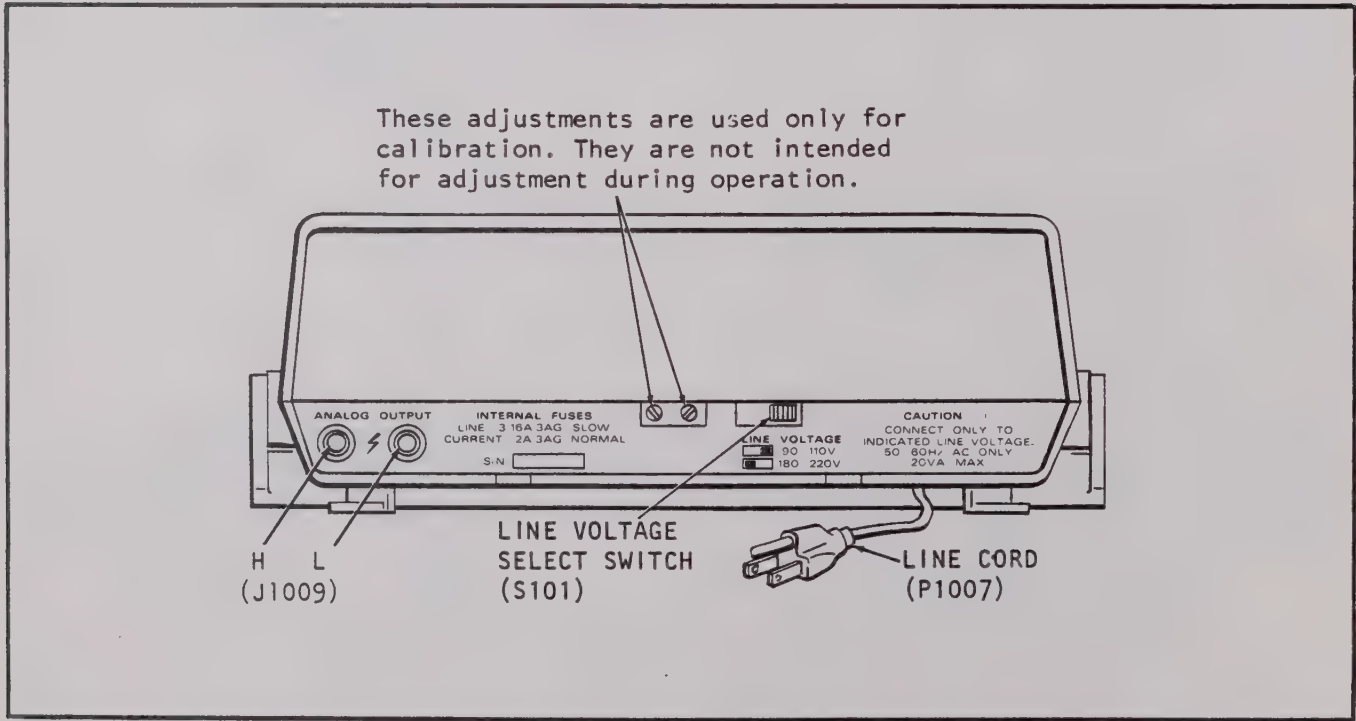


FIGURE 2-2. Rear View of Optional Line Voltage Instruments.

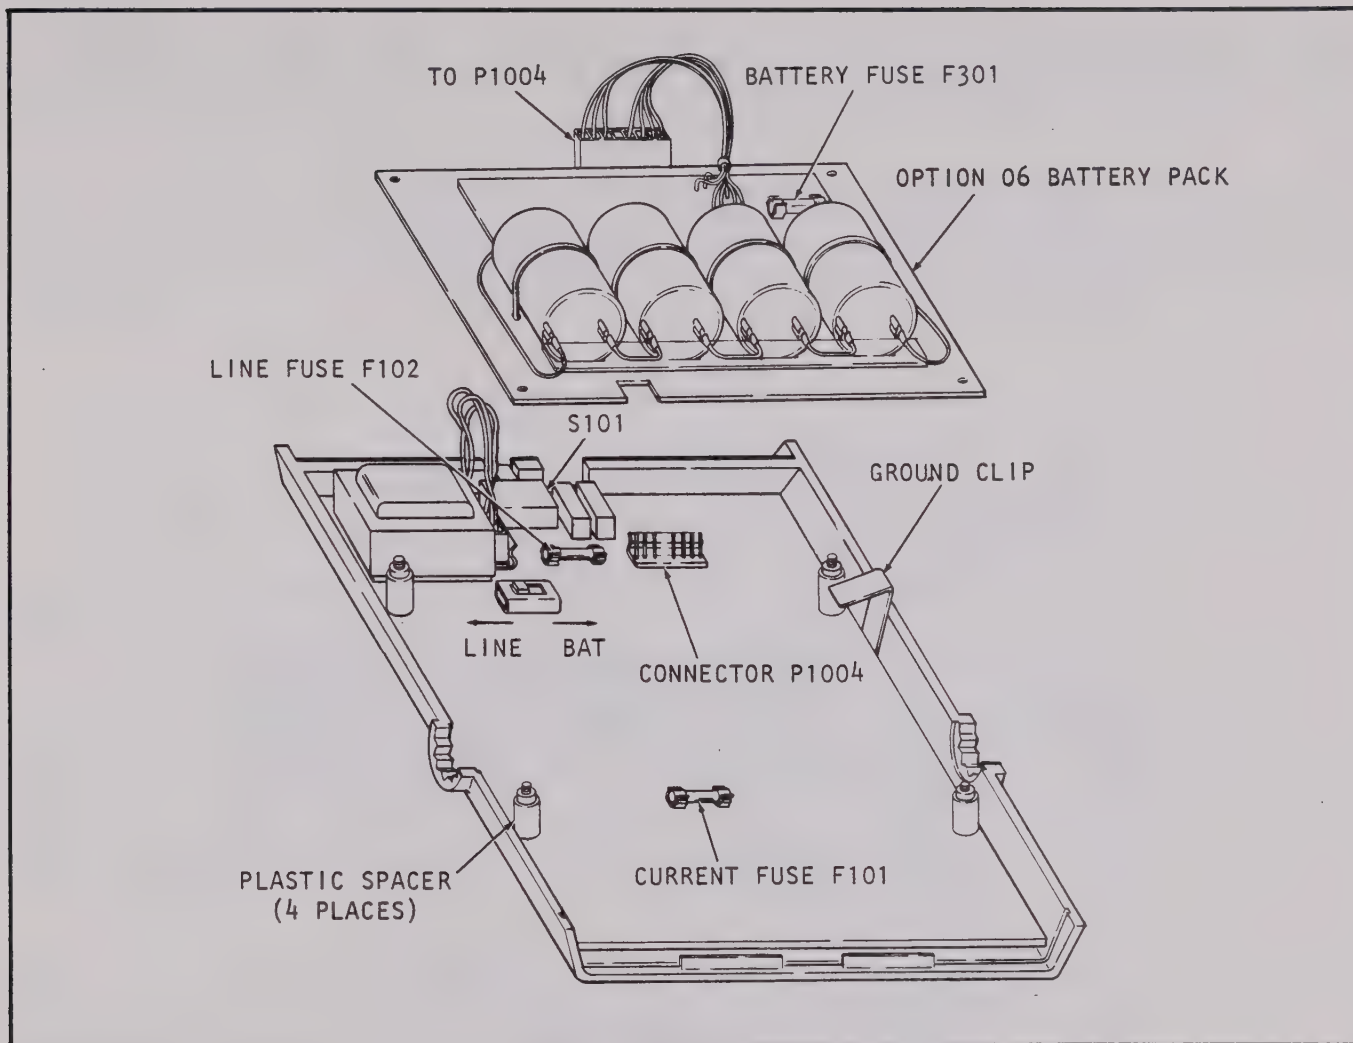


FIGURE 2-3. Battery Pack Installation.

c. Hold the top and bottom covers together to prevent their separation and turn the DMM over to normal position.

d. Lift off the top cover and the calibration shield. The four plastic spacers must remain in place on the upright studs projecting through the main printed circuit board.

NOTE

Do not discard the calibration shield. This shield must be installed during calibration, as described in Section 6.

e. Set the BAT/LINE switch to the BAT position shown in Figure 2-3. Note that the battery pack will not operate properly if this switch is not in the BAT position.

f. Remove the fuse F301 on the battery pack.

g. Install the battery pack in the instrument so that it rests on the plastic spacers. The ground clip must make contact with the upper side of the battery pack plate.

h. Carefully align the battery pack plug with connector P1004 on the circuit board. Push the plug firmly onto the connector until the lip on the plug engages the lip on the connector to lock the plug in place.

CAUTION

⚠ Make sure the connector is aligned so that all pins mate properly, otherwise, damage to the DMM and battery pack will result.

i. Install fuse F301. Reinstall top cover and secure with four screws.

j. Charge the battery pack as described in Paragraph 2-6.

TABLE 2-1.

DMM CONDENSED OPERATING INSTRUCTIONS					
TO OPERATE:					
① Set Power On ② Select Function ③ Select Range ④ Connect Source					
① POWER:					
Line: Set line switch on rear panel to applicable voltage range. (See manual for fuse location.)					
Battery: 6 hour operation after 14 hour charge with Option 06 field installable battery pack. (Note 1)					
SUMMARY OF FUNCTIONS, RANGES, AND OTHER INFORMATION					
② FUNCTION	③ RANGE (Note 2)	ACCURACY 18°C – 28°C (Note 1)	INPUT IMPEDANCE	④ MAX. INPUT (Note 1)	FRONT PANEL ZERO
DCV (---)	20mV	0.04% Rdg + 2D	10MΩ	1200V MOMENTARY	YES
	200mV	0.04% Rdg + 1D			
	2V	0.03% Rdg + 1D			
	20V				
	200V				
	1200V			0.035% Rdg + 1D	1200V
ACV (~) (Note 3)	200mV	0.5% Rdg + 15D 100Hz – 10kHz	1MΩ 75pF	1000V RMS 10 ⁷ V·Hz	
	2V				
	20V				0.7% Rdg + 15D 45Hz – 20kHz
	200V				
	1000V				
DCA	20μA	0.2% Rdg + 2D	0.02V BURDEN	2A, 250V DC OR RMS (Note 4)	YES
	200μA	0.2% Rdg + 1D	0.2V BURDEN		
	2mA		0.25V BURDEN		
	20mA				
	200mA				
	2000mA				
ACA (Note 3)	200μA	0.8% Rdg + 15D 45Hz – 10kHz	0.2V BURDEN	2A, 250V DC OR RMS (Note 4)	NO
	2mA		0.25V BURDEN		
	20mA				
	200mA				
	2000mA				
	Ω (OHMS)		20		
200		0.05% Rdg + 2D	200mV F.S.		
2k		0.04% Rdg + 1D	2V AT FULL SCALE 5V MAX OPEN CIRCUIT	NO	
20k					
200k					
2000k					
20M					0.1% Rdg + 1D
ANALOG OUTPUT: ±2V full scale, 5kΩ output resistance (Note 1).					
Note 1: See manual for detailed information.					
Note 2: Overrange is indicated by flashing 0000.					
Note 3: True root mean square, crest factor = 3.					
Note 4: Current fuse (installed internally) is 2A, 3AG normal blow. See manual for fuse location.					
DISCONNECT LINE CORD BEFORE SERVICING.					

2-6. BATTERY CHARGING. The Option 06 Battery Pack contains an integral battery charger. To charge or recharge the battery pack, install the battery pack in the 4003 DMM as described above and proceed as follows:

- a. Connect the instrument to line power as described in Paragraph 2-4.
- b. With the power switch off, the battery charge circuitry is automatically energized to charge the battery at the maximum rate. When the battery pack is first installed, or if it has completely discharged, allow it to charge for at least 14 hours in this condition.

NOTE

For maximum battery life, do not allow the battery pack to remain completely discharged. Constant charging will not harm either the battery pack or the instrument. The Model 4003 may be operated up to 6 hours from fully charged batteries. However, since 10 charge/discharge cycles may be required to reach full battery capacity, less than 6 hours DMM operation can be expected when the battery pack is first installed.

- c. When the Model 4003 is in use on line power, the battery charger maintains a trickle charge on the battery pack.

2-7. OPERATING INSTRUCTIONS. The basic operating instructions for the Model 4003 DMM are outlined below, and Condensed Operating instructions are provided on the bottom cover of the instrument and contained in Table 2-1. These instructions should only be used after becoming completely familiar with the operation of the Model 4003 through day-to-day use. Until this familiarity has been achieved, best performance and safest operation will be obtained by using the individual instructions provided in this section which describe how to make specific function measurements. Refer to Figure 2-4 and operate the DMM as follows:


- a. Turn on the power by depressing the ON/OFF pushbutton and allow a 10 minute warm-up time. Allow additional warm-up for zero stability on lowest DCV and Ω ranges.
- b. Select the function with the AC/DC, Ω , V, or A pushbuttons.
- c. Select the range by depressing the appropriate pushbutton.
- d. Connect the source to the INPUT terminals. Accessories described in Section 4 should be used as required.

CAUTION

MAXIMUM RATINGS:



DCV	(20mV, 200mV, 2V): 450V rms continuous; 1200V peak momentary, for up to 8 seconds per minute maximum. (20-1200V): 1200V peak.
ACV	(All Ranges): 1000V rms; 1400V peak; 10^7 V·Hz.
DCA, ACA	(All Ranges): 2A, 250V DC or rms (fuse protected).
Ω	(All Ranges): 350V peak, 250V rms.

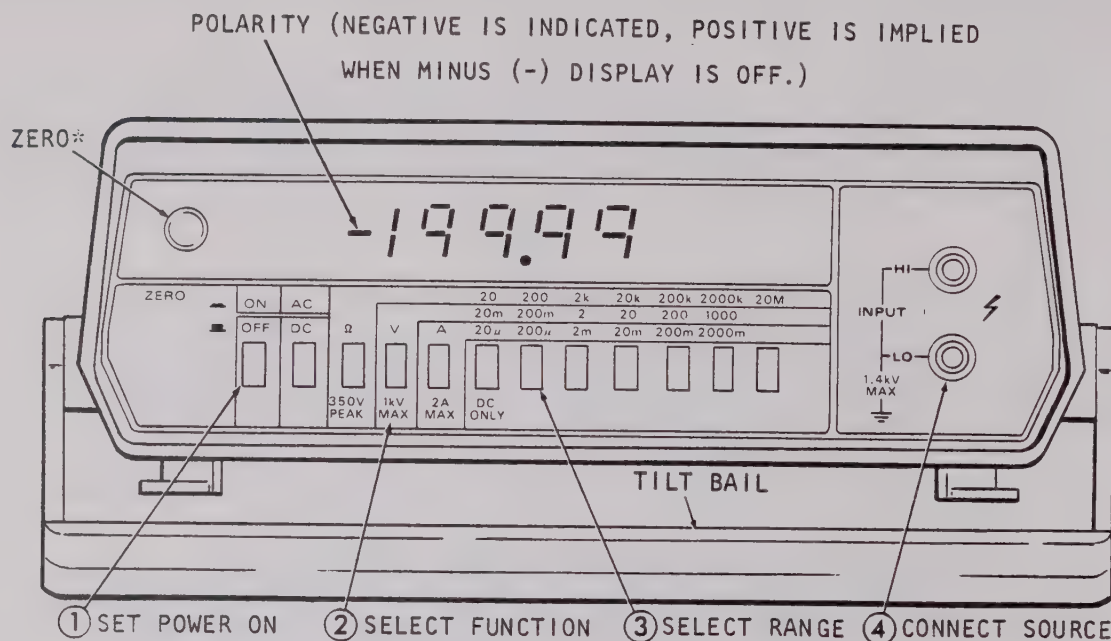

* SEE TEXT, PARAGRAPH 2-8.

FIGURE 2-4. Operating Controls.

2-8. ZERO ADJUSTMENT. The front panel zero adjustment provides compensation for test lead resistance and thermal emfs generated in the circuits connected to the DMM input terminals. The zero adjustment is operative on the 20mV and 200mV ranges of DCV, 20 and 200 Ω ranges and all DCA ranges. In general, the zero must be readjusted whenever the function is changed and the measurement is to be made on a range where the zero adjustment is operative. The accuracy specifications assume that the zero is adjusted on the lowest range of the function. Where applicable, a specific zero adjustment instruction is provided in the description of how to make the particular function measurement.

2-9. DC VOLTAGE MEASUREMENT. The Model 4003 detects dc voltages from 1 microvolt/digit to 1200 volts. The maximum displayed reading is 19999. Overrange is indicated by a flashing 0000 except on the 1200 volt range. On the 1200 volt range, the display can read beyond the maximum allowable input voltage. Use the Model 4003 to measure dc volts as follows:

CAUTION



Do not exceed the maximum input voltage ratings. Instrument damage may occur.

- a. Turn on power with the ON/OFF pushbutton and select DC with the AC/DC pushbutton.
- b. Select the desired range from the six ranges available. The decimal point is positioned by the range pushbutton. The 1200 VDC range is selected by the 1000 pushbutton.

NOTE

The 20M pushbutton is inoperative for dc volts. If this pushbutton is inadvertently depressed, the DMM will read zero regardless of the voltage applied and the 8 second per minute overload rating will apply.

c. Connect the signal to be measured between the INPUT HI and LO binding posts. The binding posts accept wires, spade lugs or banana plugs for ease of connecting the circuit to be measured. Low thermal cabling and connections are recommended for measurements on the 20mV and 200mV ranges.

d. For the top four ranges, merely observe the displayed digits, polarity sign and decimal point locations. The top four ranges are direct-reading in volts. Nominal settling time is 1 second to within 1 digit of final reading.

e. For the 20mV and 200mV ranges, the front panel ZERO must be adjusted to obtain rated accuracy. This adjustment is necessary to compensate for thermal EMF's generated by the connections to the circuit to be measured. These voltages may be only a few microvolts or several tens of microvolts. The zero adjustment span is set up at the factory to allow at least a $\pm 75\mu\text{V}$ adjustment. To adjust zero, proceed as follows:

NOTE

Due to the long thermal time constant of the 20mV range zero, a one hour warm-up time may be necessary to adjust zero to the final $1\mu\text{V}$ setting. Typically, only a one to three microvolt zero shift can be expected during this warm-up period, if the ambient temperature is within the specified 18° to 28°C and the instrument has not been subjected to temperatures outside of this range. Thus, since the expected zero shift is both small and slow, normally zero can be adjusted and several measurements taken without having to achieve the final zero setting.

- 1) Make connections to the Model 4003 as described in Step C above. For the best performance, connections should be made to the binding posts rather than using banana plugs.
- 2) Set the Model 4003 to the 20mV range.
- 3) Disconnect the leads at the circuit to be measured and short them.
- 4) Allow the thermal EMF's generated at the connections to stabilize.
- 5) Adjust the front panel ZERO knob for a display indication of 0.000 mV (a flashing ± 0.001 mV is permissible.)

NOTE

The ZERO control operates only on the 20mV and 200mV ranges. It has no effect on the other DC voltage ranges.

- 6) Make the measurement by applying the signal and reading the millivolts on the display. Nominal settling time for the 20mV range is 3 seconds to within 1 digit of final reading.

NOTE

An overload input to the Model 4003 may cause temporary zero shift due to thermal gradients.

7) The zero setting for the 20mV range will also be valid for the 200mV range. Nominal setting time for the 200mV range is 1 second to within 1 digit of final reading.

2-10. AC VOLTAGE MEASUREMENT. The Model 4003 detects ac voltages from 10 microvolts to 1000 volts. The instrument measures the true root means square (TRMS) of a signal within the frequency range of 45 to 20k hertz. The maximum reading is 19999. Overrange is indicated by a flashing 0000 except on the 1000 volt range. On the 1000 volt range, the display can read beyond the maximum allowable input voltage. The maximum crest factor for rated accuracy is 3. AC accuracy is specified for 2000 counts and above. Nominal settling time for all ac voltage ranges is 2.5 seconds to within 10 digits of final reading. Use the Model 4003 DMM to measure ac volts as follows:

a. Turn on power and set the AC/DC pushbutton to the in or AC position. Depress the V pushbutton.

NOTE

The 20 μ and 20M ranges are inoperative for ac volts. If the 20 μ pushbutton is inadvertently depressed, the display will read overrange, signalling the user to go to the next higher range. If 20M is depressed, the display will read zero regardless of the voltage applied. The method of calibrating the converter may yield an offset up to 80 digits with the Model 4003 input shorted. This does not affect the instrument accuracy.

b. Select the desired range from the five ranges available.

CAUTION

 MAXIMUM ALLOWABLE INPUT VOLTAGE (All ranges): 1000V rms, 1400V peak, 10⁷V·Hz maximum. Do not exceed the maximum rating. Instrument damage may occur.

c. Connect signal to be measured between INPUT HI and LO terminals. Observe the displayed digits and decimal point location. The 200mV range is direct-reading in millivolts and the remaining four ACV ranges are direct-reading in volts.

d. The crest factor (CF) is the ratio of the peak voltage to the rms voltage as follows

$$CF = \frac{V_{PEAK}}{V_{RMS}}$$

NOTE

There will be some additional measurement error for signals with a crest factor greater than 3 (CF>3).

1) Typical crest factors are as follows:

Sine Wave CF = 1.4

Square Wave CF = 1

Triangular Wave CF = 1.7

Positive pulse train CF = $\sqrt{1/\text{duty cycle}}$
(duty cycle for CF = 3 is 0.11)

e. Refer to Paragraph 2-14 for TRMS measurements of a signal with both ac and dc components.

2-11. RESISTANCE (Ω) MEASUREMENT. The Model 4003 DMM measures resistance from 1 milliohm/digit to 20 megohms. See Table 2-2 for ranges. Nominal settling times to within 1 digit of final reading are: 3 seconds on the 20 Ω range; 2 seconds on the 2000K Ω and 20M Ω ranges; and 1 second on the other four Ω ranges. Use the Model 4003 to measure resistance as follows:

a. Turn on power and depress the Ω pushbutton.

CAUTION

 MAXIMUM ALLOWABLE INPUT VOLTAGE (All ranges): 350V peak, 250V rms. Do not exceed maximum rating. Instrument damage may occur.

b. Connect the circuit to be measured to the INPUT binding posts and select the desired range from the seven available.

TABLE 2-2
Resistance Ranges

RANGE SETTING	MAXIMUM READING	FULL SCALE VOLTAGE **	NOMINAL APPLIED CURRENT
20 Ω *	19.999	20mV	1mA
200 Ω *	199.99	200mV	1mA
2K Ω	1.9999	2 V	1mA
20K Ω	19.999	2 V	100 μ A
200K Ω	199.99	2 V	10 μ A
2000K Ω	1999.9	2 V	1 μ A
20M Ω	19.999	2 V	0.1 μ A
*FRONT PANEL ZERO	ALL RANGES		
	OVERRANGE: FLASHING 0000	OPEN CIRCUIT: 5V MAX.	MAXIMUM ALLOWABLE INPUT: 350V PEAK
** HI binding post (red) is negative.			

c. Merely observe the displayed digits and decimal point to measure resistance using the 2K, 20K, 200K, 2000K and 20M Ω ranges. The full scale voltage drop for these ranges is 2 volts which is sufficient to cause forward conduction of semiconductor junctions. The HI (Red) terminal is negative. To measure a resistance in parallel with a semiconductor junction without turning on the junction, either reverse bias the junction or select the next higher Ω range. The latter method is possible because of the 1 decade reduction of applied test current, but will result in a measurement with 3-1/2 digit accuracy. It is suggested that the 2K Ω range be used for diode testing. This range has a nominal 1mA test current and the displayed reading is the forward voltage drop in volts.

NOTE

The front panel ZERO control operates only on the 20 Ω and 200 Ω ranges. It has no effect on the other resistance ranges.

d. Before making measurements on the 20 Ω or 200 Ω ranges, adjust front panel ZERO on the 20 Ω range to compensate for test lead resistance. Best performance will be obtained on the low ohm ranges when test lead connections are made to the binding posts, rather than using banana plugs. Adjust ZERO and make resistance measurements as follows:

- 1) Select 20 Ω range.
- 2) Disconnect the test leads at the circuit to be measured and short them. If measurement is to be made right at the INPUT terminals (no test leads used) place a short, such as a piece of copper wire, across the binding posts.
- 3) Adjust the front panel ZERO knob for a display indication of $0.000 \pm 0.001\Omega$ (flashing). The nominal ZERO adjustment span is 200m Ω .

NOTE

The specified accuracy for the 20 Ω and 200 Ω ranges assumes that ZERO was adjusted on the 20 Ω range. Re-adjust zero on the 20 Ω range each time that a different set of test leads is used or whenever measurements have been made on either the two lowest dc voltage ranges or any dc current range. The zero setting for those measurements will be different than the zero setting of ohms. Also, re-adjust zero whenever the instrument is used outside the temperature range of 18° to 28°C.

- 4) Reconnect the test leads to the circuit to be measured.
- 5) Select either 20 Ω range or 200 Ω range. Read the displayed digits and decimal point.

NOTE

An input overload to the Model 4003 may cause a temporary zero shift due to thermal gradients.

2-12. DC CURRENT MEASUREMENT. The Model 4003 DMM measures dc current from 1nA/digit to 2 amperes, over 6 ranges (the 20M range is not operative and the instrument will read zero if 20M pushbutton is depressed). The maximum reading is 19999. Overrange is indicated by a flashing 0000. Overload is protected by fuse F101, a 2 amp 3AG normal-blow fuse. Nominal settling time for dc current ranges is 1 second to within 1 digit of final reading except 3 seconds on 20 μ A range.

a. Zero Adjustment. Before making dc current measurements, the front panel ZERO must be adjusted on the 20 μ A range. This adjustment is necessary to remove any offset that was introduced by adjusting ZERO for a low dc voltage measurement or a low Ω measurement. This adjustment will also be necessary whenever the instrument is used outside of the temperature range of 18 to 28°C. The specified accuracy for the dc current ranges assumes that ZERO was adjusted on the 20 μ A range. Adjust ZERO as follows:

- 1) Disconnect all circuits from the Model 4003 INPUT terminals. The INPUT terminals must have an open circuit.
- 2) Turn on power and set the AC/DC pushbutton to the out or DC position.
- 3) Depress A and 20 μ pushbuttons.
- 4) Adjust front panel ZERO knob for a display indication of 0.000 μ A $\pm$.001 flashing.

b. After adjusting ZERO, use the Model 4003 to measure dc current as follows:

CAUTION



Do not install a larger capacity fuse than the one originally supplied (2A). Current fuse F101 (shown in Fig. 2-3) protects the instrument against overcurrent.

- 1) Select the desired range from the six ranges available.
- 2) Connect the circuit to be measured to the INPUT terminals.
- 3) Read the displayed polarity, digits and decimal point. Select the next higher range if overrange is indicated.

2-13. AC CURRENT MEASUREMENT. The Model 4003 measures ac current from 10nA/digit to 2 amperes, over five ranges. (The 20 μ A and 20M ranges are not operative. See note below.) The 200 μ A range is direct-reading in microamperes. The remaining ac current ranges are direct-reading in milliamperes. The maximum reading is 19999. Overrange is indicated by a flashing 0000. Overload is protected by fuse F101, a 2A, 3AG normal-blow fuse. The instrument measures the true root mean square (TRMS) of waveforms in the frequency range of 45 to 10K hertz. Use the Model 4003 to measure ac current as follows:

a. Turn on power and set the AC/DC pushbutton to in or AC position. Depress the A pushbutton.

CAUTION



Do not install a larger capacity fuse than the one supplied (2). Current fuse F102 (shown in Fig. 2-3) protects the instrument against overcurrent.

b. Connect the circuit to be measured to the INPUT terminals and select the desired range from the five ranges available.

NOTE

The 20 μ A and 20M ranges are not operative for ac current measurements. If the 20 μ A pushbutton is inadvertently depressed, an overrange will be indicated, signaling the user to go to the next higher range. If the 20M pushbutton is depressed, the instrument will read zero.

- c. Read the displayed digits and decimal point.

NOTE

AC accuracy is specified for 2000 counts and above. The method of calibrating the converter may yield an offset up to 80 digits with the Model 4003 input shorted. This does not affect the instrument accuracy. There will be some additional measurement error for signals with a crest factor greater than 3 (CF>3). Refer to AC Voltage Measurement (Paragraph 2-10d) for information on how to determine the crest factor of a waveform.

- d. Refer to Paragraph 2-14 for TRMS measurements of a signal with both ac and dc current components.

2-14. TRMS MEASUREMENT (AC + DC). The Model 4003 measures the ac component of a waveform and does not measure the dc component. Use the Model 4003 to measure TRMS of a signal which has both ac and dc components as follows:

- a. Measure and record the ac and dc components separately.

- 1) Refer to Paragraph 2-9 for DC Voltage Measurement.
- 2) Refer to Paragraph 2-10 for AC Voltage Measurement.
- 3) Refer to Paragraph 2-12 for DC Current Measurement.
- 4) Refer to Paragraph 2-13 for AC Current Measurement.

- b. Compute the TRMS value using the following equation:

$$E_{\text{TRMS}} = \sqrt{E_{\text{DC}}^2 + E_{\text{AC}}^2} \quad \text{OR} \quad I_{\text{TRMS}} = \sqrt{I_{\text{DC}}^2 + I_{\text{AC}}^2}$$

2-15. ANALOG OUTPUT. The rear panel accessible ANALOG OUTPUT provides a $\pm 2\text{V}$ full scale dc signal (10K counts = 1 volt). The ANALOG OUTPUT is operable for all instrument ranges and functions. The output polarity of the analog voltage is negative for the ohms (Ω) function, positive for AC function and non-inverting for DC functions. The effective analog output resistance is $5\text{K}\Omega$ ($4\text{K}\Omega$ in series with the HI output to protect the Model 4003 against externally applied voltage and $1\text{K}\Omega$ between input L0 and analog output L0 to prevent a ground loop when connection is made to a grounded load, oscilloscope or recorder). The analog output voltage is compatible with most modern analog recorders and may be used to determine signal changes with respect to time or other variables. With respect to the signal input and analog output, the Model 4003 acts as an amplifier (for microvolt signals), an attenuator (for kilovolt signals) or a converter to dc volts (for ac, current or resistance signals). Output accuracy is the same as the display except on ohms, up to $\pm 0.05\%$ error can be expected due to the ratio-metric method used. The analog output floats at input L0. For this reason, do not connect a voltage source across INPUT L0 and ANALOG L0. This will result in a measurement error and may damage the Model 4003 if the voltage is greater than 15 volts. When the instrument is in an overrange condition, up to ± 15 volts dc may be at the ANALOG OUTPUT dependent upon the function, range and level of the input signal.

SECTION 3. PERFORMANCE VERIFICATION.

3-1. GENERAL. Performance verification may be performed upon receipt of the instrument to ensure that no damage or misadjustment has occurred during transit. Verification may also be performed whenever there is question of the instrument's accuracy, and following calibration, if desired.

NOTE

For instruments that are still under warranty (Less than 12 months since date of shipment), if the instrument's performance falls outside specifications at any point, contact your Racal-Dana representative or the factory immediately.

3-2. RECOMMENDED TEST EQUIPMENT. Recommended test equipment for performance verification is listed in Table 3-1. Alternate test equipment may be used. However, if the accuracy of the alternate test equipment is not at least 10 times better than the instrument specifications, additional allowance must be made in the readings obtained. Some of the equipment listed in Table 3-1 is not 10 times better than the 4003 specifications because such equipment is not readily available. In these instances, the verification procedures indicate the equipment manufacturer's specified uncertainty, and include the uncertainty in determining the allowable reading for the Model 4003.

3-3. ENVIRONMENTAL CONDITIONS. All measurements should be made at an ambient temperature within the range of 18° to 28°C (65° to 82°F), and a relative humidity of less than 80%.

3-4. PERFORMANCE VERIFICATION PROCEDURE. Use the following procedures to verify the basic accuracy of the Model 4003 DMM for voltage, resistance and current measurements. If the instrument is out of specifications at any point, perform a complete calibration as described in Section 6, unless the instrument is still under warranty, as noted above.

TABLE 3-1.
Recommended Test Equipment For Performance Verification.

ITEM	DESCRIPTION	SPECIFICATION	MFR.	MODEL
A	DC Calibrator	0.19V, 1V, 10V, 100V, 1000V ±0.002% or 20μV	Fluke	343A
B	AC Calibrator	0.1V, 1V, 10V, 100V ±0.022%	H-P	745A
C	AC Calibrator/Amplifier	1000V @ ±0.04%	H-P	745A/746A
D	Decade Resistor	190Ω, 1.9KΩ, 19KΩ, 190KΩ, 1.9MΩ, 10MΩ, ±0.01%	ESI	RS725
E	Current Source	100μA, 1mA, 10mA, ±0.006%	Fluke	3330B
F	Current Source	100mA, 1A, ±0.02%	Fluke	382A
G	100Ω Per Step 4-Terminal Low Thermal Resistor	10:1 divider within 50 PMM	ESI	SR1010

NOTE

Performance verification should be performed by qualified personnel using accurate and reliable test equipment.

a. Initial Conditions. Before beginning the verification procedure the instrument must meet the following conditions:

- 1) If the instrument has been subjected to extremes of temperature, allow internal temperatures to stabilize for one hour minimum at the environmental conditions specified in Paragraph 3-3.
- 2) Turn on the 4003 DMM and allow it to warm up for 1 hour. The instrument may be operated from either line power or from battery pack power, as long as the battery pack has been fully charged as described in Paragraph 2-6.

WARNING



Some procedures require the use of high voltage. Take care to prevent contact with live circuits which could cause electrical shock resulting in injury or death.

b. DC Voltage Accuracy Check (2V to 1200V Ranges).

- 1) Select dc voltage function with the AC/DC and V pushbuttons.
- 2) Connect the DC Calibrator (Item A, Table 3-1) to the instrument.
- 3) Select the 2V range, and apply positive 2Vdc to the DMM. The reading must be within the limits specified in Table 3-2.
- 4) Select each remaining range and apply required voltage specified in Table 3-2. Verify that the reading is within specifications.
- 5) Repeat all checks with negative voltage.

TABLE 3-2.

DC Voltage Performance Check (2V to 1200V Range)

Range	Applied Voltage	Allowable Readings at 18° to 28°C
2 V	1.0000 V	0.9996 to 1.0004
20 V	10.000 V	9.996 to 10.004
200 V	100.00 V	99.96 to 100.04
1200 V	1000.0 V	999.5 to 1000.5

c. DC Voltage Accuracy Check (20mV and 200mV Ranges).

- 1) Select DCV and 20mV range.
- 2) Disconnect test leads at the DC Calibrator (A) and short them. Adjust Model 177 front panel ZERO for a display indication of 0.000mV $\pm$ 0.001mV flashing.
- 3) Connect the DC Calibrator and select 200mV range.

- 4) Set the DC Calibrator to an output of +0.190000V.
- 5) Verify that the Model 4003 reading is between +189.89 to +190.11mV. Note that the allowable reading includes a ± 2 digit allowance for the uncertainty of the DC Calibrator (A).
- 6) Repeat steps 4 and 5 with negative voltage.
- 7) Select 20mV range.
- 8) Connect the DC Calibrator (A), Low Thermal Resistor (G) and Model 4003 as shown in Figure 3-1.
- 9) Temporarily disconnect the test leads from the DC Calibrator and short them. Adjust Model 4003 front panel ZERO for a display indication of 0.000 ± 0.001 mV flashing.
- 10) Set the DC Calibrator to an output of +0.190000V.
- 11) Verify that the Model 4003 reading is between +18.987 and +19.013mV. Note that the allowable reading includes ± 2 digits for DC Calibrator (A) uncertainty and ± 1 digit for Low Thermal Resistor (G) uncertainty.
- 12) Repeat steps 10 and 11 with negative voltage.

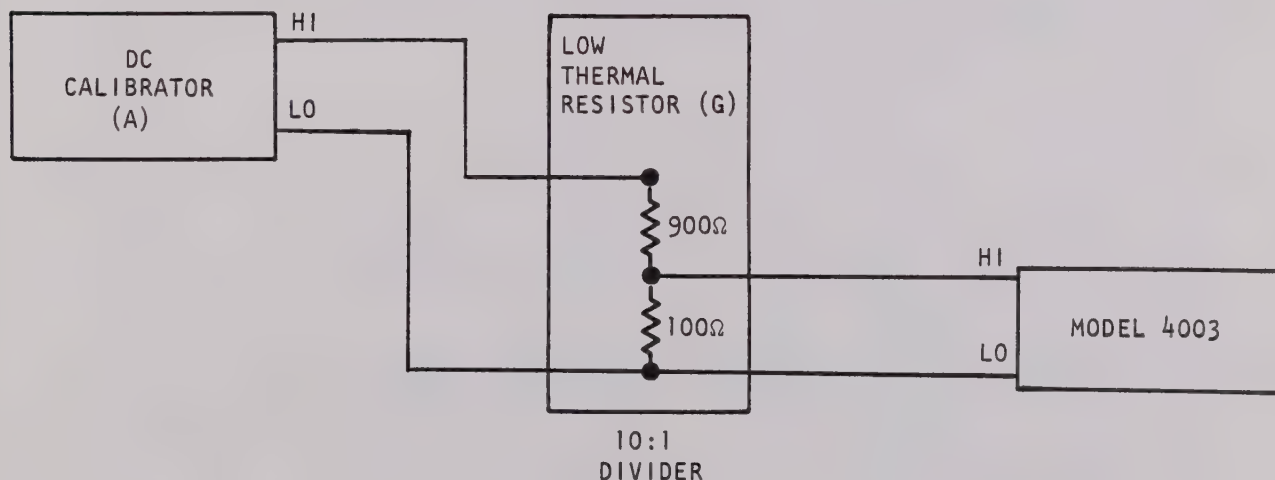


FIGURE 3-1. Test Circuit For 20mV DC Accuracy Check.

d. AC Voltage Accuracy Check.

- 1) Select ac voltage function with the AC/DC and V pushbuttons.
- 2) Connect the AC Calibrator (Item B, Table 3-1) to the DMM. Set the calibrator frequency to 1 kHz.
- 3) Set the DMM to the 200mV range and apply 100mV ac to the DMM. The reading must be within the limits specified in Table 3-3.
- 4) Select the 2, 20 and 200 volt ranges and apply the required voltages as specified in Table 3-3. Verify that the readings are within specifications.
- 5) To check 1000 volt range, connect the AC Calibrator Amplifier (Item C, Table 3-1) to the output of the AC Calibrator per the manufacturer's instructions. Connect the Amplifier output to the Model 4003 INPUT terminals. Set the AC Calibrator for Amplifier output of 1000.000 volts @ 1 kHz. Verify that the DMM reading is within the specified limits in Table 3-3.
- 6) To Check accuracy at 45 Hz and 20 kHz, select the 20 volt range. Apply the voltage specified in Table 3-3 at 45 Hz, then repeat at 20 kHz. Verify that the DMM readings are within the specified limits.

TABLE 3-3.
AC Voltage Accuracy Check.

Range	Applied Voltage	Allowable Readings at 18° to 28°C
	<u>@ 1kHz</u>	
200 mV	100.00 mV	99.35 to 100.65 mV
2 V	1.0000 V	0.9935 to 1.0065 V
20 V	10.000 V	9.935 to 10.065 V
200 V	100.00 V	99.35 to 100.65 V
1000 V	1000.0 V	993.5 to 1006.5 V
	<u>@ 45Hz</u>	
20 V	10.000 V	9.915 to 10.085 V
	<u>@ 20kHz</u>	
20 V	10.000 V	9.915 to 10.085 V

e. Resistance (Ω) Accuracy Check.

- 1) Select resistance function by depressing Ω pushbutton.
- 2) Select 200 Ω range.
- 3) Connect the decade resistor (Item D, Table 3-1) to the DMM.
- 4) Set the decade resistor to zero and compensate for lead resistance by adjusting front panel ZERO for a display indication $00.00 \pm 0.01 \Omega$ flashing.
- 5) Set the decade resistor to 190 Ω . Verify that the reading for the 200 Ω range is within the limits specified in Table 3-4.
- 6) Select the 2k Ω range.
- 7) Set the decade resistor to zero and measure the resistance of the test leads. Subtract this reading from the displayed reading in all of the following steps.
- 8) Set the decade resistor to 1.900K Ω . Verify that the reading is within the limits specified in Table 3-4.
- 9) Continue by selecting the next range and measure the next resistance as specified in Table 3-4. Test each item in the table and verify that each reading is within specifications.

TABLE 3-4.
Resistance Accuracy Check.

RANGE	RESISTANCE	ALLOWABLE READING AT 18° to 28°C	*
200 Ω	190 Ω	189.86 to 190.14 Ω	± 2 digits
2K Ω	1.900 K Ω	1.8989 to 1.9011 K Ω	± 2 digits
20K Ω	19.000 K Ω	18.989 to 19.011 K Ω	± 2 digits
200K Ω	190.00 K Ω	189.89 to 190.11 K Ω	± 2 digits
2000K Ω	1900.0 K Ω	1898.9 to 1901.1 K Ω	± 2 digits
20M Ω	10.000 M Ω	9.988 to 10.012 M Ω	± 1 digits
* Manufacturer's specified uncertainty of the decade resistor (D) in digits. This uncertainty has been added to the specified accuracy of the Model 4003 to obtain the allowable reading.			

f. DC Current Accuracy Check.

- 1) Select the dc current function with the AC/DC and A pushbutton.
- 2) Select the 20 μ A range. With an open circuit at the INPUT terminals of the Model 177, adjust the front panel ZERO for a display indication of 0.000 $\pm$ 0.001 μ A flashing.
- 3) Connect the dc current source (Item E or F, Table 3-1) to the DMM.
- 4) Select each range and apply the required current as specified in Table 3-5. Verify that each reading is within specifications.

g. Analysis. If the instrument is out of specified limits at any point in Table 3-2 through 3-5, calibrate the DMM as described in Section 6. If the unit is still under warranty, refer to the note in Paragraph 3-1.

TABLE 3-5.
DC Current Accuracy Check.

Range	Applied Current	Allowable Reading at 18° to 28°C
200 μ A	100.00 μ A	99.79 to 100.21 μ A
2 mA	1.0000 mA	0.9979 to 1.0021 mA
20 mA	10.000 mA	9.979 to 10.021 mA
200 mA	100.00 mA	99.79 to 100.21 mA
2000 mA	1000.0 mA	997.9 to 1002.1 mA

NOTE

It is not necessary to specifically check 20 Ω or 20 μ A ranges, or any of the ACA ranges. The circuit components that determine their accuracy have been checked elsewhere in the verification procedure.

SECTION 4. ACCESSORIES.

4-1. POWER OPTIONS. The Model 4003 can be powered by line voltage (105-125V@ 50-60Hz or 210-250V@ 50-60Hz - Standard ranges) or the Option 06 Rechargeable Battery Pack. (Optional line voltage ranges are described in Section 2). Option 06 is available factory-installed or field-installable. Installation and operating instructions are given in Section 2.

SECTION 5. THEORY OF OPERATION.

5-1. GENERAL. This section contains circuit descriptions for the Model 4003 DMM and the Option 06 Battery Pack. An overall block diagram of signal flow is provided in Figure 5-1. The schematic diagrams are contained in Section 7 of this manual.

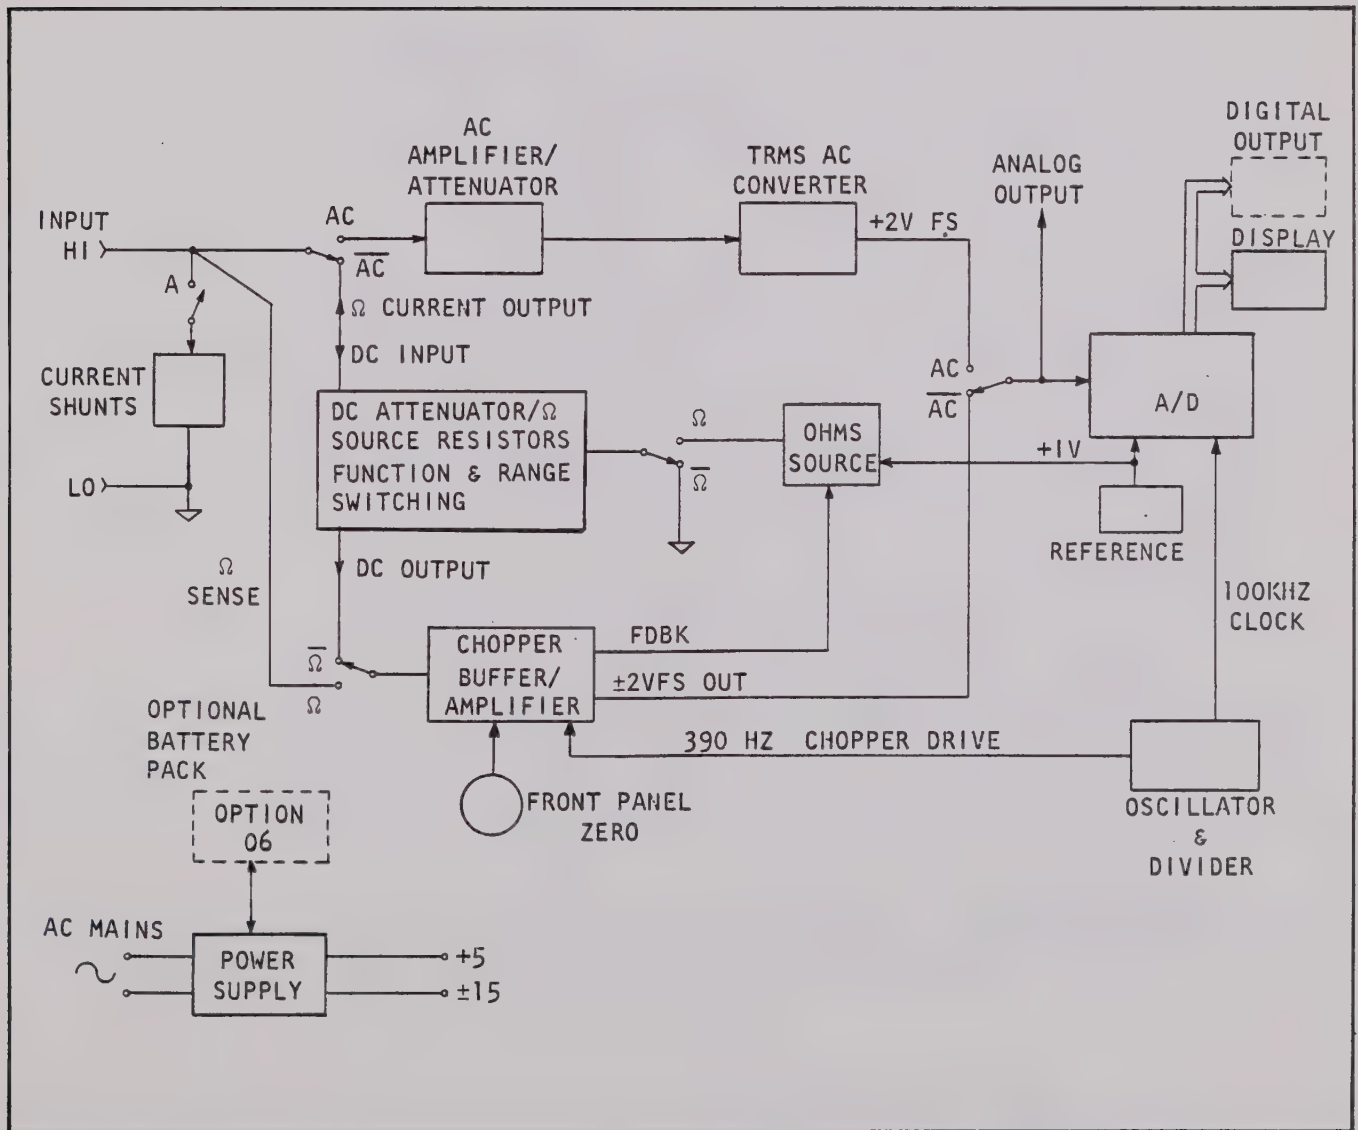


FIGURE 5-1. Simplified Signal Flow Block Diagram.

5-2. OVERALL OPERATION. The Model 4003 DMM uses a 2-volt (20,000 count) full scale analog-to-digital (A/D) converter with a 4-1/2 digit multiplexed display. Signal conditioning permits the A/D converter to accommodate full scale dc voltage and current measurements over 6 ranges, ac voltage and current measurements over 5 ranges and resistance measurements over 7 ranges.

a. Signal Conditioning. Signal conditioning includes dc attenuation (on the 20, 200 and 1200 volt ranges), modulation and demodulation of the DC signal by the chopper buffer/amplifier with X100 and X10 gain (on the 20 and 200 mV ranges, respectively), ac attenuation (on the 20, 200 and 1000 volt ranges), ac amplification (on the 200 mV and 20 volt ranges), ac-to-dc conversion, ohms source and conversion, and current shunts as shown in Figure 5-1.

1) In the DCV mode, signal conditioning to the A/D converter consists of range and function switching, range resistors (attenuator) and the chopper buffer/amplifier. For all ranges, the dc input signal is attenuated/amplified to provide a ± 2 volt full scale output to the A/D converter. In the DCA mode, the voltage developed across the shunt resistor is applied direct to the input of the chopper amplifier. A chopper gain of X10 is used for all ranges except 20 μ A which uses X100.

2) In the ACV mode, ac inputs for all ranges pass through the ac converter which consists of an amplifier/attenuator and a TRMS converter, as shown in Figure 5-2. The ac input is scaled by the amplifier/attenuator to 2 volts rms full scale for all ranges. The TRMS converter provides a positive dc output signal which is proportional to the true root mean square ac signal. This dc signal is the input to the A/D converter. In the ACA mode, the shunt voltage is applied to the input of the ac converter. The amplifier/attenuator provides a X10 gain for all ac current ranges.

3) Ohms conversion. Resistance measurements are made by supplying a constant current from the ohms converter to the unknown resistor (R_x). The resulting voltage developed across the unknown resistor is proportional to its resistance, and this voltage is applied to the input of the chopper amplifier used for dc volts. The chopper amplifier output to the A/D converter is scaled to ± 2 volts full scale for all ohms ranges. Scaling of the ohms signal over the seven ranges is accomplished by using 5 constant current levels and the 3 gains of the chopper amplifier.

b. A/D Converter. The A/D converter is a large scale integration (LSI) ratiometric device. Converter output is a multiplexed 5 digit number, in binary coded decimal (BCD) form which is equal to the ratio of the input voltage to the reference voltage. A separate clock circuit supplies a 100 kHz timing input to the integrated circuit, which also multiplexes the BCD output. The full scale A/D input for all ranges of the Model 4003 is 2 volts dc, with the polarity determined by the function as follows: (1) ACV and ACA, + 2 volts; (2) DCV and DCA, ± 2 volts; (3) Resistance (Ω), -2 volts.

c. Range Switching. It is important to note that the range switches on the schematic are identified by the front panel marking for the Ω ranges. The corresponding V and A ranges may either be determined from the instrument front panel or by using Table 5-1.

TABLE 5-1.
Range Switch Correlation

Function	Ranges						
Ω	20	200	2K	20K	200K	2000K	20M
V	20m*	200m	2	20	200	1000**	
A	20 μ *	200 μ	2m	20m	200m	2000m	
* DC Only							
** ACV 1000, DCV 1200							

5-3. AC CONVERTER. When making AC voltage measurements, the AC converter scales the input signal by appropriate attenuation or amplification, performs TRMS conversion and provides the equivalent positive dc level to the A/D for display. Input resistance for ac volts is $1M\Omega$ (R107). Shunt capacitance is less than 75pF. Signal conditioning is as follows:

a. Scaling. Scaling is performed in the first two stages, as shown on the schematic and summarized in Table 5-2. Scaling is performed by using a relay and FET switches to switch feedback resistors in the attenuator (U101) and the amplifier (U102). The actual gains used in attenuator U101 are 0.99, 0.0099 and 0.00099. Amplifier U102 gains are nominally 1.003 and 10.03. The combined gain of U101 and U102 is offset low to permit gain adjustment in the TRMS stage. The only adjustments provided in the attenuator and amplifier stages are two high frequency compensation capacitors (C102 and C103). AC coupling is used at the input and output of the attenuator and amplifier stages. Input overload protection is provided by diodes (CR106 and CR107) and resistor R107 ($1M\Omega$, 2 watts).

TABLE 5-2.
AC Converter Attenuation and Amplification.

RANGE	ATTENUATOR (U101)	AMPLIFIER (U102)
200mV	$\div 1$	$\times 10^*$
2 V	$\div 1$	$\times 1$
20 V	$\div 100^{**}$	$\times 10^*$
200 V	$\div 100^{**}$	$\times 1$
1000 V	$\div 1000^{***}$	$\times 1$
* $\times 10 = Q102$ Off		
** $\times 100 = Q101$ On		
*** $\times 1000 = K101$ On		

b. AC Conversion. AC-to-DC conversion is performed by a monolithic TRMS module (U103). Output $V_{dc} = \sqrt{\text{Avg} (V_{in})^2}$. Averaging and output filtering are done before the internal output buffer to give a low impedance for the Analog Output. Potentiometer R113 provides midband (10K count) gain adjustment and R114 establishes output zero (1K count).

Capacitor C108 is used in the averaging circuit, and C109 provides filtering as described above.

d. AC Current Measurements. For ac current measurements, the appropriate shunt resistor is placed in front of the AC converter. The 200mV range gain configuration is used for all current ranges.

5-4. DC SIGNAL CONDITIONING. For dc voltage measurements, the input resistance is $10M\Omega$, which is established by all of the range resistors being connected in series to signal ground. On low voltage ranges, the DC input is applied to the top of the resistive divider (range resistor) and to the buffer amplifier input without attenuation. And the chopper amplifier has appropriate gain to provide a ± 2 volts full scale output to the A/D. On high voltage ranges, the DC signals are scaled down to ± 2 volts full scale by the resistive divider and the chopper is used in the unity gain (follower) mode as a buffer. A summary of input attenuation and chopper amplifier gain is given in Table 5-3.

TABLE 5-3.
DC Signal Conditioning Attenuation and Gain.

RANGE	INPUT ATTENUATION	CHOPPER GAIN
20mV	-----	x 100
200mV	-----	x 10
2 V	-----	x 1
20 V	$\div 10$	x 1
200 V	$\div 100$	x 1
1200 V	$\div 1000$	x 1

a. Input Attenuation. On the 20, 200 and 1200 volt ranges, the input signal is attenuated by the resistive divider to divide by 10, 100 and 1000, respectively. Depressing one of the above range pushbuttons, interrupts the unattenuated signal from the volts switch pin 17 and connects the wiper of the appropriate range potentiometer to the input of the chopper. Division by 10, 100 or 1000 is accomplished by connecting the wiper of R155, R156 or R157, respectively.

b. Chopper. The input signal to the chopper is filtered and applied to a modulator circuit. The ac signal is then amplified and demodulated. A final high gain dc amplifier provides a dc signal to the A/D converter and the Analog Output.

1) Modulator circuit. This circuit converts the input dc signal to an ac signal with a fundamental frequency component of approximately 390 Hz. This frequency was chosen because it reduces the amplitude of higher harmonics of the 50 Hz and 60 Hz line frequencies, which minimizes beating. The circuit utilizes a dual MOS-FET (Q104A and Q104B) connected in a series-shunt configuration to maintain the required high input impedance.

2) AC Amplifier. The ac amplifier uses a JFET-input operational amplifier (U108). The amplifier feedback network provides a gain of approximately 133 at the modulating frequency of 390 Hz, while maintaining a gain of one for amplifier (U108) dc offset voltages.

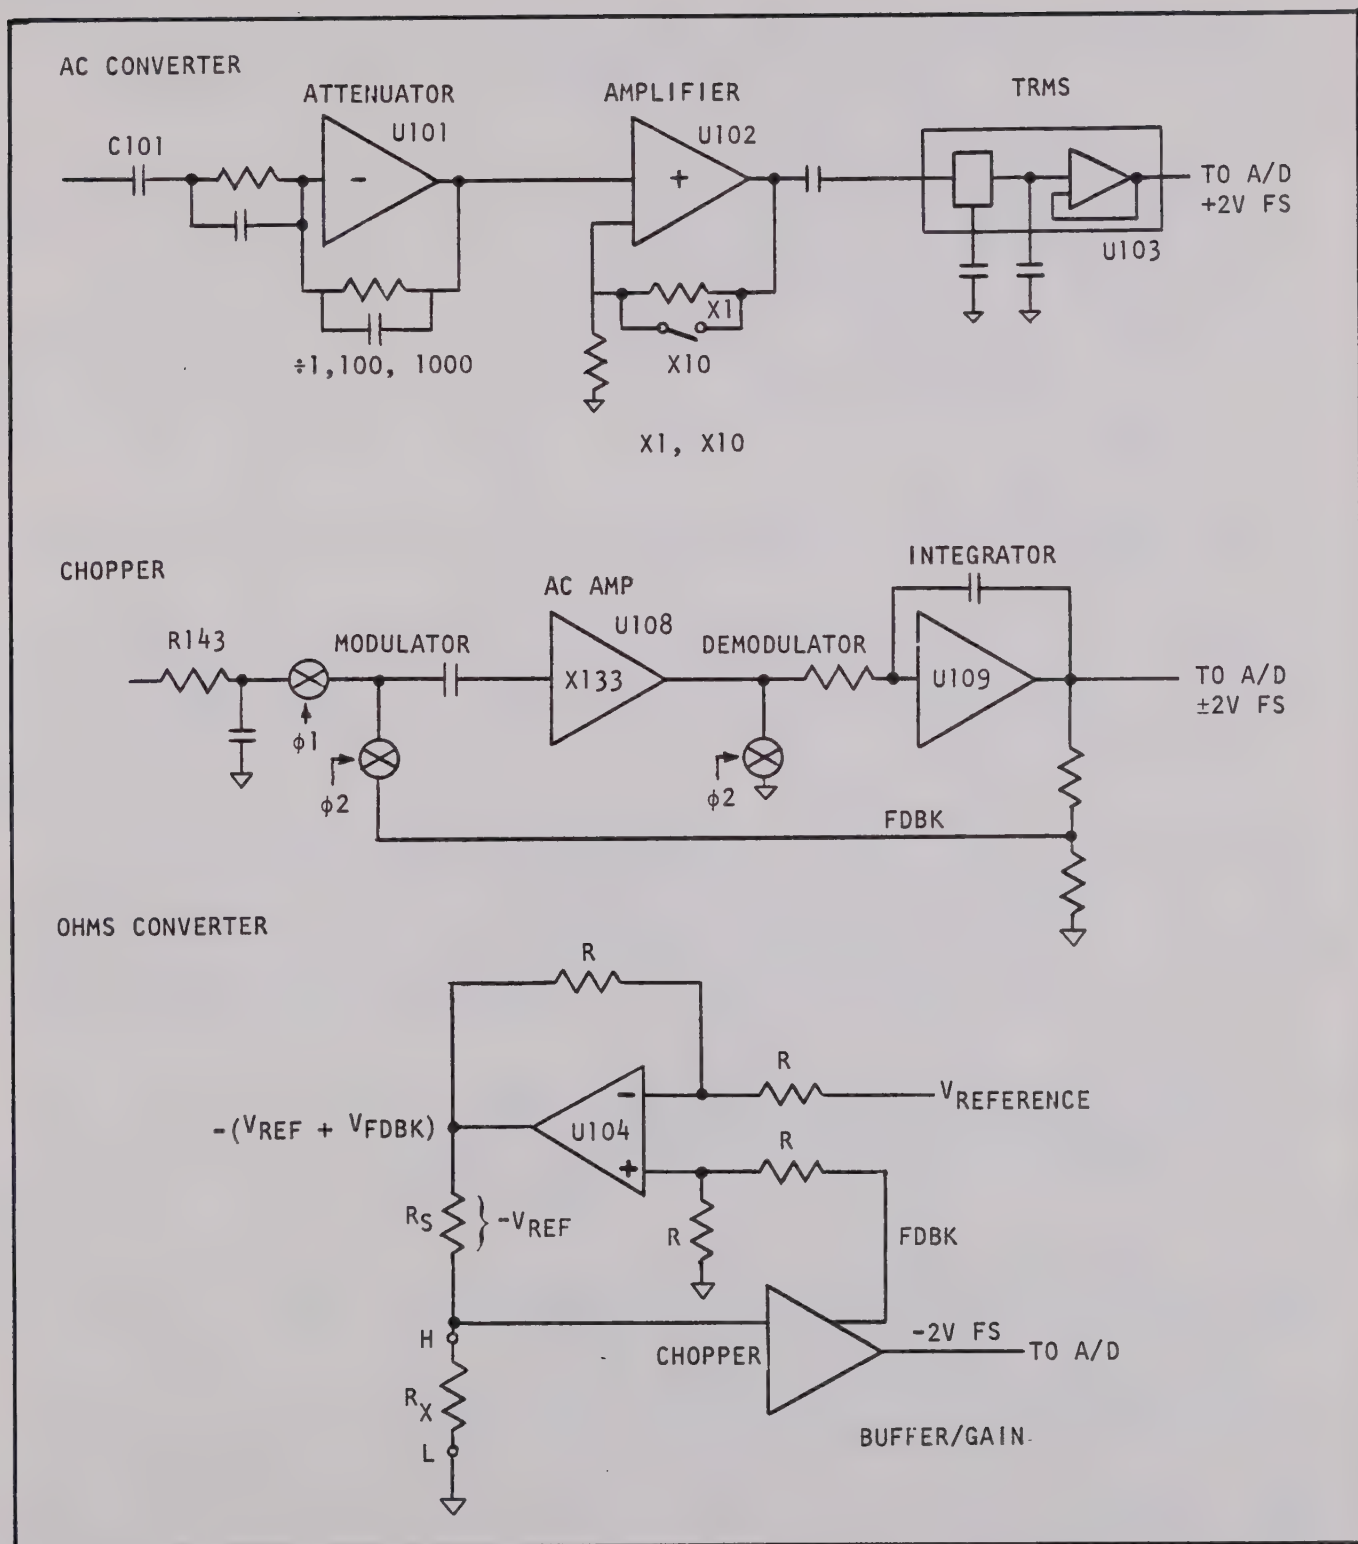


FIGURE 5-2. Simplified Signal Conditioning.

3) Demodulator Circuit. The demodulator is synchronized with the input modulator. A JFET (Q105) with low on-resistance is used to alternately attenuate and pass the signal present at the output of ac amplifier U108. This produces a "half-wave rectified" dc signal at the input of the integrator stage, that is inverted with respect to the chopper input signal.

4) DC Amplifier. Amplifier (U109) is connected as an integrator with an offset adjustment. U109 provides sufficient gain to bring the total open-loop dc gain to about one million. U109 drives the feedback divider network and the A/D converter, and provides the low output impedance necessary to drive the Analog Output. Feedback capacitor (C138) was selected to provide nominal settling time, while meeting NMR requirements. When the chopper is operating as a unity gain follower, the dc signal present at the output of U109 is the chopper feedback. This is the condition for the 2 VDC range and above. On the 200mV and 20mV ranges, where chopper gains of 10 and 100 are required, the resistive divider feeds back a portion of the output of U109 to provide the required gain.

5) Modulator-Demodulator Drive Circuit. CMOS inverters (U111A and U111F) provide opposite phase 0 to -15 volts square waves used to drive MOS-FET modulator transistors Q104A and Q104B. Inverter U111F also drives the demodulator JFET Q105. Resistors R118, R119 and R142, and capacitors C131 and C132 affect the rise and fall times of drive signals. R142 adjusts the rise and fall time of the drive signal to Q104A only, so that the total charge, both positive and negative, transferred to the input can be minimized. The frequency of the drive signal is determined by the clock circuit. Circuitry in U110 divides down a nominal clock frequency of 100 kHz to produce 390 Hz.

6) Adjustments and Input Protection. The front panel zero control (R203) permits adjustment of the chopper feedback to compensate for input thermal EMFs. It functions only on ranges where chopper gain is greater than one. A span of $\pm 75\mu\text{V}$ is considered adequate, however, it is typical for R203 to provide a greater than $400\mu\text{V}$ change as it is turned end-to-end. The span is skewed by R128 to give best resolution in both DCV and Ω . Potentiometer R163 provides an internal X1 zero adjustment to compensate for amplifier offsets. Potentiometer R146 provides a calibration adjustment of the 200mV range (X10 gain configuration) and R147 adjusts the X100 gain used on the 20mV range. Chopper input resistor R143 limits the input current during momentary input overloads to 12mA, which is then absorbed by the chopper load resistance (R145 and/or R149) or the power supplies thru CR116 and CR117.

7) DC Current Measurements. As previously described, dc current measurements are made by placing the appropriate shunt resistor on the chopper input. A chopper gain of X10 is used for all current ranges except 20 μA , which uses X100. The front panel zero control (R203) is functional for all dc current ranges.

5-5. OHMS CONVERSION. The ohms converter contains 2 sections: a floating current source and a high input impedance buffer/amplifier. The chopper employed as a buffer/amplifier in DCV is also used as the high impedance buffer/amplifier for Ω . Refer to paragraph 5-4, DC Signal Conditioning, for additional chopper theory.

a. Floating Current Source. The floating current source involves a differential amplifier (U107) driven by the A/D reference voltage and the chopper feedback voltage. This results in a constant voltage across the source resistance ($= -V$ reference) which results in a constant current in the unknown resistance. One or more range resistors is always connected as the ohms source resistor (R_s) when ohms function is selected. Five different constant current levels are supplied by changing the value of R_s with the range pushbuttons. These levels are given in Table 5-4. For Ω , INPUT HI terminal is negative with respect to INPUT LO.

TABLE 5-4.
Ohms Conversion.

RANGE	R_s SOURCE RESISTANCE	CHOPPER GAIN	NOMINAL CURRENT
20	1k	x 100	1mA
200	1k	x 10	1mA
2k	1k	x 1	1mA
20k	10k	x 1	100 μ A
200k	100k	x 1	10 μ A
2000k	1M	x 1	1 μ A
20M	10M	x 1	0.1 μ A

b. Chopper. For ohms, the full scale chopper output is -2 volts. Gain is employed on the 20 Ω and 200 Ω ranges to give -2 VFS out with the nominal 1mA source current. The front panel zero control functions on these two ranges, allowing compensation for up to 200m Ω of lead resistance. Settling time is determined primarily by chopper input ($T = R_x C$) which results in 2 seconds to full scale on the 2000K Ω and 20M Ω ranges ($.047\mu F \times 2M\Omega$ and $.0047\mu F \times 20M\Omega$).

c. Adjustments and Input Overload Protection. Two Ω source calibration adjustments are required. Potentiometer R162 compensates primarily for the tolerance of R_s (R158), while R159 compensates for ratio variations in the four gain resistors (R150 thru R153). The protection network at the source output isolates the amplifier from positive voltage overloads (Q103) and negative voltage overloads (CR120) applied to INPUT HI. Transistor Q107 clamps the source input during overload. The ratio of the base to emitter resistors on Q103 sets the open circuit voltage.

5-6. ANALOG OUTPUT. The rear panel ANALOG OUTPUT provides a ± 2 volt full scale dc output signal (10K counts = 1V). The analog output signal is available on all instrument functions and ranges, with a negative polarity on ohms (Ω) and a positive polarity on AC. The output is unbuffered, supplied by either the chopper or the TRMS converter through 5K Ω effective resistance, with 1K Ω placed in the L0 leg to prevent ground loops through INPUT L0.

5-7. CLOCK. A single chip CMOS oscillator/ $\div 2^N$ package is used to generate the 100kHz A/D clock and the 390Hz chopper drive signals. The 100kHz 0V to 5V signal drives the A/D and battery pack directly. The 390Hz signal is level shifted to 0V to -15V and split into 2 phases for driving the chopper FETs. An RC adjustment (R142) provides chopper input bias current compensation. Balancing and guarding is employed to keep the drive signal out of the chopper AC amp stage.

5-8. A/D CONVERTER. The A/D converter operates on the dual slope principle. The timing is divided into 3 periods as described below.

a. Auto-Zero. The auto-zero period (A, Figure 5-3, Sheet 1) is 100 milliseconds in length, which corresponds to 10,000 clock pulses. During this period, the reference voltage (V_{REF}) is stored on capacitor C116. Capacitor C115 stores $V_{REF} + V_{OS1} - V_{OS2}$.


b. Signal -Integrate. The signal-integrate period (B, Figure 5-3, Sheet 1) is also 100 milliseconds in length. The A/D input is buffered and integrated by U105. Positive signals generate a negative-going ramp at the integrator output (Pin 14), while negative signals produce a positive-going ramp. The level of the integrated signal at the end of the signal-integrate period is proportional to the average of the applied signal during this period. Since signal integration continues for 100 milliseconds, the A/D converter exhibits high normal mode rejection for ac signals in multiples of 10 Hz, particularly the 50 and 60 Hz line frequencies.

c. Reference-Integrate. The reference-integrate period for a full scale input (C or D, Figure 5-3, Sheet 2) is 200 milliseconds, or 20,000 counts in length. During this period, the integrator is returned to baseline level by applying a reference voltage of a polarity opposite to that of the signal. A positive-going ramp is obtained by grounding the buffer input, while a negative-going ramp is produced by the integration of $2 \times V_{REF}$ (that is, $V_{REF} +$ the voltage stored on C116). The time, or number of clock pulses, required for discharge is proportional to the signal input. Digital output is from latches within U106 which store the number of clock pulses required for the integrator to return to baseline level. The maximum count during this period is 20,000, which corresponds to a discharge period of 200 milliseconds, or full scale input. For an input of less than full scale, the A/D automatically reverts to auto-zero for that period of the 200 milliseconds remaining after return to baseline level. V_{REF} is provided by a divider across a temperature-compensated zener diode. Operational amplifier U104 provides the zener with a self-regulating bias.


5-9. DISPLAY. Five light-emitting diodes (LED) are driven by U203, which is a CMOS BCD-to-seven segment decoder/driver with bipolar current-sourcing outputs. Segment currents are limited to approximately 20 milliamperes peak by resistor network R202. The LED readout is a multiplexed, common-cathode configuration with Darlington array U202 sequentially sinking current from each digit. Blanking of the overrange digit is accomplished by gates U104C and U104D. U104A and U104B ensure that CMOS-compatible levels are maintained on U104D, regardless of the loading of U202. The minus polarity readout is blanked on ac voltage and resistance ranges by normally open contacts on the AC and Ω pushbuttons.

5-10. AC POWER SUPPLY. When the DMM is operated from ac line power, the power supply furnished +5, +15, and -15 volts from regulators VR101, VR102 and VR103, respectively. Full-wave rectified ac from bridge rectifiers CR103 and CR104 is filtered by capacitors C120, C123 and C125 and is applied to the linear voltage regulators.

5-11. OPTION 06 BATTERY PACK. When the Option 06 Battery Pack is installed in the DMM, S102 must be set to the BAT position to provide additional secondary voltage for battery charging. S102 also switches the input to VR101 from bridge rectifier CR103 to batteries BT301. Four 2-volt, 2.5 ampere-hour lead-acid cells supply approximately 9.8 volts at full charge. After six hours of use on battery power, the battery pack should be re-charged to ensure long battery life.



C. NEGATIVE REFERENCE INTEGRATE (20k COUNTS AT FULL SCALE)
(POSITIVE INPUTS-TO A/D)

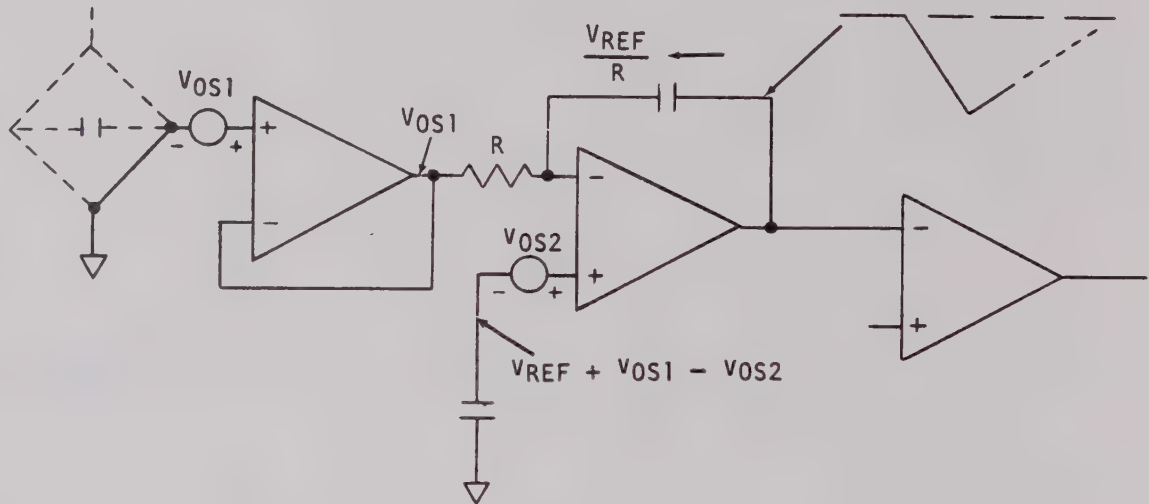

D. POSITIVE REFERENCE INTEGRATE (20k COUNTS AT FULL SCALE)
(NEGATIVE INPUTS TO A/D)

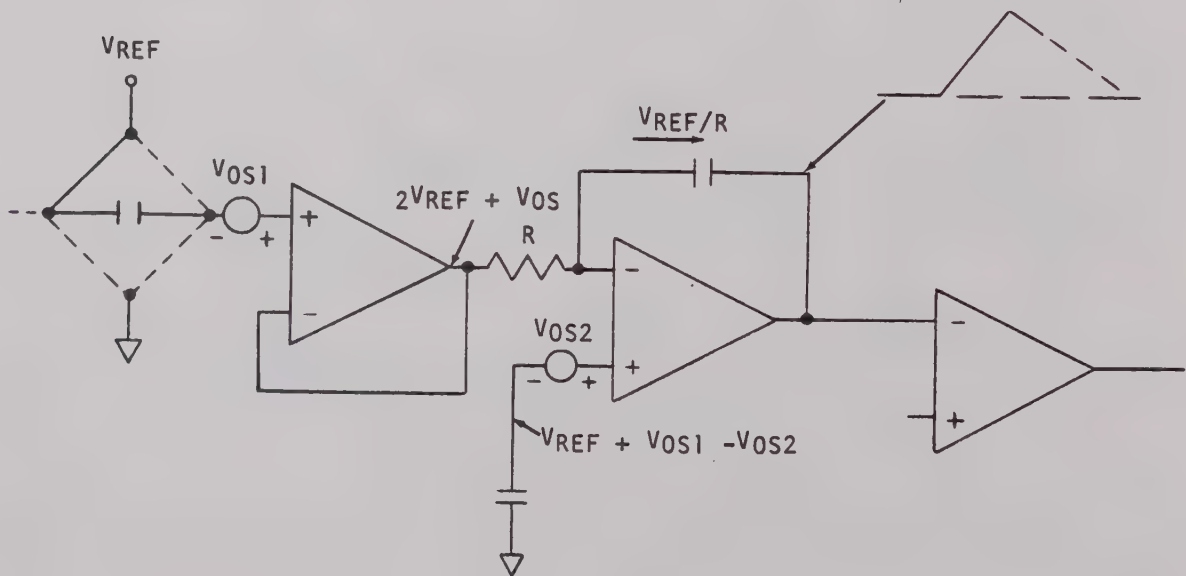


FIGURE 5-3. A/D Converter Function (Sheet 2 of 2)

a. Battery Charging Circuit. While the DMM is plugged into line power and the battery pack is installed, battery charging proceeds as follows:

1) Full-wave rectified voltage from CR103 is applied to the anode of Q301, which is an SCR which regulates charging voltage. When Q301 is triggered on by a sufficient gate-cathode voltage differential, the batteries receive charge. Charging continues as long as the bridge output voltage exceeds battery voltage by 1 volt or more. Resistor R304 limits charging current when recharging a set of completely discharged cells. A filtered positive output from CR104 (or T301) provides the necessary gate turn-on bias through R306 and diode CR301. Resistor R303 ensures proper high-temperature operation of Q301.

2) When the battery voltages reach the preset float voltages of 9.8 volts, zener VR301 conducts sufficient current to turn on Q302 and thus remove the gate trigger voltage from Q301. Float voltage is adjusted with R301. This is a factory adjustment which will normally not need field readjustment.

b. Battery Operation and Shutdown Circuit. The DMM operates as follows on battery power:

1) When the power is turned on, the batteries are connected to the input of VR101 to supply +5 volts for the logic, display and the clock circuit. The clock output is applied to the A/D converter as described in Paragraph 5-7, and U301 which is a divide-by-four binary counter. The outputs of U301 drive a dc-to-dc inverter which is synchronized to the A/D converter to filter out inverter noise. The 25 kHz operating frequency is optimal for the small transformer size and results in low switching losses. Blocking capacitors C301 and C302 protect Q307 and Q308 from damage if the drive is lost. Two half-wave rectifiers (CR304 and CR305) on the secondary of T301 provide rectified ac to filter capacitors C304 and C305, which provide power to +15 and -15 volt regulators VR102 and VR102, respectively.

2) To prevent permanent loss of battery capacity caused by deep discharge, a shutdown circuit stops operation on battery power when the battery voltage drops below approximately 7.2 volts. Shutdown is performed by micropower voltage detector U302. The open-collector output (U302, pin 4) saturates low and turns off pass transistor Q309 when the input voltage (at U302, pin 3) drops below 1.15 volts (typical). Resistor R314 provides sufficient hysteresis to prevent discharge from resuming when the battery voltage rises following disconnection of the load.

SECTION 6. MAINTENANCE.

6-1. GENERAL. This section contains information necessary to maintain the Model 4003 DMM and Option 06 Battery Pack. Adjustment/Calibration, Troubleshooting, Front Panel Zero Knob Removal and Replacement, and Fuse Replacement. Calibration should be performed yearly (every 12 months) or whenever Performance Verification (See Section 3) indicates that the Model 4003 is out of specifications. If any step in the calibration procedure cannot be performed properly, refer to troubleshooting information in this section, or contact your Racal-Dana representative or the factory as described in Section 3.

NOTE

Calibration should be performed by qualified personnel using accurate and reliable test equipment.

6-2. RECOMMENDED TEST EQUIPMENT. Recommended test equipment for calibration is listed in Table 6-1. Alternate test equipment may be used. However, the accuracy of the alternate test equipment must be at least 10 times better than the Model 4003 specifications, or equal to Table 6-1 specifications.

TABLE 6-1.
Recommended Test Equipment For Calibration.

Item	Description	Specification	Mfr.	Model
A	DC Calibrator	0.1V, 1V, 10V, 100V, 1000V $\pm 0.002\%$ or $20\mu V$	Fluke	343A
B	AC Calibrator	0.1V, 1V, 10V, 100V $\pm 0.022\%$	H-P	745A
C	Decade Resistor	500 Ω , 1.9K Ω , 190K Ω , $\pm 0.01\%$	ESI	RS725
D	100 Ω Per Step 4-Terminal Low Thermal Resistor	10:1 divider within 50 PMM (See Figure 3-1).	ESI	SR1010

6-3. ENVIRONMENTAL CONDITIONS. Calibration should be performed under laboratory conditions having an ambient temperature of 20° to 26°C (68° to 78°F), and a relative humidity of less than 80%. If the instrument has been subjected to temperatures outside of this range, or to higher humidity, allow one hour minimum for the instrument to stabilize at the specified environmental conditions before beginning the calibration procedure.

6-4. CALIBRATION PROCEDURE. Perform the following adjustments to calibrate the DMM and restore its operation to specified limits.

a. Calibration Shield Installation. If the Option 06 Battery Pack is installed in the instrument it must be removed and the calibration shield reinstalled before calibration.



WARNING

Disconnect the line cord before removing the case cover.

If the calibration shield has been lost or misplaced, order Racal-Dana Part Number 29473.

- 1) Turn off the power and disconnect the line cord. Remove four screws from the bottom of the case and separate the top cover from the bottom cover.
- 2) Push back the ground clip (shown in Figure 2-3) from the upper side of the battery pack and remove the battery pack from the spacers.
- 3) Calibration may be performed on battery power as long as the battery pack is sufficiently charged. Leave the battery pack plugged into the instrument, but set the battery pack behind the DMM on the bench or table. Ensure that LINE/BAT switch (S102) is in BAT position.
- 4) Set the calibration shield in place on the spacers. The shield should read correctly when viewed from the front of the instrument.
- 5) Slide the ground clip over the top of the calibration shield so that it contacts the upper surface of the shield.
- 6) If battery power is not to be used, plug in the line cord and position S102 to the LINE position if the battery pack has been disconnected.

b. Warm-Up. Turn the Model 4003 on and allow a one hour warm-up time.

c. Calibration Instructions.

WARNING



Some procedures require the use of high voltage. Take care to prevent contact with live circuits which could cause electrical shock resulting in injury or death. Use an insulated tool when making adjustments.

- 1) Refer to Table 6-2 and perform the listed adjustments in the sequence indicated. Note that the step sequence is also indicated on the calibration shield by boxed numerals. The sequence must be followed exactly because the adjustments are inter-related and dependent on the preceding steps. The step sequence (box numerals) is also shown on the schematic.
- 2) If the indicated adjustment cannot be made to obtain the specified reading, refer to Troubleshooting Information in this section.

TABLE 6-2.
Calibration Procedure

Step	Function	Range	Input	Adjustment Point	Desired Reading	Test Equipment
1	DC V	2 V	Short	R163	.0000/- .0000	None
2	DC V	2 V	Open	R142	.0000/- .0000	None
3	DC V	2 V	Short	R163	.0000/- .0000	None
4	DC V	2 V	Open	R142	.0000/- .0000	None
5	DC V	2 V	+1.9 V	R134	1.9000	DC Calibrator (A)
6	DC V	20 mV	Short	R203	.0000/- .0000	None
7	DC V	200 mV	+190 mV	R146	190.00	DC Calibrator
8	DC V	20 mV	+19 mV	R147	19.000	DC Calibrator and 10:1 Divider (D)
9	Ω	2 K Ω	500 Ω	R162	.4999/.5000	Decade Resistor (C)
10	Ω	2 K Ω	1.9 K Ω	R159	1.9000	Decade Resistor
11	Ω	2 K Ω	500 Ω	R162	.4999/.5000	Decade Resistor
12	Ω	2 K Ω	1.9 K Ω	R159	1.9000	Decade Resistor
13	Ω	200 K Ω	190 K Ω	R156	190.00	Decade Resistor
14	DC V	200 V	+190 V	R139	190.00	DC Calibrator
15	DC V	20 V	+19 V	R155	19.000	DC Calibrator
16	DC V	1000 V	+1000 V	R157	1000.0	DC Calibrator
17	AC V	2 V	.1 V @ 1kHz	R114	.1000	AC Calibrator (B)
18	AC V	2 V	1 V @ 1kHz	R113	1.0000	AC Calibrator
19	AC V	2 V	.1 V @ 1kHz	R114	.1000	AC Calibrator
20	AC V	2 V	1 V @ 1kHz	R113	1.0000	AC Calibrator
21	AC V	200 V	100 V @ 20 kHz	C102	100.00	AC Calibrator
22	AC V	2 V	1 V @ 20kHz	C103	1.0000	AC Calibrator

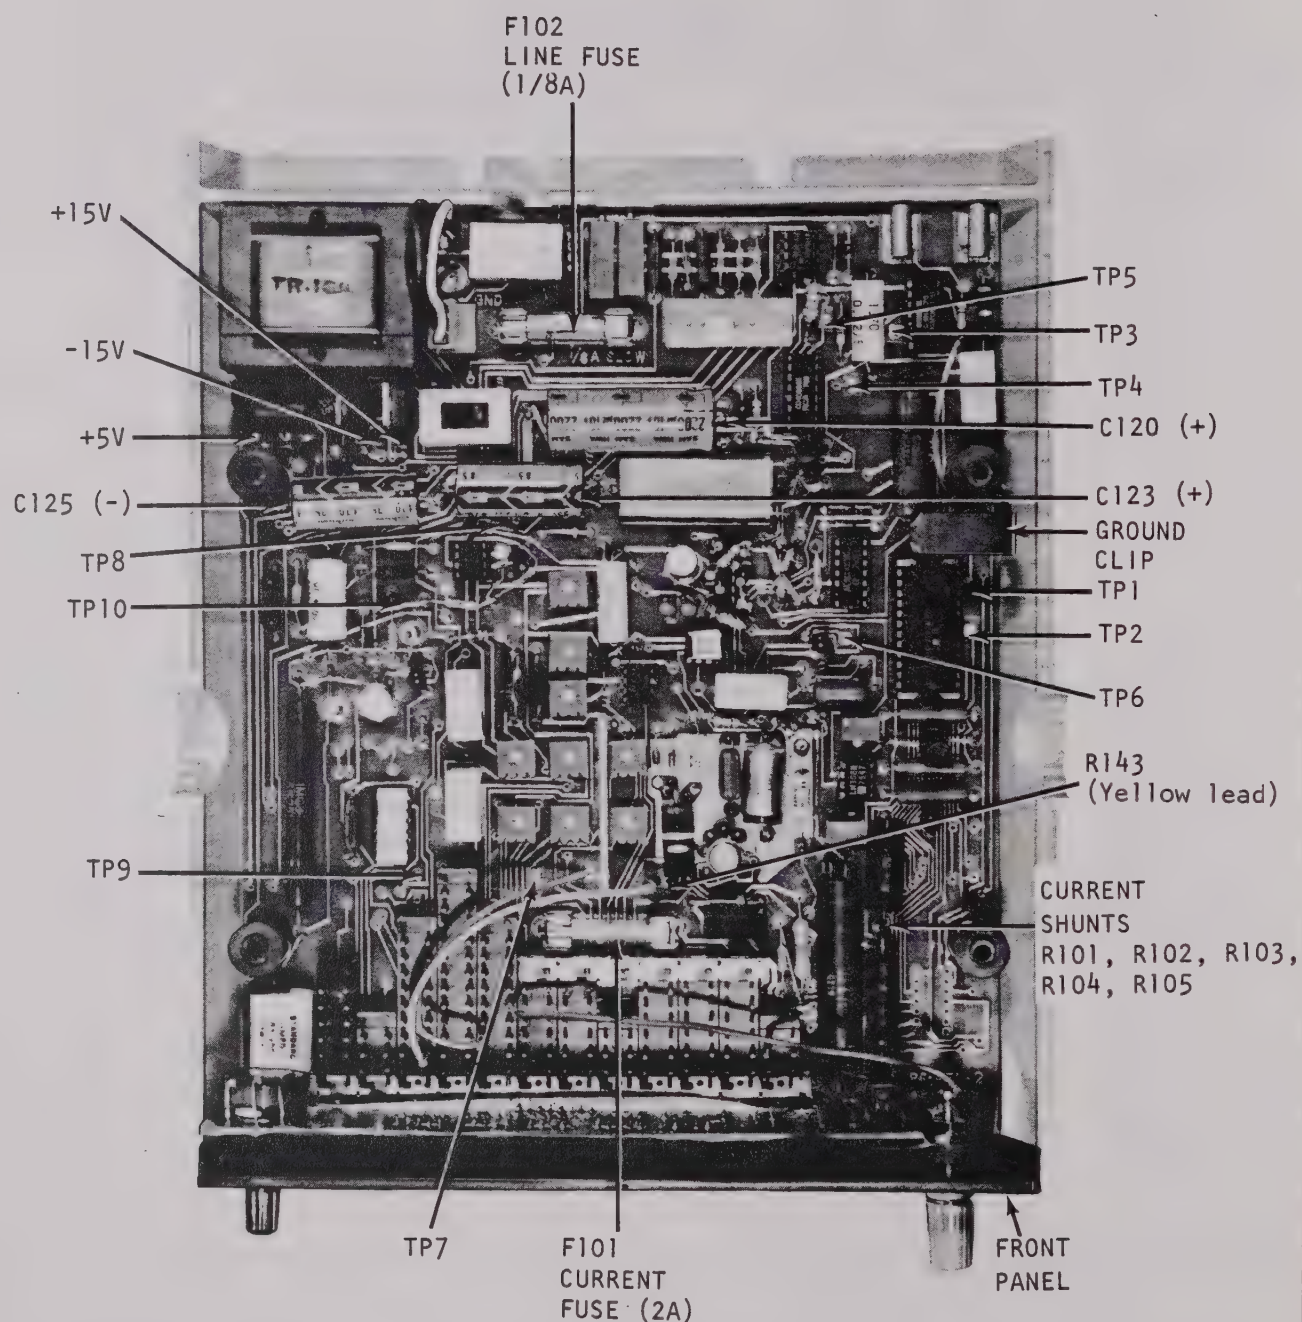


FIGURE 6-1. Test Point Locations.

6-5. TROUBLESHOOTING. The troubleshooting instructions contained in this section are intended for qualified personnel having a basic understanding of analog and digital electronic principles and components used in a precision electronic test instrument. Instructions have been written to assist in isolating the defective circuit or subcircuit. Isolation of the specific defective component has been left to the technician.

NOTE

For instruments that are still under warranty (less than 12 months since date of shipment), if the instrument's performance is outside of specifications at any point, contact your Racal-Dana representative or the factory before attempting troubleshooting or repair, other than fuse replacement.

6-6. TROUBLESHOOTING PROCEDURE. This section contains tables listing step-by-step checks of the major DMM circuits described in Section 5, Theory of Operation. The following steps outline the use of these tables and provide instructions for preparing the DMM for troubleshooting. Read all of these steps carefully before troubleshooting the instrument.

a. Calibration Shield/Battery Pack Removal. If the Option 06 Battery pack (or calibration shield) is installed, it must be removed to gain access to test points and circuit components for troubleshooting.



WARNING

Disconnect the line cord before removing the case cover.

1) Turn off power and disconnect the line cord. Remove four screws from the bottom of the case and separate the top cover from the bottom cover.

2) Push back the ground clip (shown in Figure 2-3) and remove either the calibration shield or battery pack from the spacers. If operation on battery power is to be checked, leave the battery pack plugged into the instrument, but set the battery pack behind the DMM on the bench or table.

b. Line Power. In general, start troubleshooting with Table 6-3, Line power checks, to verify that the power supplies are providing the correct voltages to the electronic components.

c. Battery Power. If trouble occurs on battery power only, or if battery operating time is substantially less than 6 hours after overnight charging, test the batteries and charging circuit per Table 6-4.

d. Proper operation of the A/D converter and display should be verified before troubleshooting the signal conditioning circuits. Check the A/D converter and display per Tables 6-6 and 6-5, respectively.

e. Problems with ac voltage or ac current ranges may involve the ac converter. Check this circuit per Table 6-7. If the problem is only on ac current ranges, see Step g, below.

f. Problems with dc voltage, dc current or resistance ranges may involve the chopper amplifier. Check this circuit per Table 6-8. After verifying chopper amplifier operation by completing step 1 thru 10 of Table 6-8, go to Table 6-9 if resistance measurements are erratic. If problem is only on dc current ranges, see Step g below.

NOTE

Dust, flux or other contamination will degrade performance on resistance and dc voltage ranges.

g. If problems occur with current readings, check the current shunts and related circuitry per Table 6-10. It should be noted that, since the current shunts are common to both ac and dc current, problems should exist on the same ac and dc current ranges if there is a fault in the current shunt circuitry.

h. All measurements are referenced to analog common (ground clip), unless otherwise noted in the Tables.

i. If a gross failure exists that indicates a possible blown fuse (line power, battery pack, or current fuse) refer to paragraph 6-8 for Fuse Replacement instructions.

WARNING



Some procedures in the following tables require the use of high voltage. Take care to prevent contact with live circuits which could cause electrical shock resulting in injury or death.

TABLE 6-3.
Line Power Checks.

Step	Item/Component	Required Condition	Remarks
1	S101 line switch.	Must be set to 105-125V or 210-250V as appropriate.**	
2	S102 LINE/BAT switch.	Must be set to BAT for use with battery pack.	
3	F102 line fuse.	Continuity.	
4	P1007 line cord.	Plugged into live receptacle.	
5		Turn on power.	
6	+5V pad*.	+5 volts $\pm 5\%$.	Output of VR101.
7	VR101, IN C120-2200 μ F (+).	+7 volts minimum.	Output of CR103, input to VR101.
8	+15V pad*.	+15 volts $\pm 10\%$.	Output of VR102.
9	VR102 IN, C123-470 μ F (+).	+17.5 volts minimum..	Output of CR104, input to VR102.
10	-15V pad*.	-15 volts $\pm 10\%$.	Output of VR103.
11	VR103 IN, C125-470 μ F (-).	-17.5 volts minimum.	Output of CR104, input to VR103.
NOTE: Hot regulator may indicate shorted load.			

* On main printed circuit board (see Figure 6-2).

** On optional line voltage units set to 90-110V or 180-220V as appropriate.

TABLE 6-4.
Battery Power Checks.

Step	Item/Component	Required Condition	Remarks
1		Check AC line power per Table 6-3.	
2		Turn off power.	
3	S102 LINE/BAT switch.	Move to BAT.	
4	P1007 line cord.	Plugged into live receptacle.	Charge circuit checks.
5	F301.	Remove fuse and connect ammeter to fuse clip. 0 to 500mA charging rate, varies with line voltage and battery state of charge.	No charge, see step 5A. Correct charging but short battery operating time, see step 6.
5A	BT301 Batteries.	Full charge is ≈ 9.8 volts over 4 cells. R301 adjusts charging rate (float voltage).	If voltage is low and adjustment of R301 does not start charging, see steps 7 and following. If voltage is low and adjustment of R301 does start charging, see Table 6-11 for adjustment of battery charge voltage.
6	Each battery cell voltage <u>during</u> charging.	1.5 - 3 volts for any cell.	High voltage or zero indicates damaged cell.
7	Q301 anode.	Full wave rectified voltage, 15 VDC nominal.	Output of CR103.
8	C304 + .	+17.5 volts minimum.	Output of CR104. Triggers Q301 gate thru R306 and CR301 unless Q302 is on.
9	Q302.	Should saturate only when battery approaches full charge.	
10	VR301.	8.2V zener.	
11		Unplug line cord & turn power on.	Discharge checks.
12	P1004 pin 8 or U301 pin 11.	100 kHz 5V square wave.	Clock input. If no input, see step 12A.
12A	VR101, IN.	+7 volts minimum.	Battery voltage input to VR101.
13	Q307 and Q308 base.	Square wave, ± 0.7 volts at 25 kHz.	Output of U301, $\div 4$.
14	Q307, Q308 collector.	Must oscillate from saturation to twice battery voltage (≈ 19 volts) at 25 kHz.	Inverter.
15	C304, C305.	± 17.5 volts minimum (± 25 volts typical with fully charged bat.).	Inverter Output, input to VR102 and VR103.

TABLE 6-5.
Display:

Step	Item/Component	Required Condition	Remarks
1		Turn on power. Any function or range, except OHMS.	
2	+5V Pad* or J1001, Pin 7.	+5 volts $\pm$ 5%.	If low, check per Table 6-3.
3	U202, pins 2, 6, 7, 9 and 13.	Digit drive. Low = enabled.	LED cathode.
4	U203, pins 1, 2, 6 and 7.	HI = enabled.	BCD input to U203 segment decoder/drive.
5	U203, pin 2.	Negative-going signal lasting for 200 clock pulses.	Leading digit suppression.
6	J1001, pin 2.	Polarity line (sign). HI = off LO = -	Polarity output is disabled on AC and Ω .
7	J1001, pin 4 J1002-Pins 1, 11 & 12	Appropriate DP line high (on).	Depress RANGE pushbuttons to check all DPs.

*On main printed circuit board. See Figure 6-2.

NOTE

If the display board has to be removed for troubleshooting or repair, the front panel ZERO knob will also have to be removed. Refer to Paragraph 6-7, Front Panel Zero Knob Removal and Replacement.

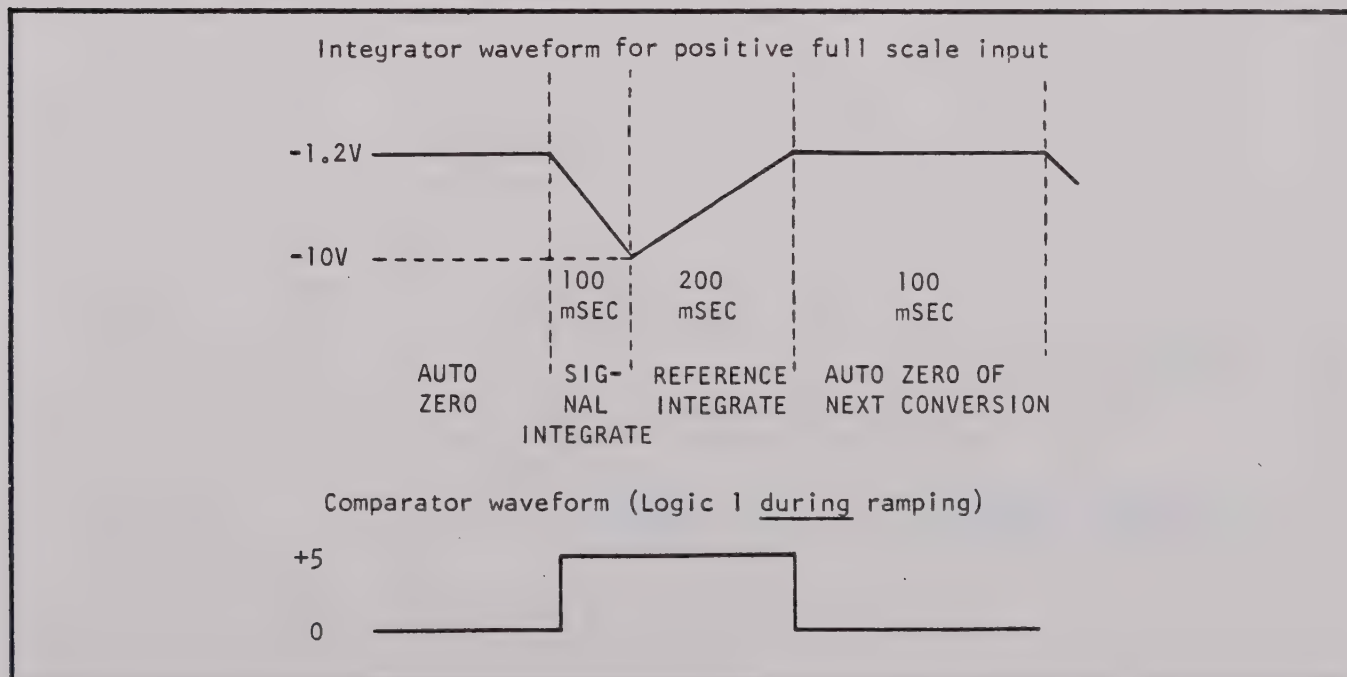


FIGURE 6-2. Integrator and Comparator Waveforms.

TABLE 6-6.
A/D Converter.

Step	Item/Component	Required Condition	Remarks
1		Turn on power. Select 2 VDC range.	
2	Display.	.0000 $\pm$ 1 digit.	
3	TP1*.	0.0000 volts.	Input to U106, Chopper output.
4	TP2*.	+1.00 volt.	Reference output.
5		Short TP1 to TP2.	Connects reference output to U106 input.
6	Display.	1.0000 $\pm$ 2 digits.	If steps 4 and 6 are correct A/D converter is functioning properly. If not, continue with step 7.
7	TP4*.	0 to +5 volt square wave at 100 kHz $\pm$ 100 Hz.	Clock input to U106.
8	TP3*.	+1.0 $\pm$ 0.1 volts.	Stored autozero voltage.
9	U105, pin 11.	+1.0 $\pm$ 0.1 volts.	Σ -node voltage to integrator in U105.
10	U105, pin 14.	-1.2 $\pm$ 0.2 volts.	U105 integrator output voltage.
11	U105, pin 13.	+ 1 volt.	U105 buffer input.
12	U105, pin 9.	+ 1 volt.	U105 buffer output.
13	External voltage source.	Apply + 1.9000 volts.	Calibration point.
14	Display.	1.9000 $\pm$ 1 digit.	If different, check U106 input.
15	TP1.	1.9000 volt.	Input to U106.
16	U105, pin 14.	Waveform per Figure 6-3.	Integrator output.
17	U105, pin 2.	Waveform per Figure 6-3, during ramping of integrator.	Comparator output.

* On main printed circuit board, see Figure 6-2.

TABLE 6-7.
AC CONVERTER.

Step	Item/Component	Required Condition	Remarks
1		Turn on power. Select 2 VAC range.	NOTE: Full scale input on all ranges should produce ≈ 2 volts rms output at TP8*.
2	External voltage source.	Apply 1 volt rms at 1 kHz.	Calibrated input.
3	TP10*	.99 volts rms nominal.	Output of U101 and feedback components R108 and C103 (nominal gain .99).
4	TP8*	.993 volts rms nominal.	Output of U102. (Q102 on, nominal gain 1.003).
5	U103 Pin 6 or TP1*	+1 volt.	Output of U103. Gain of U103 adjusted to provide +1 Vdc output for 1 Vac (1/2-scale) input.
6	External voltage source.	Select 20 VAC range. Apply 10 volts rms at 1 kHz.	Gain check of U101 and U102. Nominally, .0099 (U101) and 10.03 (U102).
7	TP10	.099 volts rms nominal.	Output of U101 and feedback components R109, C104 and Q101 (on).
8	TP8	.993 volts rms nominal.	Output of U102 (Q102 off).
9	External voltage source.	Select 1000 VAC range. Apply 1000V rms at 1 kHz.	Calibrated input. Check gain of U101 (nominal .00099).
10	TP10	.99 volts rms nominal.	Output of U101 and feedback components K101, R110 and C105 (K101 (Closed).
11	External voltage source.	Select 200 VAC range. Apply 100 v rms at 20 kHz.	Calibrated input.
12	Display.	100.00 nominal.	High frequency response (compensation C102, C103, C104).
13	External voltage source.	Select 2 VAC range. Apply 1 volt rms at 20 kHz.	Calibrated input.
14	Display.	1.0000 nominal.	High frequency response. (Compensation C102, C103).
15	External voltage source.	Select 1000 VAC range. Apply 1000 volts rms at 20 kHz.	
16	Display.	1000.0 $\pm$ nominal.	High frequency response. (Compensation C102, C103, C105)
17	External voltage source.	Select 2 VAC range. Apply 1 volt rms at 45 Hz.	
18	Display.	1.0000 V $\pm$ nominal.	Low frequency response. C101, C106, C107, C108, C109.

TABLE 6-8.
DC Attenuation and Chopper Amplifier.

Step	Item/Component	Required Condition	Remarks
1		Turn on power. Select 20 mVDC range. Short input and adjust F.P. Zero for ± 0.0000 on display.	NOTE: Insufficient zero adjustment may indicate leaky FET switches in Chopper Amplifier Circuit.
2	TP5, TP6*.	≈ -7.5 volts DC (on DMM).	Chopper Drive. Signals are actually 0 to -15 square waves at 390 Hz. A steady zero volt or -15 volt signal indicates a problem in the chopper drive or clock circuitry.
3	External voltage source.	Apply + 19mV.	Calibrated input.
4	R143 (yellow wire side)*.	+ 19mV.	Input to chopper amplifier $\div 1$ attenuation (range resistors).
5	TP1*.	+ 1.9 volts.	Input to U106, chopper output ($\times 100$ gain).
6	External voltage source.	Select 200 mVDC range. Apply + 190 millivolts.	Calibrated input.
7	R143.	+ 190 mV.	Input to chopper amplifier $\div 1$ attenuation.
8	TP1.	+ 1.9 volts.	Input to U106, chopper output ($\times 10$ gain).
9	External voltage source.	Select 2 VDC range. Apply + 1.9 volts.	Calibrated input.
10	R143, TP1.	+ 1.9 volts.	$\div 1$ attenuation, $\times 1$ chopper gain.
11	External voltage source.	Select 20 VDC range. Apply +19 volts.	Calibrated input.
12	R143.	+1.9 volts.	$\div 10$ attenuation (range resistors).
13	External voltage source.	Select 200 VDC range. Apply +190 volts.	Calibrated input.
14	R143.	+1.9 volts.	$\div 100$ attenuation (range resistors).
15	External voltage source.	Select 1000 (1200) VDC range. Apply +1000 volts.	Calibrated input.
16	R143.	+1 volt.	$\div 1000$ attenuation (range resistors).

* On main printed circuit board, see Figure 6-2.

TABLE 6-9.
Ohms Source and Resistors.

Step	Item/Component	Required Condition	Remarks
1		Check chopper amplifier operation per Table 6-7, steps 1 thru 10.	
2		Select 2 K Ω range. Short Input.	
3	Display.	.0000 $\pm$ 1 digit.	
4	TP9*	-1 volt approximately.	Inverted reference voltage plus calibrated offset of U107.
5	INPUT HI to LO.	Remove short and connect ammeter from INPUT HI to LO. Source Current should be approximately 1mA, HI Terminal negative.	If incorrect, check R158 and switching to INPUT HI and chopper amplifier.
6	INPUT HI to LO.	Remove ammeter and measure open circuit voltage. Voltage must be -2 to -5 volts.	HI negative with respect to LO. Display should be blinking, indicating overrange.
7	1.9K Ω resistor.	Apply to INPUT.	Calibrated resistance.
8	Display.	1.9000 $\pm$ 12 digits.	Subtract test lead resistance from reading. Checks accuracy of R158 and feedback loop to U107.
9	19 K Ω resistor.	Apply to INPUT. Select 20 K Ω range.	Calibrated resistance.
10	Display.	19.000 $\pm$ 12 digits.	Source resistors: R158, R154 (8.975 K Ω), R157 (wiper).
11	190 K Ω resistor.	Apply to INPUT. Select 200 K Ω range.	Calibrated resistance.
12	Display.	190.00 $\pm$ 12 digits.	Source resistors: R158, R157 R156 (wiper), R154 (89.75 K Ω , 8.975 K Ω).
13	1900 K Ω resistor.	Apply to INPUT. Select 2000 K Ω range.	Calibrated resistance.
14	Display.	1900.0 $\pm$ 12 digits.	Source resistors: R158, R157, R156, R155 (wiper), R154 (all except 8.975M Ω).
15	10 M Ω resistor.	Apply to INPUT. Select 20 M Ω range.	Calibrated resistance.
16	Display.	10.000 $\pm$ 12 digits.	Source resistors: all Ω range resistors. NOTE: To conveniently measure the resistance of all Ω range resistors, turn power off, set all function switches out and measure resistance INPUT HI to LO.
		NOTE: Reference loading by the ohms source does not affect Ω readout since A/D converter is ratiometric.	

TABLE 6-10.
Current Shunts.

Step	Item/Component	Required Condition	Remarks
1	F101	Continuity.	Apply a known 1/2-scale current and measure voltage across shunt.
2	R101, R102, R103, R104, R105	Correct shunt value for specified range. See schematic.	
3		Turn on power. Select DCA and 200 μ A range.	
4	External voltage source.	0 to 3 volts.	Clamping must occur at ± 2 volts.

TABLE 6-11.
Adjustment of Battery Charge Voltage.

Step	Item/Component	Required Condition	Remarks
1		Instrument off.	Fully charged cells require several minutes to reach this level. Discharged cells require several hours.
2	R301	Turn full CCW (maximum charge rate).	
3	BT301	Monitor battery voltage for > 9.8V.	
4	R301	When cells reach 9.8V, turn DMM on and adjust to maintain 9.8V across BT301.	 CAUTION: Charging to > 10V for longer than 30 minutes will reduce battery life.

6-7. FRONT PANEL ZERO KNOB REMOVAL AND REPLACEMENT. The front panel zero knob will have to be removed if either the front panel or display board is to be removed. To remove the knob, proceed as follows:

- a. Carefully remove the end-cap (shown in Figure 6-3) using a thin-bladed instrument.
- b. Loosen the slotted screw and remove the knob from the shaft.
- c. Take care not to damage or lose either the end-cap or knob. These items provide protection against electrical shock and must be installed when the instrument input is floating.



WARNING

The ZERO potentiometer shaft is electrically connected to INPUT LO. Maintain INPUT LO at ground potential while the ZERO knob or its cap is removed to prevent an electrical shock hazard.

- d. To replace the knob, reverse the above procedure. Do not substitute any other knob. If the knob or its cap is lost or damaged, order only Racal-Dana part number KN-41-1 as a replacement.

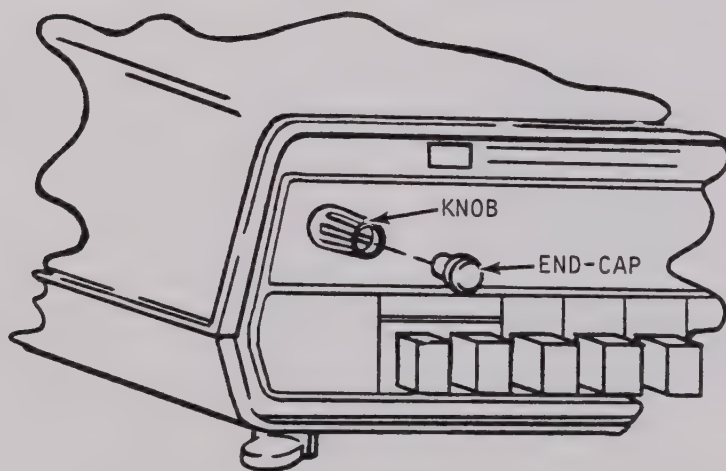


FIGURE 6-3. Front Panel Zero Knob Removal.

6-8. FUSE REPLACEMENT. All fuses are located internally in the Model 4003. To replace a fuse, proceed as follows:



WARNING

Disconnect the line cord before removing the case cover.

- a. Turn off power and disconnect the line cord.
- b. Turn the DMM bottom side up and loosen the four screws in the bottom cover. These screws are held captive by rubber O-rings.
- c. Hold the top and bottom covers together to prevent their separation and turn the DMM over to normal position.
- d. Lift off the top cover.



CAUTION

Do not install fuses with higher ratings than specified. Instrument damage may occur.

e. Replacement of Battery Pack Fuse F301.

- 1) Leave the Battery Pack in place and connected.
- 2) Remove F301, shown in Figure 2-3, and replace it with a 2A, 250V, 3AG fuse. (Racal-Dana part number FU-13).

f. Replacement of Line Power Fuse F102.

- 1) Once the top cover is removed, F102 is accessible without removing any other components.
- 2) Remove F102, shown in Figure 6-1, and replace it with a 2A, 250V, 3AG SLO-BLO fuse (Racal-Dana part number FU-20) for standard line voltage units. Optional line voltage units with 90-110V and 190-210V ranges, use a 3/16A, 250V 3AG SLO-BLO fuse (Racal-Dana part number FU-29).

g. Replacement of Current Fuse F101.

- 1) Lift the calibration cover, or Battery Pack, off of the spacers to gain access to the current fuse.
- 2) Remove F101, shown in Figure 6-1, and replace it with a 2A, 250V, 3AG fuse (Racal-Dana part number FU-13).
- 3) Replace calibration shield, or Battery pack, on the spacers. Be sure that the ground clip, shown in Figure 6-1, is positioned on the top side of the shield or battery pack.

h. Replace the top cover.

SECTION 7. REPLACEABLE PARTS.

7-1. GENERAL. This section contains information for ordering replacement parts. Panels and covers are shown separately on Figure 7-1. The Replaceable Parts List is arranged in alphabetical order of the Circuit Designations of the components. A cross-reference list of manufacturers, containing their addresses, is given in Table 7-2.

7-2. ORDERING INFORMATION. To place an order or to obtain information concerning replacement parts, contact Racal-Dana Instruments, Irvine, California 92713, (714) 833-1234. When ordering, include the following information:

- a. Instrument Model Number.
- b. Instrument Serial Number.
- c. Part Description.
- d. Circuit Designation (if applicable).
- e. Racal-Dana Part Number.

7-3. FACTORY SERVICE. If the instrument is to be returned to the factory for service, please complete the Service Form which follows this section and return it with the instrument.

7-4. SCHEMATICS.

- a. Model 4003 4-1/2 Digit Multimeter: Page 7-12.
- b. Option 06 Battery Pack: Page 7-13.

7-5. COMPONENT LAYOUTS.

- a. Model 4003 PC-476 Component Layout: Page 7-15.
- b. Display Board PC-475 Component Layout: Page 7-14.
- c. Option 06 Battery Pack PC-451 Component Layout: Page 7-13.

7-6. MAINTENANCE KIT. A Maintenance Kit is available that contains a complement of spare parts that will maintain up to ten Model 4003 DMMs. Specify Part Number 29966 when ordering. A list of the kit parts is given in Table 7-1.

TABLE 7-1.
MODEL 4003 MAINTENANCE KIT

QTY.	RACAL-DANA PART NUMBER	SCHEMATIC CALLOUT
2	DD-16	DS202, 3, 4, 5
1	DD-17	DS201
5	FU-13	F101
2	FU-20	F102
1	IC-93	VR101
1	IC-102*	U201
1	IC-139*	U111
1	IC-168*	U203
1	IC-169	U202
1	IC-197*	U110
1	IC-203	U107, 109
1	IC-205	U108
1	KN-41-1	Front Panel Zero
1	LSI-11	U106
1	LSI-12	U105
1	RL-56	K101
1	TF-80	R126
1	TG-77	Q101, 102, 105
1	TG-93	Q103
1	TG-94*	Q104

*Anti-Static Protection & Handling Required.

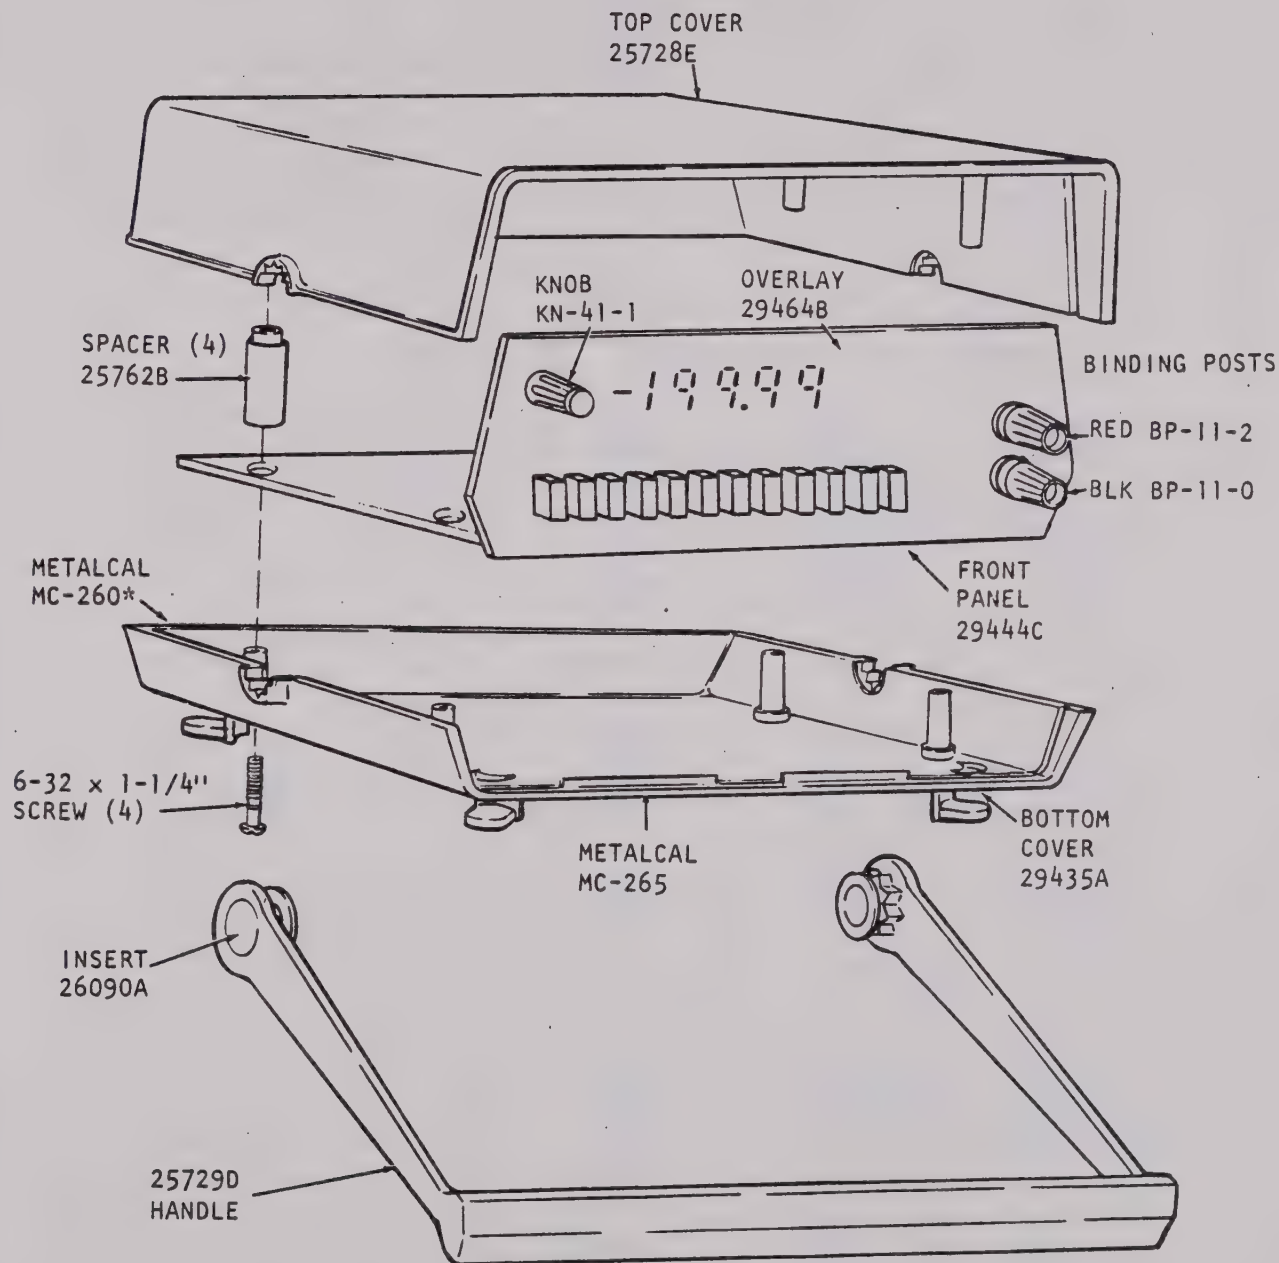


FIGURE 7-1. Covers and Panels.

TABLE 7-2.
Cross-Reference of Manufacturers.

MFR. CODE	NAME AND ADDRESS	FED. SUPPLY CODE	MFR. CODE	NAME AND ADDRESS	FED. SUPPLY CODE
A-B	Allen-Bradley Corp. Milwaukee, WI 53204	01121	L-F	Littlefuse, Inc. Des Plaines, IL 60016	75915
A-D	Analog Devices Inc. Norwood, MA 02026	24355	MEP	Mepco, Inc., Morristown, NJ	80031
ACI	American Components, Inc. Conshohocken, PA 19423	14298	MOL	Molex Downers Grove, IL 60515	27264
A-P	A-P Products, Inc. Painsville, Ohio		MOT	Motorola Semi Prod. Inc. Phoenix, AZ 85008	04713
AMP	Amphenol Broadview, IL 60153	02660	NAT	National Semi Corp. Santa Clara, CA 95051	27014
BEC	Beckman Inst. Inc. Fullerton, CA 92634	73138	NIC	Nichion Corp. Chicago, IL 60645	
BRN	Bourns, Inc. Riverside, CA 92507	80294	NCI	National Components, Inc. West Palm Beach, FL	
BUS	Bussman Mfg. Div. St. Louis, MO 63017	71400	NEL	Northern Engr. Labs. Burlington, WI 53105	00815
C-I	Components, Inc. Biddeford, ME 04005	06751	POT	Potter Co. Weston, Miss. 39191	13050
C-W	Continental-Wirt Elec. Corp. Warminster, PA 18974	79727	PRE	Precision Rectifier Hillside, NJ 07805	25007
CLB	Centralab Division Milwaukee, WI 53201	71590	R-D	Racal-Dana Instruments Irvine, Ca. 92713	21793
COT	Coto-Coil Co., Inc. Providence, R.I.		RCA	RCA Corporation Moorestown, NJ 08050	02734
DLE	Dale Electronics, Inc. Columbus, NE 68601	91637	SHR	Sheridan Sales, Inc. Cincinnati, Ohio 45222	
EDI	Electronic Devices, Inc. Yonkers, NY 10710	83701	SIE	Siemens Corp. Iselin, NJ 08830	25088
EFJ	E.F. Johnson Co. Waseca, MN 56093	74970	SIG	Signetics Corp. Sunnyvale, CA 94086	18324
F-I	Fairchild Inst. Corp. Mountain View, CA 94043	07263	HHS	H.H. Smith Brooklyn, NY 11207	83330
G-E	General Electric Co. Syracuse, NY 13201	03508	STD	Standard Condensor Chicago, IL	97419
G-I	General Instrument Corp. Newark, NJ 07104	72699	SUP	Superior Electric Co. Bristol, CT. 06010	58474
INT	Intersil Inc. Cupertino, CA 95014	32293	T-I	Texas Instruments, Inc. Dallas, TX 75231	01295
IRC	IRC Division Burlington, IA 52601	07716	TEP	Tepro Electric Corp. Rochester, NY 14606	02985
ITT	ITT Semi Conductors Lawrence, MA		TRW	TRW Capacitor Div. Ogallala, NB 69153	84411

Model 4003

REPLACEABLE PARTS LIST

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
-------------------	-------------	------------------	-----------------------------------	--------------	----------------	----------

BATTERIES (BT)
Option 06 Battery Pack
"300" Series (Sch. 29659C-Pg. 7-13)

BT301	Set of four "D" Cells, 8V	E2	---	*		
*	Lead-acid "D" cell, 2V, 2.5AH (Used for BT301, four required)			G-E	GE0225	BA-33

CAPACITORS (C)
"100" Series (Sch. 29658E-Pg. 7-15)
(PC-Board 476-Pg. 7-14)

C101	0.1 μ F, 1000V, MPF	B3	4/E5	STD	M2W-F-0.1 μ F	C-285-.1
C102	.25-1.5pF, 2000V, Teflon Trimmer. .	B3	5/C5	EFJ	273-101	C-184
C103	.25-1.5pF, 2000V, Teflon Trimmer. .	D3	6/C5	EFJ	273-101	C-184
C104	110pF, 500VDC, $\pm$ 1%, Silver Mica . .	D3	7/C5	G-I	RDM19FD112F03	C-278-110pF
C105	1100pF, 500VDC, $\pm$ 1%, Silver Mica. .	D3	8/C5	G-I	RDM19FD111F03	C-278-1100pF
C106	33 μ F, 15V, ETT.	D4	9/C4	NCI	KNS336D015K	C-228-33
C107	33 μ F, 15V, ETT.	D4	10/C4	NCI	KNS336D015K	C-228-33
C108	1 μ F, 100V, $\pm$ 10%, MPF.	E4	11/D4	POT	4309C105	C-294-1
C109	1 μ F, 100V, $\pm$ 10%, MPF.	E3	12/C4	POT	4309C105	C-294-1
C110	NOT USED					
C111	2200pF, 500V, CerD.	G2	14/C2	CLB	831-25U0-222M	C-22-2200p
C112	100pF, 1000V, CerD.	D5	15/C3	CLB	DD-101	C-64-100pF
C113	NOT USED					
C114	NOT USED					
C115	1 μ F, 100V, $\pm$ 10%, MPF.	H4	18/B1	POT	4309C105	C-294-1
C116	4 μ F, 100V, 10%, MPF.	G3	19/B2	POT	0109-5432	C-294-4
C117	.22 μ F, 200VDC, $\pm$ 10%, MPF.	H3	20/B2	TRW	22-200-10-X363UW	C-269-.22
C118	.12 μ F, 100V, 10%, MPF.	G4	21/C2	POT	4039C	C-294-.12
C119	NOT USED					
C120	2200 μ F, 15V, EAL.	D7	23/B3	SHR	16FLA2200	C-290-2200
C121	4.7 μ F, 20V, ETT.	E7	24/B5	NCI	KNS475A020K	C-179-4.7
C122	4.7 μ F, 20V, ETT.	E7	25/B5	NCI	KNS475A020K	C-179-4.7
C123	470 μ F, 35V, EAL.	D8	26/B4	NAC	35ELA470	C-289-470
C124	4.7 μ F, 20V, ETT.	C5	27/C3	NCI	KNS475A020K	C-179-4.7
C125	470 μ F, 35V, EAL.	D8	28/B5	SHR	35ELA470	C-289-470
C126	10 μ F, 20V, ETT.	C5	29/C3	C-I	TD2-20-106-20	C-179-107
C127	NOT USED					
C128	NOT USED					
C129	NOT USED					
C130	100pF, 1000V, CerD.	A6	33/B2	CLB	DD-101	C-64-100pF
C131	100pF, 630V, Poly.	C7	34/C2	SIE	B31360-A1101-H	C-252-100pF
C132	100pF, 630V, Poly.	B7	35/A2	SIE	B31360-A1101-H	C-252-100pF
C133	.0047 μ F, 100V, Poly.	B5	36/D3	POT	4100E-472K	C-301-.0047
C134	.12 μ F, 100V, 10%, MPF.	B4	37/D3	POT	4039C	C-294-.12
C135	1000pF, 500VDC, Poly.	C5	38/D3	CLB	CPR-1000J	C-138-1000pF
C136	NOT USED					
C137	NOT USED					
C138	1 μ F, 100V, 10%, MPF.	E5	41/C3	NIC	DT200	C-294-2
C139	1 μ F, 100V, 10%, MPF.	C5	42/C3	POT	4309C105	C-294-1
C140	.047 μ F, 100V, Poly.	B5	43/D2	POT	4100B-473K	C-301-.047

"200" Series (Sch. 29658E-Pg. 7-12)
(PC-Board 475-Pg. 7-14)

C201	4.7 μ F	G-7	3/A3	NIC	25ULA4R7D-T	C-314-4.7
------	-----------------------	-----	------	-----	-------------	-----------

CAPACITORS (C) (CON'T)
 "300" Series (Sch. 29659C-Pg. 7-13)
 (PC-Board 451-Pg. 7-13)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
C301	4.7 μ F, 20V, ETT	D3	3/E3	NCI	KNS475A020K	C-179-4.7
C302	4.7 μ F, 20V, ETT	D4	2/E3	NCI	KNS475A020K	C-179-4.7
C303	1.0 μ F, 250V, MPY.	E4	4/E3	AMP	C280AE/A1M	C-256-1
C304	100 μ F, 35VC	B5	6/F4	SHR	35-ULA-100	C-295-100
C305	100 μ F, 35VC	B5	5/F3	SHR	35-ULA-100	C-295-100

DIODES (CR)
 "100" Series (Sch. 29658E-Pg. 7-12)
 (PC-Board 476-Pg. 7-15)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
CR101	Bridge Rectifier, 50V, 5A, 4-Diode. B1	B1	46/D3	EDI	PE05	RF-48
CR102	Silicon Rectifier	B1	47/D3	MOT	MR-501	RF-34
CR103	Bridge Rectifier, 100V, 2A.	D7	48/B5	EDI	PD10	RF-36
CR104	Bridge Rectifier, 1A, 400V.	D8	49/135	EDI	PF40	RF-46
CR105	NOT USED					
CR106	Rectifier, 75mA, 75V.	C3	51/C5	T-1	1N4148	RF-28
CR107	Rectifier, 75mA, 75V.	C3	52/C5	T-1	1N4148	RF-28
CR108	NOT USED					
CR109	NOT USED					
CR110	Rectifier, 75mA, 75V.	H2	55/A2	T-1	1N4148	RF-28
CR111	Rectifier, 75mA, 75V.	H3	56/A2	T-1	1N4148	RF-28
CR112	Rectifier, 75mA, 75V.	H4	57/B2	T-1	1N4148	RF-28
CR113	Rectifier, 75mA, 75V.	H4	58/B2	T-1	1N4148	RF-28
CR114	Rectifier, 75mA, 75V.	B6	59/D3	T-1	1N4148	RF-28
CR115	Rectifier, 75mA, 75V.	B6	60/D3	T-1	1N4148	RF-28
CR116	Rectifier, 75mA, 75V.	E3	---	T-1	1N4148	RF-28
CR117	Rectifier, 75mA, 75V.	F3	---	T-1	1N4148	RF-28
CR118	NOT USED					
CR119	NOT USED					
CR120	Rectifier, 1A, 800V	F1	65/B4	MOT	1N4006	RF-38

"300" Series (Sch. 29659C-Pg. 7-13)
 (PC-Board 451-Pg. 7-13)

CR301	Rectifier, 75mA, 75V.	B3	26/D4	T-1	1N4148	RF-28
CR302	Rectifier, 75mA, 75V.	D4	28/E3	T-1	1N4148	RF-28
CR303	Rectifier, 75mA, 75V.	D4	27/E3	T-1	1N4148	RF-28
CR304	Rectifier, 75mA, 75V.	C5	30/F4	T-1	1N4148	RF-28
CR305	Rectifier, 75mA, 75V.	C5	29/F4	T-1	1N4148	RF-28

DISPLAYS (DS)
 "200" Series (Sch. 29658E-Pg. 7-12)
 (PC-Board 475-Pg. 7-14)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
DS201	± 1 LED Digit.	G7	5/C2	G-I	MAN 6690	DD-21
DS202	7-Segment LED Digit	H7	6/C2	G-I	MAN 6680	DD-20
DS203	7-Segment LED Digit	H7	7/C2	G-I	MAN 6680	DD-20
DS204	7-Segment LED Digit	H7	8/D2	G-I	MAN 6680	DD-20
DS205	7-Segment LED Digit	H7	9/D2	G-I	MAN 6680	DD-20

FUSES (F)

"100" Series (Sch. 29658E-Pg. 7-12)
(PC-Board 476-Pg. 7-15)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
F101	2A, 250V, 3AG, Quick.	B1	68/D3	L-F	312002	FU-13
F102	Slo-Blo, 1/8A, 250V, 3AG.	C8	69/B4	BUS	MDL	FU-20*

* Standard line voltages, optional line voltage units use 3/16A FU-29.

"300" Series (Sch. 29659C-Pg. 7-13)
(PC-Board 451-Pg. 7-17)

F301	2A, 250V, 3AG, Quick.	E1	13/C3	L-F	312002	FU-13
------	-------------------------------	----	-------	-----	--------	-------

CONNECTORS (J)

"1000" Series (Sch. 29658E-Pg. 7-15)
(PC-Board 476-Pg. 7-14)

J1001	8-Pin Connector	F6	71/E5	A-P	929853-04	CS-356-4
J1002	12-Pin Connector.	G6/F8	72/E2	A-P	929853-06	CS-356-6
J1003	Female Connector.	C8	---	MOL	2139-3	CS-287-3
J1004	Connector Housing	A2	9/D5	MOL	2139-8	CS-287-8
J1005	Binding Post, Black	A2	---	HHS	DF-21-BC	BP-11-0
J1006	Binding Post, Red	A1	---	HHS	DF-21-BC	BP-11-2
J1007	NOT USED					
J1008	14-Pin Connector	K5,6	78/E2	T-1	C931402	S0-70
J1009	Contact	F5	79/A1, A2	R-D	Special	29316A

RELAYS (K)

"100" Series (Sch. 29658E-Pg. 7-12)
(PC-Board 476-Pg. 7-15)

K101	5V, Reed Type	C3/E3	82/C5	COT	UF-40097	RL-56
------	-------------------------	-------	-------	-----	----------	-------

CONNECTORS (P)

"1000" Series (Sch. 29658E-Pg. 7-12)
(PC-Board 476-Pg. 7-15)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
P1001	8-Pin Connector	G6	11/A3	A-P	929838001-04	CS-355-4
P1002	12-Pin Connector.	G6/G8	12/F3	A-P	929838001-12	CS-355-6
P1003	Male, Connector	C8	73/A4	MOL	A-2391-3A	CS-288-3
P1004	Male, Connector	E6	74/A3	MOL	---	29467A
P1005	NOT USED					
P1006	NOT USED					
P1007	Line Cord	C8	---	R-D	SPECIAL	C0-9

TRANSISTORS (Q)

"100" Series (Sch. 29658E-Pg. 7-12)
(PC-Board 476-Pg. 7-15)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
Q101	N-Chan, JFET.	C3	85/C5	INT	ITE4392	TG-77
Q102	N-Chan, JFET.	D4	86/C4	INT	ITE4392	TG-77
Q103	NPN, Case TO-5.	F1	87/C3	RCA	2N3439	TG-93
Q104(A-B)	Dual "P" Channel MOS Fet 8-PIN TO-77.	85/C5	88/D3	G-1	955-004	TG-94
Q105	N-Chan JFET	D5	89/C3	INT	ITE4392	TG-77
Q106	PNP, Switch	A7	90/B2	F-1	2N5139	TG-66
Q107	NPN	G1	91/C2	F-1	2N3565	TG-39

TRANSISTORS (Q) "300" Series (Sch. 29659C-Pg. 7-13) (PC-Board 451-Pg. 7-13)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
Q301	Thyristor, SCR.	B2	38/C4	G-E	C106F1-	TG-132
Q302	NPN Switch	B3	21/C3	MOT	2N3904	TG-47
Q303	PNP, Silicon, T0-92 Case.	D3	35/D4	MOT	2N3905	TG-53
Q304	NPN, Switch	D3	33/E4	MOT	2N3904	TG-47
Q305	NPN, Switch	C4	32/E4	MOT	2N3904	TG-47
Q306	PNP, Silicon, T0-92 Case.	C4	34/E4	MOT	2N3905	TG-53
Q307	NPN, Switch	D3	37/E3	MOT	2N3725	TG-131
Q308	NPN, Switch	D4	36/E3	MOT	2N3725	TG-131
Q309	PNP, Silicon.	C2	50/D3	MOT	MPS-U55	TG-133
Q310	PNP, Silicon, T0-92 Case.	C2	51/D3	MOT	2N3905	TG-53

RESISTORS (R) "100" Series (Sch. 29658E-Pg. 7-12) (PC-Board 476-Pg. 7-15)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
R101	.1Ω, 7.5W, WW	B2	94/E2	PRE	SM37244	R-262-.1
R102	.898Ω, + 1%, 5W, WW	B2	95/E2	TEP	TS5	R-232-.898
R103	9Ω, .1%, 5W, WW	B2	96/D2	TEP	TS-1	R-252-9
R104	90Ω, .1%, 1/2W, MtF	C2	97/D2	DLE	MFF	R-169-90
R105	900Ω, .1%, 1/8W, MtF	C2	98/D2	DLE	MFF-1/8	R-168-900
R106	NOT USED					
R107	1.005M, 1000V RMS, 2W, MtF.	C3	100/D5	AC-1	CM-2	R-284-1.005M
R108	990KΩ, .1%, 1/8W, MtF	D3	101/C5	DLE	MMF-1/8	R-176-990K
R109	9.97KΩ, .1%, 1/8W, MtF.	D3	102/C5	DLE	MMF-1/8	R-176-9.97K
R110	991Ω, .1%, 1/8W, MtF	D3	103/C5	DLE	MMF-1/8	R-176-991
R111	90.3KΩ, .1%, 1/8W, MtF.	D4	104/C4	DLE	MMF-1/8	R-176-90.3K
R112	10KΩ, .1%, 1/8W, MtF.	C4	105/C4	DLE	MMF-1/8	R-176-10K
R113	500Ω, 0.5W, POT	E4	106/D4	BEC	72PMR-500	RP-97-500
R114	50KΩ, 10%, Cermet Trimmer	G2	107/D4	BEC	72PMR	RP-97-50K
R115	NOT USED					
R116	NOT USED					
R117	27KΩ, 5%, 1/4W, Comp	A7	110/C2	A-B	CB	R-76-27K
R118	4.32KΩ, 1%, 1/8W, MtF	B7	111/C3	IRC	CEA-T0-432K	R-88-4.32K
R119	4.99KΩ, 1%, 1/8W, MtF	B7	112/C2	IRC	CMF 1/10; T-1, 1%	R-88-4.99K
R120	NOT USED					
R121	3.9KΩ, 10%, 1/2W, Comp.	F5	114/A1	A-B	EB-3.9-10%	R-1-3.9K
R122	1KΩ, 10%, 1/4W, Comp.	F6	115/A1	A-B	CB	R-76-1K
R123	NOT USED					
R124	NOT USED					
R125(A-H)	Thick Film.	Several	118/C3	R-D	SPECIAL	TF-79
R126(A-K)	Thick Film.	Several	119/C3	R-D	SPECIAL	TF-80
R127	NOT USED					
R128	27KΩ, 10%, 1/4W, Comp.	G6	121/D5	A-B	CB	R-76-27K
R129	NOT USED					
R130	6.49KΩ, 1%, 1/8W, MtF	J1	123/A3	IRC	CEA-T0-6.49K	R-88-6.49K
R131	3.65KΩ, 1%, 1/8W, MtF	J1	124/A3	IRC	CEA-T0-3.65K	R-88-3.65K
R132	806Ω, 1%, 1/8W, MtF	H1	125/A3	IRC	CEA-T0-806	R-88-806
R133	2.15KΩ, 0.1%, 1/10W, MtF.	H1	126/A3	TRW	MAR-5	R-263-2.15K
R134	50Ω, 3/4W, POT	H1	127/A3	BRN	3069P	RP-64-50
R135	402Ω, 0.1%, 1/10W, MtF	H2	128/A3	TRW	MAR-5	R-263-402
R136	100KΩ, 1%, 1/8W, MtF.	H3	129/B2	IRC	CEA-T0-100K	R-88-100K
R137	Selected With DZ58	H1	130/A3	R-D	SPECIAL	PART OF 27699A
R138	33.2KΩ, ±1%, 1/8W, MtF.	F5	131/C4	IRC	CEA-T0-33.2K	R-88-33.2K
R139	50KΩ, 10%, Cermet Trimmer	D1	132/D3	BEC	72PMR	RP-97-50K
R140	47KΩ, 10%, 1/4W, Comp	A6	133/B3	MEP	CR25, 5%	R-76-47K
R141	22M, ±10%, 1/4W, MtF	A6	134/B3	A-B	CB	R-76-22M

RESISTORS (R) (CON'T)
 "100" Series (Sch. 29658E-Pg. 7-12)
 (PC-Board 476-Pg. 7-15)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
R142	1K Ω , $\pm 10\%$, 3/4W, POT.	B7	135/A3	BRN	3069P	RP-64-1K
R143	100K Ω , 10%, 2W, Comp.	B5	136/D3	A-B	HB	R-3-100K
R144	22K Ω , $\pm 10\%$, 1/4W, ...	B5	137/D3	A-B	CB	R-76-22K
R145	922 Ω , 0.1%, 1/4W, MtF.	E5	138/C4	TRW	MAR-7	R-264-922
R146	10K Ω , 0.5W, POT.	F5	139/C4	BEC	72PMR	RP-97-10K
R147	100 Ω , 0.5W, POT.	E5	140/C4	BEC	72PMR	RP-97-100
R148	8.95K Ω , 0.1%, 1/10W, MtF.	F5	141/C4	TRW	MAR-5	R-263-8.95K
R149	100 Ω , .1%, 1/10W, MtF.	F6	142/C4	TRW	MAR-5	R-263-100
R150	998K Ω , .1%, 1/4W, MtF.	G1	143/D2	TRW	MAR-7, T13	R-264-998K
R151	998K Ω , .1%, 1/4W, MtF.	G1	144/D2	TRW	MAR-7, T13	R-264-998K
R152	998K Ω , .1%, 1/4W, MtF.	G1	145/D2	TRW	MAR-7, T13	R-264-998K
R153	994K Ω , .1%, 1/4W, MtF.	G2	146/D2	TRW	MAR-7, T13	R-264-994K
R154	Thick Film	D1	147/D3	~~R-D~~	SPECIAL	TF-78
R155	5K Ω , 10%, Cermet Trimmer.	D1	148/D4	BEC	72PMR	RP-97-5K
R156	500 Ω , 10%, Cermet Trimmer	E1	149/D3	BEC	72PMR	RP-97-500
R157	50 Ω , 10%, Cermet Trimmer.	E1	150/D4	BEC	72PMR	RP-97-50
R158	1K Ω , .1%, 1/10W, MtF.	F1	151/D4	TRW	MAR-5	R-263-1.0K
R159	10K Ω , 10%, Cermet Trimmer	G2	152/D2	BEC	89P	RP-89-10K
R160	NOT USED.					
R161	3.9M, 10%, 1/4W, Comp.	F6	154/C4	A-B	CB	R-76-3.9M
R162	50K Ω , 10%, Cermet Trimmer	G2	155/C2	BEC	89P	RP-89-50K
R163	200K Ω , .5W, POT.	E5	156/C4	BEC	72PMR-200K	RP-97-200K
R164	200K Ω , 1%, 1/8W, MtF.	G2	157/D2	IRC	CEA-T0-200K	R-88-200K
R165	100 Ω , 1%, 1/8W, MtF.	G2	158/C2	IRC	CEA-T0-100	R-88-100

"200" Series (Sch. 29658E-Pg. 7-12)
 (PC-Board 475-Pg. 7-14)

R201	Thick Film.	G8	14/C3	BRN	4310R 102-121	TF-82
R202	Thick Film.	J7	15/E3	DLE	LDPI4-01-470G	TF-64
R203	Potentiometer	G6	16/A2	BRN	3856H	RP-117-50K

"300" Series (Sch. 29659C-Pg. 7-13)
 (PC-Board 451-Pg. 7-13)

R301	20K Ω , 10%, Cermet Trimmer	C3	25/C3	BEC	72PMR	RP-97-20K
R302	330 Ω , 10%, 1/4W, Comp.	B3	20/C3	MEP	CR25, 5%	R-76-330
R303	1K Ω , 10%, 1/4W, Comp.	B3	21/D4	MEP	CR25, 5%	R-76-1K
R304	3.9K Ω , $\pm 20\%$, 3W, WW.	B2	24/D4	TEP	TS3	R-268-3.9K
R305	4.7K Ω , 10%, 1/4W, Comp.	B4	23/D3	MEP	CR25, 5%	R-76-4.7K
R306	3.3K Ω , 10%, 1/4W, Comp.	B4	22/C3	A-B	CB-332-10%	R-76-3.3K
R307	82 Ω , 10%, 1/4W, Comp.	D4	19/E3	MEP	CR25, 5%	R-76-82
R308	82 Ω , 10%, 1/4W, Comp.	D4	18/E3	MEP	CR25, 5%	R-76-82
R309	10 Ω , 10%, 1/4W, Comp.	B5	17/F4	A-B	CB-100-10%	R-76-10
R310	10 Ω , 10%, 1/4W, Comp.	B5	16/F4	A-B	CB-100-10%	R-76-10
R311	100K Ω , 10%, 1/4W, Comp.	D2	44/E3	A-B	CB-104-10%	R-76-100K
R312	100K Ω , 10%, 1/4W, Comp.	D2	45/E3	A-B	CB-104-10%	R-76-100K
R313	100K Ω , 10%, 1/4W, Comp.	D2	43/E3	A-B	CB-104-10%	R-76-100K
R314	6.8M, 10%, 1/4W, Comp.	D2	46/E3	A-B	CB-6UR-10%	R-76-6.8M
R315	576K Ω , 1%, 1/8W, MtF.	D2	48/E3	IRC	CEA-T0-576K	R-88-576K
R316	100K Ω , 1%, 1/8W, MtF.	D2	47/E3	IRC	CEA-T0-100K	R-88-100K

SWITCHES (S)
 "100" Series (Sch. 29658E-Pg. 7-12)
 (PC-Board 476-Pg. 7-15)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
S101	Line Selector	C7	161/A4	C-W	GG350PCDPOT	SW-318
S102	Line Battery	D7	162/B4	R-D	SPECIAL	SW-397
S103	12 Station Pushbutton	Several	163/E3,E5	R-D	SPECIAL	29434B

TRANSFORMERS (T)
 "100" Series (Sch. 29658E-Pg. 7-12)
 (PC-Board 476-Pg. 7-15)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
T101	Transformer, Power	D6	165/A5	R-D	SPECIAL	TR-168 *
* Standard line voltages, optional line voltage units use TR-169						
"300" Series (Sch. 29659C-Pg. 7-13) (PC-Board 451-Pg. 7-17)						
T301	Transformer, Inverter	E3	39/F3	R-D	SPECIAL	TR-170

INTEGRATED CIRCUITS (U)
 "100" Series (Sch. 29658E-Pg. 7-12)
 (PC-Board 476-Pg. 7-15)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
U101	8-Pin Op-Amp JFET	C4	167/C5	T-1	TL081CL	IC-196
U102	BI-FET, Op-Amp.	D4	168/C4	NAT	LF351N	IC-176
U103	True RMS-TO-DC Converter.	E4	169/D5	A-D	AD536JH	IC-172-1
U104	8-Pin Op-Amp DIP.	J1	170/A2	F-1	U6T7741393	IC-42
U105	4-1/2 Digit Analog-Processor.	H3	171/A2	INT	8052A	LSI-12
U106	4-1/2 Digit Logic-Processor	H4	172/C2	INT	7103A	LSI-11
U107	Linear Op-Amp 8-Pin	G1	173/C2	INT	LM308AN	IC-203
U108	J-FET Input Op-Amp.	C5	174/C3	MOT	LF3558N -Selected	IC-205
U109	Linear Op-Amp 8-Pin	D5	175/C3	INT	LM308AN	IC-203
U110	CMOS 14-Stage Binary Converter.	A6	176/B2	NAT	CD4060BCN	IC-197
U111	Six COS/MOS Hex Inverter.	A7	177/C2	RCA	CD4069B	IC-139

"200" Series (Sch. 29658E-Pg. 7-12)
 (PC-Board 475-Pg. 7-14)

U201(A-D)	4011 CMOS Unbuffered.	Several	18/E3	MOT	MC14011CP	IC-102
U202	Digit Driver.	G-7	19/E2	T-1	75492	IC-169
U203	Segment Drive	J-7	20/E3	MOT	4511	IC-168

"300" Series (Sch. 29659C-Pg. 7-13)
 (PC-Board 451-Pg. 7-13)

U301	Dual D-Type Flip-Flop 14-Pin DIP.	C4	14/D3	RCA	CD4013AE	IC-103
U302	1.1V Micro-Power Detector	D2	49/E3	INT	ICL8211CPA-Selected	IC-177

INSTRUCTION MANUAL

Digital Multimeter

Model 4003

REPLACEABLE PARTS

VOLTAGE REGULATORS (VR)
 "100" Series (Sch. 29658E-Pg. 7-12)
 (PC-Board 476-Pg. 7-15)


Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
VR101	+5V, 3-Term, T0-220	E7	180/B5	MOT	MC7805C1	IC-93
VR102	+15V, 500mA	E8	181/B5	F-1	78M15CU	IC-194
VR103	-15V, 500mA	E8	182/B5	SIG	78M15CU	IC-195
VR104	Selected DZ-58.	H1	183/A3	R-D	SPECIAL	27699A

"300" Series (Sch. 29659C-Pg. 7-13)
 (PC-Board 451-Pg. 7-13)


VR301	8.2Volt, Zener.	B3	10/C3	MOT	1N765A	DZ-61
-------	-------------------------	----	-------	-----	--------	-------


CRYSTAL (Y)
 "100" Series (Sch. 29658E-Pg. 7-15)
 (PC-Board 476-Pg. 7-14)

Circuit Desig.	Description	Sch. Location	PC-Board Item No./ Location	Mfr. Code	Mfr. Desig.	Part No.
Y101	Quartz, $\pm 0.01\%$, 100kHz	A6	186/B3	NEL	NE34PE	CR-8

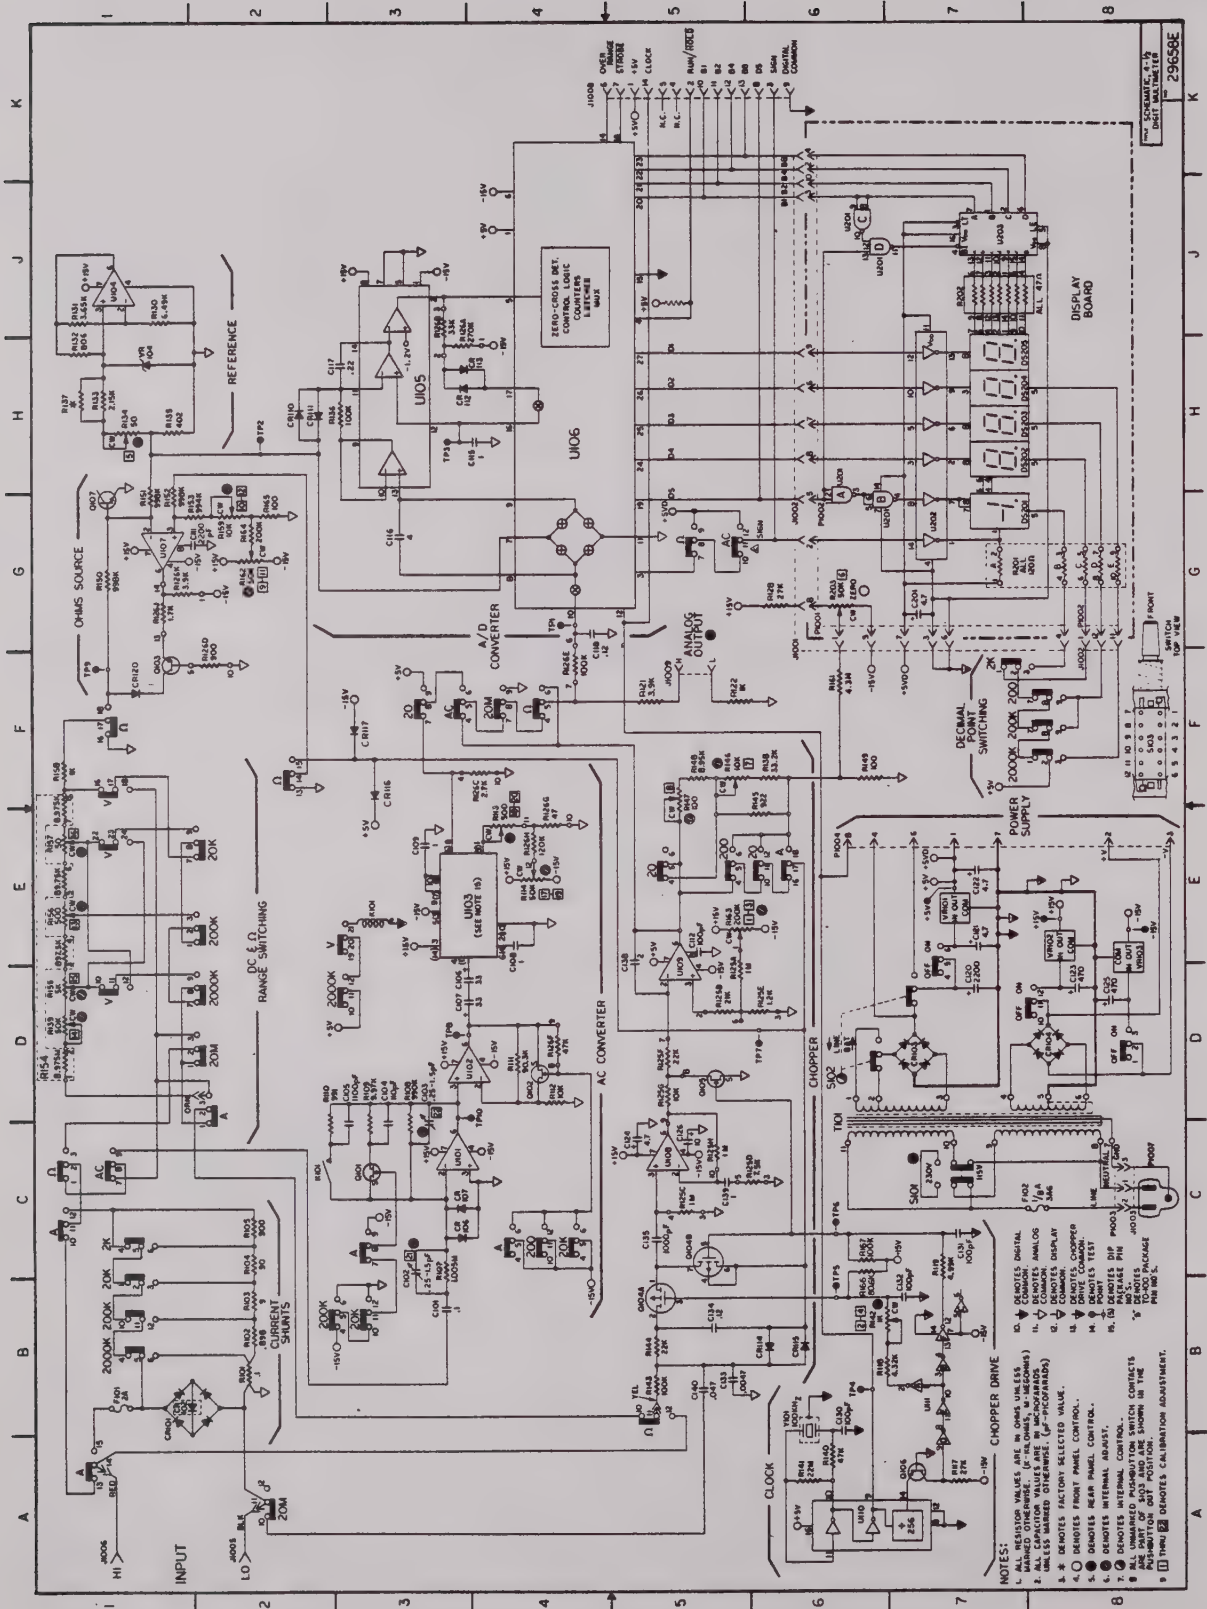

ITEM	PART NO.	SCHEM DISC.	ZONE
1	29005C	100E-51M	C2
2	C-119-47	C302	E3
3	"	C301	E3
4	C-256-1	C303	E3
5	C-285-100	C305	F3
6	"	C304	F4
7	C-38-2	"	D4
8	C5-276	7R600	D5
9	C5-287-8	71004	D5
10	D2-41	VR301	C3
11	FR-12	"	C2
12	"	"	D3
13	FU-13	F301	C3
14	IC-103	U301	D3
15	LU-87	2R600	D2
16	R-16-19	R310	F4
17	"	R309	F4
18	R-16-82	R308	F3
19	"	R307	E3
20	R-16-330	R302	C3
21	R-16-1K	R303	D4
22	R-16-33K	R306	C3
23	R-16-47K	R305	D3
24	R-268-3.9	R304	D4
25	RP-97-20K	R301	C3
26	RF-28	CR301	D4
27	"	CR303	E3
28	"	CR302	E3
29	"	CR305	F4
30	"	CR304	F4
31	T6-47	Q302	C3
32	"	Q305	E4
33	"	Q304	E4
34	T6-53	Q306	E4
35	"	Q303	D4
36	T6-131	Q308	E3
37	"	Q307	E3
38	T6-132	Q301	C4
39	TR-110	T301	F3
40	226A-110E	TR600	D4
41	SC-16-0	"	D2
42	SC-16-9	"	D2
43	R-16-100K	R313	E3
44	"	R311	E3
45	"	R312	E3
46	R-16-68M	R314	E3
47	R-88-100K	R316	E3
48	R-88-516K	R315	E3
49	IC-117	U302	E3
50	T6-133	Q309	D3
51	T6-53	Q310	D3
52	C5-345	"	C6

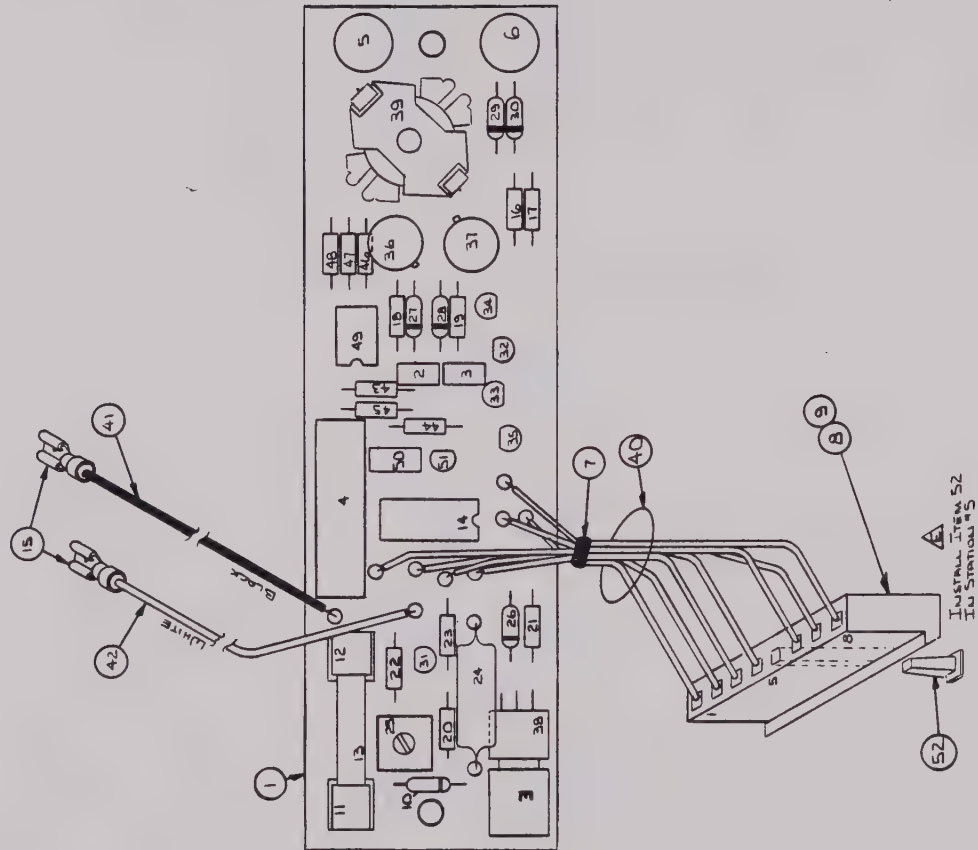

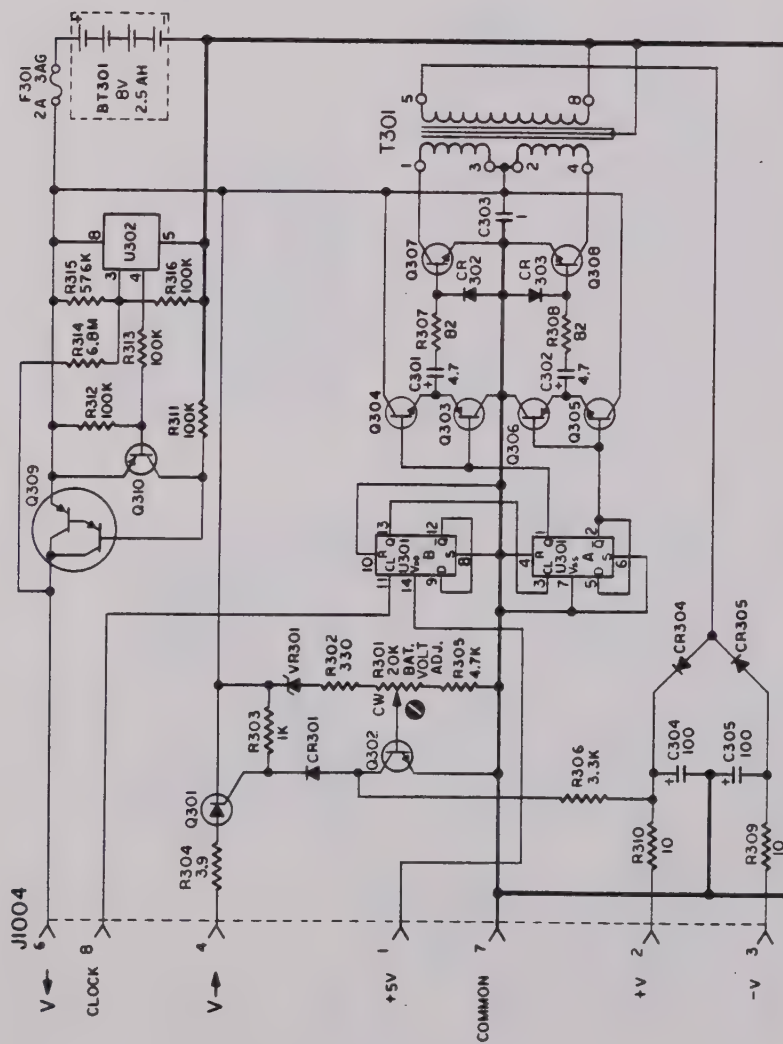

1. ALL RESISTOR VALUES ARE IN OHMS UNLESS MARKED OTHERWISE. (K-KILOHMS, M-MEGOHMS)
2. ALL CAPACITOR VALUES ARE IN MICROFARADS.
3. ⚡ DENOTES INTERNAL ADJUST.

HIGHEST SCHEMATIC DESIGNATIONS USED


BT301	C305	CR303	F301
J1004	Q310	R316	T301
U302	VR301		

SCHEMATIC DESIGNATIONS NOT USED


J1001 THRU J1003	
------------------	--

TITLE SCHEMATIC
BATTERY PACK

NO 29659C

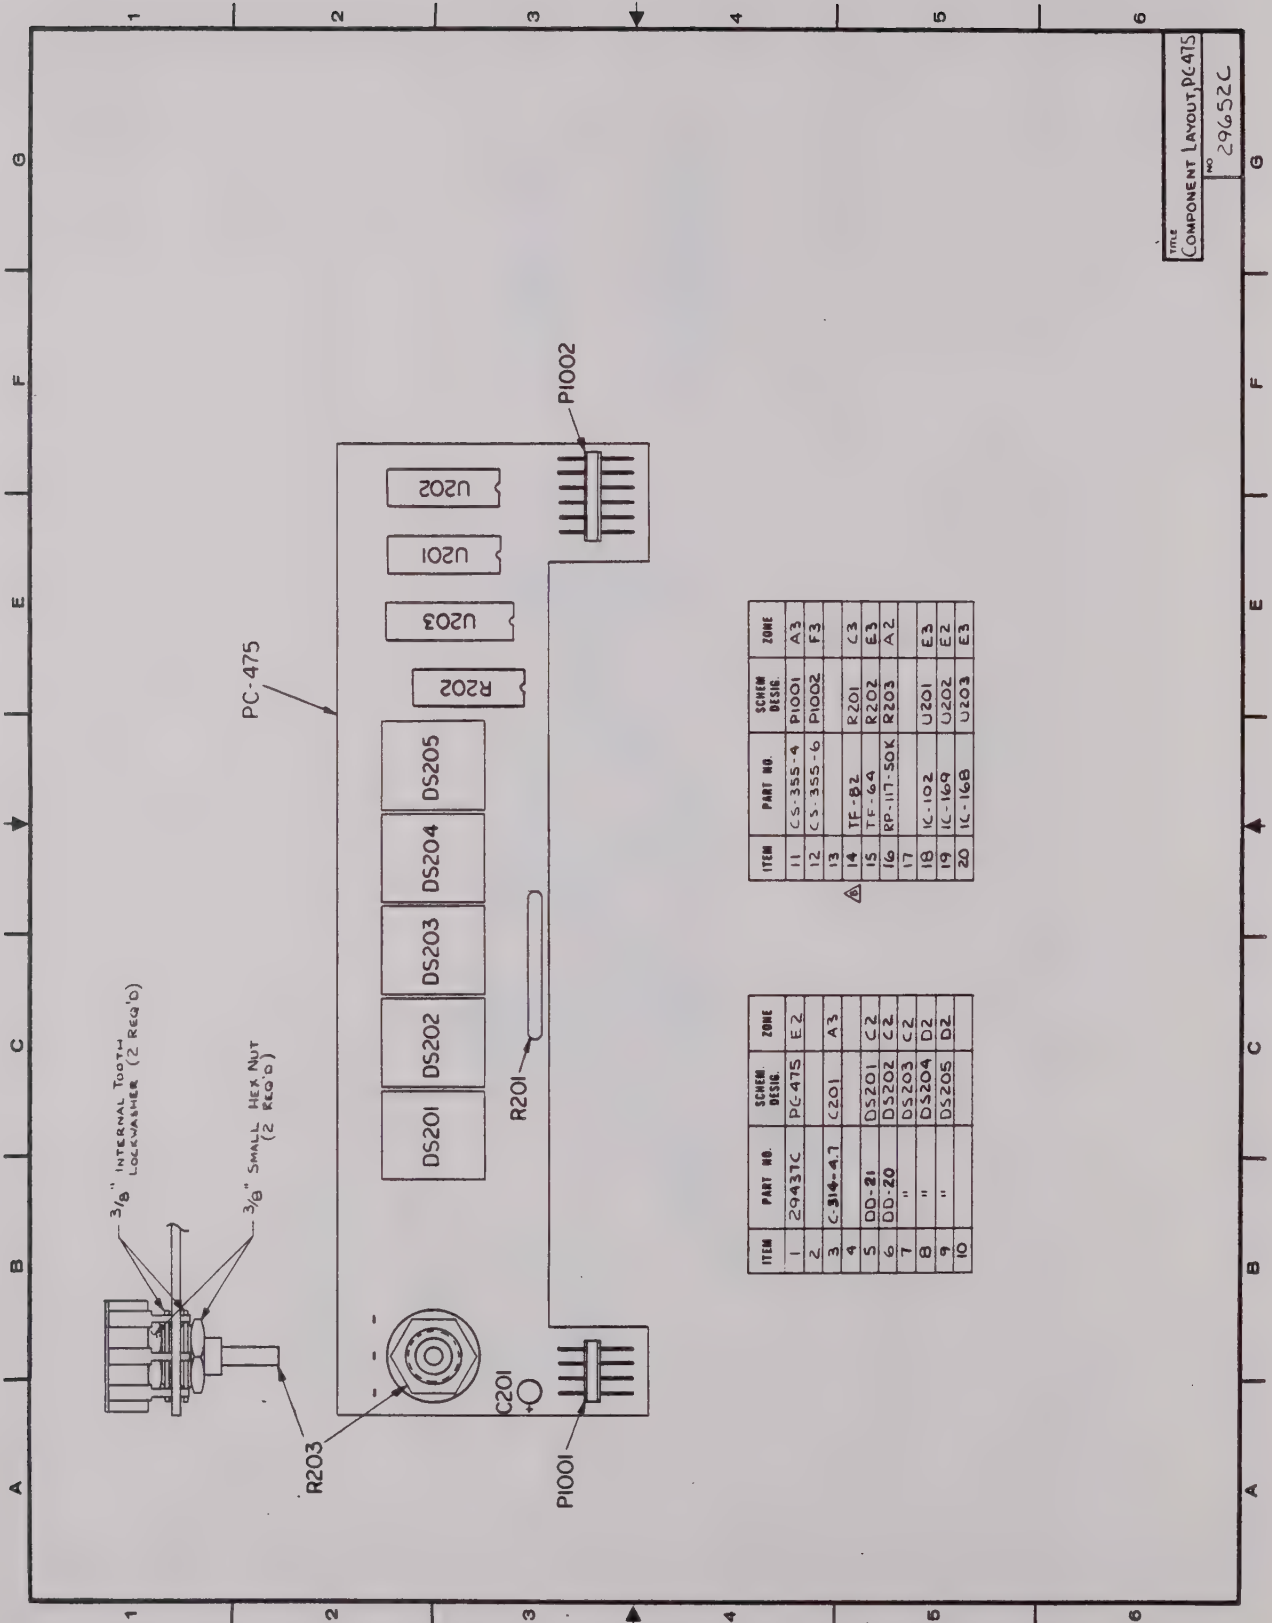

TITLE
COMPONENT LAYOUT, PC-475
NO 29652C

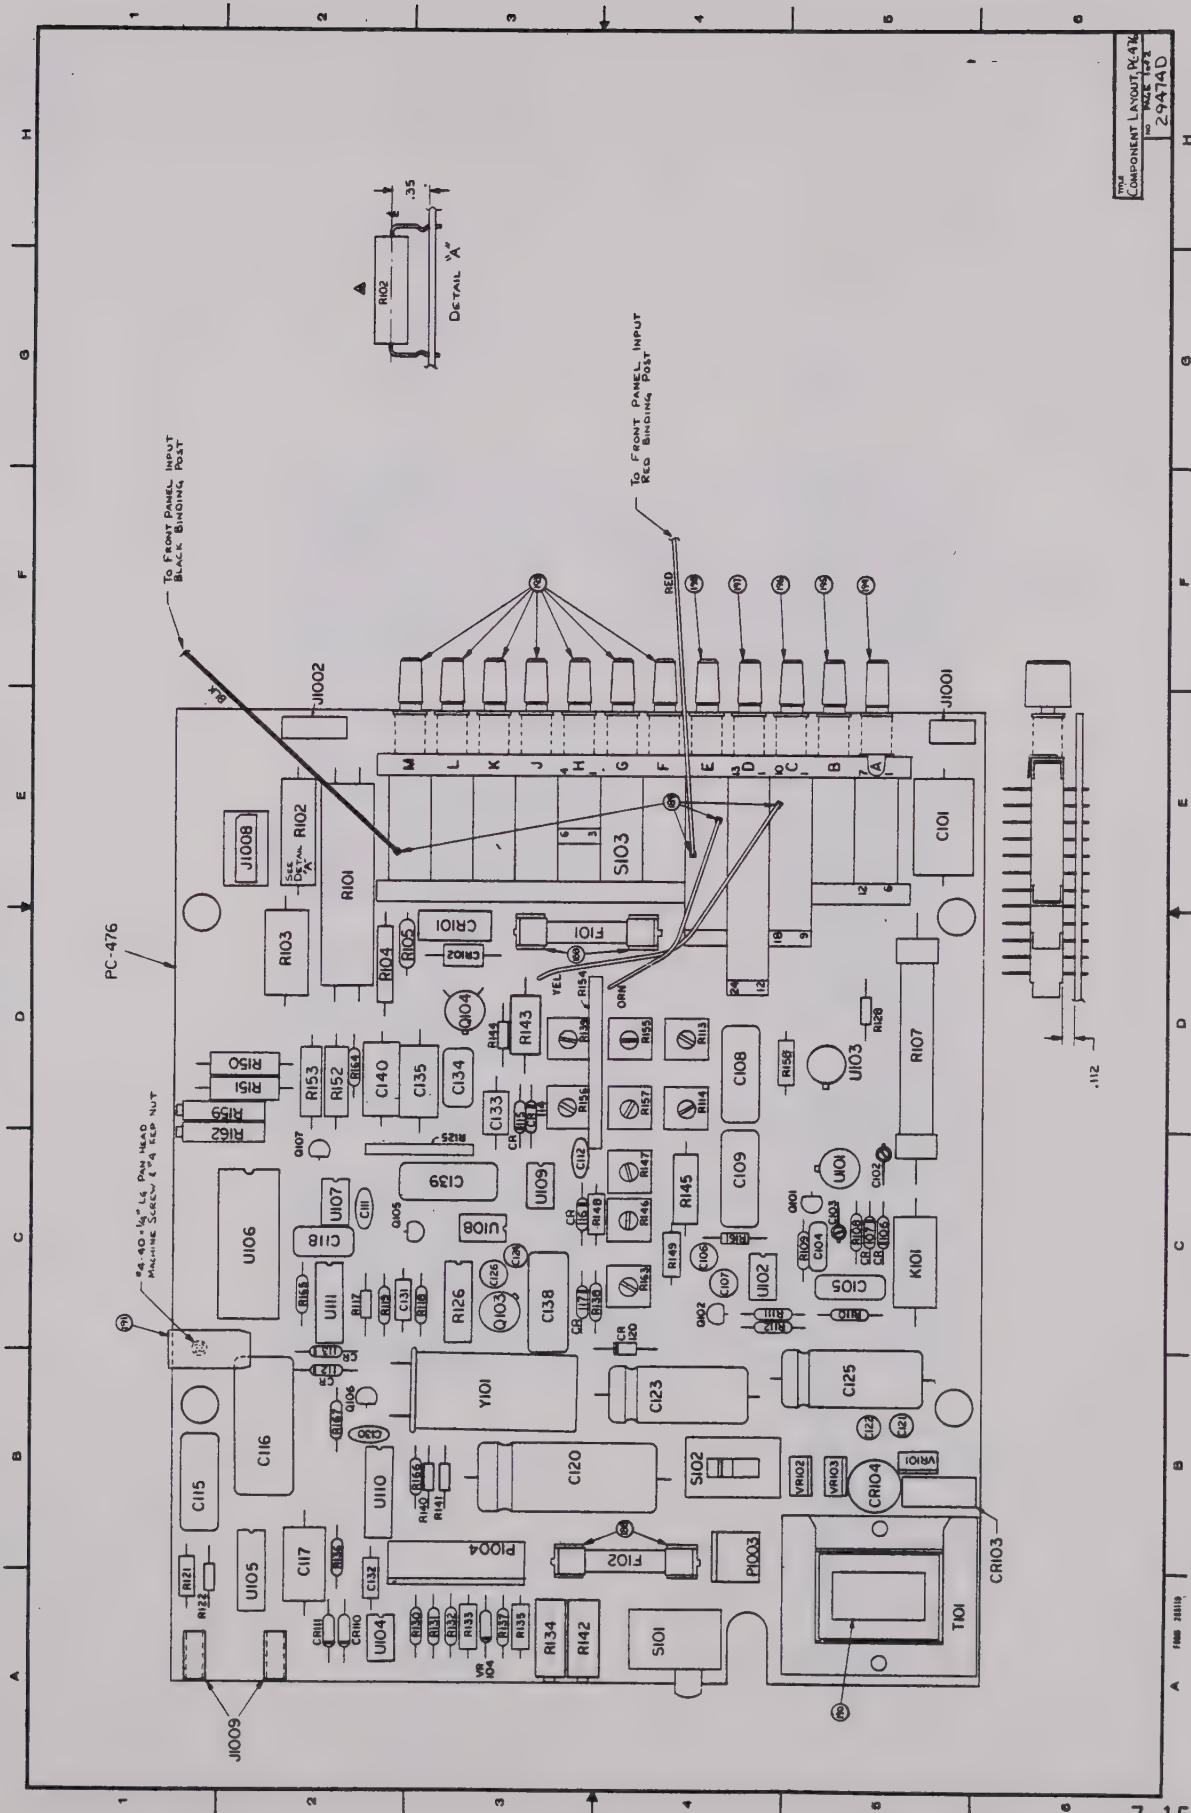

ITEM	PART NO	SCREEN REMARK	ZONE
1	294-00	PC-416	D1
2	"	"	"
3	"	"	"
4	C-283-1	C101	E5
5	C-184	C102	C5
6	C-184	C103	C5
7	C-218-100P	C104	C5
8	C-218-100P	C105	C5
9	C-314-1	C106	C5
10	C-314-1	C107	C5
11	C-314-1	C108	C5
12	"	C109	C4
13	"	C110	C4
14	C-222-200P	C111	C2
15	C-222-200P	C112	C3
16	"	"	"
17	"	"	"
18	C-284-1	C115	B1
19	C-284-1	C116	B2
20	C-284-1	C117	B2
21	C-284-1	C118	C2
22	"	"	"
23	C-284-1	C119	C3
24	C-314-1	C121	B5
25	"	C122	B5
26	C-284-1	C123	B4
27	C-314-1	C124	C3
28	C-284-1	C125	B5
29	C-314-1	C126	C5
30	"	"	"
31	"	"	"
32	C-244-100P	C130	B2
33	C-244-100P	C131	C2
34	C-244-100P	C132	B2
35	C-244-100P	C133	B2
36	C-244-100P	C134	D3
37	C-244-100P	C135	D3
38	C-138-1000P	C136	D3
39	"	"	"
40	C-244-1	C138	C3
41	C-244-1	C139	C3
42	C-244-1	C140	D2
43	C-244-1	C141	D2
44	"	"	"
45	"	"	"
46	RE-48	CR101	D3
47	RE-48	CR102	D3
48	RE-48	CR103	B5
49	RE-48	CR104	B5
50	RE-48	CR105	B5

ITEM	PART NO	SCREEN REMARK	ZONE
51	RE-28	CR106	C5
52	"	CR107	C5
53	"	"	"
54	"	"	"
55	RE-28	CR110	A2
56	"	CR111	A2
57	"	CR112	B2
58	"	CR113	B2
59	"	CR114	D3
60	"	CR115	D3
61	"	CR116	C3
62	"	CR117	C3
63	"	"	"
64	RE-38	CR120	B4
65	"	"	"
66	EU-13	F101	D3
67	EU-13	F102	B4
68	EU-20	F103	E5
69	EU-20	F104	E5
70	"	"	"
71	C-314-1	F105	E2
72	C-314-1	F106	E2
73	C-314-1	F107	E2
74	C-314-1	F108	E2
75	C-314-1	F109	E2
76	"	"	"
77	"	"	"
78	SO-10	J1000	E2
79	SO-10	J1001	E2
80	SO-10	J1002	E2
81	SO-10	J1003	E2
82	RL-56	K101	C5
83	"	"	"
84	TG-17	G101	C5
85	"	"	"
86	TG-93	G102	C5
87	TG-93	G103	C5
88	TG-93	G104	D3
89	TG-93	G105	C5
90	TG-93	G106	B2
91	TG-39	G107	C1
92	"	"	"
93	RE-202-1	R101	E2
94	RE-202-1	R102	E2
95	RE-202-1	R103	D2
96	RE-202-1	R104	D2
97	RE-202-1	R105	D2
98	RE-202-1	R106	D2
99	RE-202-1	R107	D2
100	RE-202-1	R108	D2

ITEM	PART NO	SCREEN REMARK	ZONE
101	RE-100-900K	R109	C5
102	RE-100-900K	R110	C5
103	RE-100-900K	R111	C5
104	RE-100-900K	R112	C4
105	RE-100-900K	R113	D4
106	RE-100-900K	R114	D4
107	RE-100-900K	R115	D4
108	RE-100-900K	R116	D4
109	RE-100-900K	R117	C2
110	RE-100-900K	R118	C2
111	RE-100-900K	R119	C2
112	RE-100-900K	R120	C2
113	RE-100-900K	R121	A1
114	RE-100-900K	R122	A1
115	RE-100-900K	R123	A1
116	RE-100-900K	R124	A1
117	RE-100-900K	R125	C3
118	RE-100-900K	R126	C3
119	RE-100-900K	R127	C3
120	RE-100-900K	R128	D5
121	RE-100-900K	R129	D5
122	RE-100-900K	R130	A3
123	RE-100-900K	R131	A3
124	RE-100-900K	R132	A3
125	RE-100-900K	R133	A3
126	RE-100-900K	R134	A3
127	RE-100-900K	R135	A3
128	RE-100-900K	R136	B2
129	RE-100-900K	R137	B2
130	RE-100-900K	R138	D3
131	RE-100-900K	R139	D3
132	RE-100-900K	R140	B3
133	RE-100-900K	R141	B3
134	RE-100-900K	R142	A3
135	RE-100-900K	R143	A3
136	RE-100-900K	R144	A3
137	RE-100-900K	R145	C4
138	RE-100-900K	R146	C4
139	RE-100-900K	R147	C4
140	RE-100-900K	R148	C4
141	RE-100-900K	R149	C4
142	RE-100-900K	R150	C4
143	RE-100-900K	R151	D2
144	RE-100-900K	R152	D2
145	RE-100-900K	R153	D2
146	RE-100-900K	R154	D2
147	RE-100-900K	R155	D2
148	RE-100-900K	R156	D2
149	RE-100-900K	R157	D2
150	RE-100-900K	R158	D2

ITEM	PART NO	SCREEN REMARK	ZONE
151	RE-100-900K	R159	D4
152	RE-100-900K	R160	D2
153	RE-100-900K	R161	C4
154	RE-100-900K	R162	C4
155	RE-100-900K	R163	C4
156	RE-100-900K	R164	C2
157	RE-100-900K	R165	C2
158	RE-100-900K	R166	C2
159	RE-100-900K	R167	B3
160	RE-100-900K	R168	B3
161	RE-100-900K	R169	A4
162	RE-100-900K	R170	A4
163	RE-100-900K	R171	A4
164	RE-100-900K	R172	A4
165	RE-100-900K	R173	A4
166	RE-100-900K	R174	A4
167	RE-100-900K	R175	A4
168	RE-100-900K	R176	A4
169	RE-100-900K	R177	A4
170	RE-100-900K	R178	A4
171	RE-100-900K	R179	A4
172	RE-100-900K	R180	A4
173	RE-100-900K	R181	A4
174	RE-100-900K	R182	A4
175	RE-100-900K	R183	A4
176	RE-100-900K	R184	A4
177	RE-100-900K	R185	A4
178	RE-100-900K	R186	A4
179	RE-100-900K	R187	A4
180	RE-100-900K	R188	A4
181	RE-100-900K	R189	A4
182	RE-100-900K	R190	A4
183	RE-100-900K	R191	A4
184	RE-100-900K	R192	A4
185	RE-100-900K	R193	A4
186	RE-100-900K	R194	A4
187	RE-100-900K	R195	A4
188	RE-100-900K	R196	A4
189	RE-100-900K	R197	A4
190	RE-100-900K	R198	A4
191	RE-100-900K	R199	A4
192	RE-100-900K	R200	A4

* NOTE: 100V JAPANESE VERSION SUBSTITUTE
FOR ITEM 68, FU-20 AND
TE-100 FOR ITEM 100, TE-100.

COMPONENT LAYOUT PC-416
29474D

RACAL-DANA Instruments Inc.

U. S. REPRESENTATIVES

ALABAMA
(800) 327-0853

ALASKA
(503) 241-8624

ARIZONA
(602) 252-5242

ARKANSAS
(918) 496-1457

CALIFORNIA
Northern
(408) 727-2341
Southern
(714) 859-8999
Los Angeles
(213) 628-8825

COLORADO
(303) 592-1717

CONNECTICUT
(201) 423-3039

DELAWARE
(609) 853-1605

DISTRICT OF COLUMBIA
(703) 941-0525

FLORIDA
(305) 724-0920 or
(800) 432-6288

GEORGIA
(800) 327-0853

HAWAII
(808) 847-4300

IDAHO
(714) 859-8999

ILLINOIS
(312) 932-4922

INDIANA
(800) RAC-DANA

IOWA
(800) RAC-DANA

KANSAS
(800) RAC-DANA

KENTUCKY
(800) RAC-DANA

LOUISIANA
(713) 780-2511

MAINE
(617) 890-7195

MARYLAND
(703) 941-0525

MASSACHUSETTS
(617) 890-7195

MICHIGAN
(800) RAC-DANA

MINNESOTA
(800) RAC-DANA

MISSISSIPPI
(800) 327-0853

MISSOURI
(800) RAC-DANA

MONTANA
(714) 859-8999

NEBRASKA
(800) RAC-DANA

NEVADA
(714) 859-8999

NEW HAMPSHIRE
(617) 890-7195

NEW JERSEY
Northern
(201) 423-3039
Southern
(609) 853-1605

NEW MEXICO
(602) 252-5242

NEW YORK
New York City,
Long Island
(516) 242-3454
Upstate New York
(315) 475-1500

NORTH CAROLINA
(800) 327-0853

NORTH DAKOTA
(312) 932-4922

OHIO
(800) RAC-DANA

OKLAHOMA
(918) 299-4818

OREGON
(503) 241-8624

PENNSYLVANIA
Eastern
(609) 853-1605
Western
(800) RAC-DANA

PUERTO RICO
(305) 724-0920

RHODE ISLAND
(201) 423-3039

SOUTH CAROLINA
(800) 327-0853

SOUTH DAKOTA
(312) 932-4922

TENNESEE
(800) 327-0853

TEXAS
Austin
(512) 451-5174
Dallas
(214) 661-0300
(214) 231-8106, Signal
Source Products Only
Houston
(713) 780-2511
San Antonio
(512) 342-3031

UTAH
(714) 859-8999

VERMONT
(315) 475-1500

VIRGINIA
(703) 941-0525


WASHINGTON
(503) 241-8624

WEST VIRGINIA
Eastern
(703) 941-0525
Western
(800) RAC-DANA

WISCONSIN
(800) RAC-DANA

WYOMING
(714) 859-8999

CANADA
Ontario
(416) 671-3920 or
(613) 726-8888
Quebec
(514) 336-0392
British Columbia
(604) 430-1410
Ottawa
(613) 726-8888
Montreal
(514) 336-0392

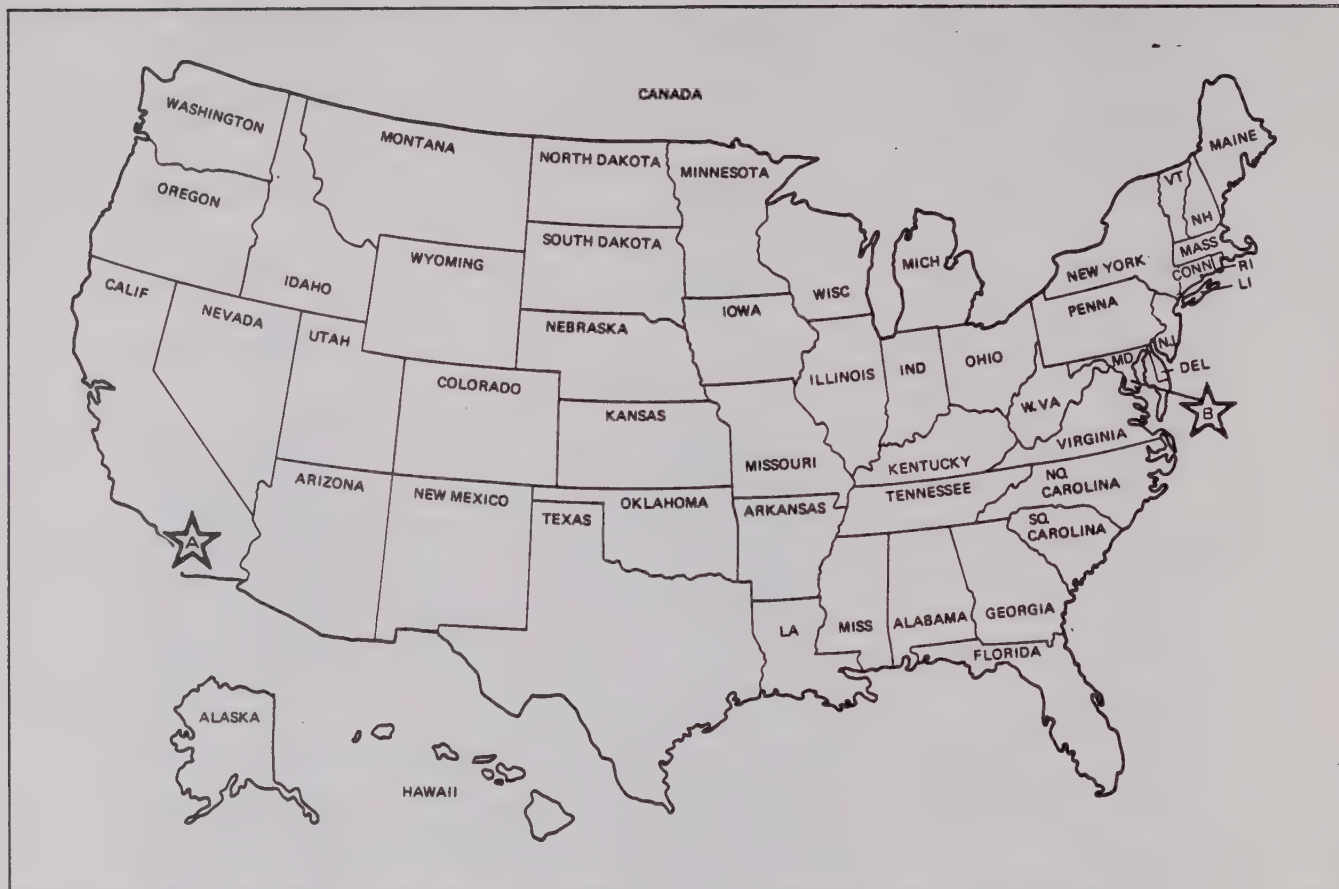**FACTORY SERVICE****RACAL-DANA INSTRUMENTS INC.**

4 Goodyear Street

Irvine, California 92714

Telephone: (714) 859-8999

PRODUCT SERVICE TWX 910-595-1136

REGIONAL SERVICE CENTER**RACAL-DANA INSTRUMENTS INC.**

5101 "D" Blacklick Road

Annandale, Virginia 22003

Telephone: (703) 941-0525

INTERNATIONAL SERVICE CENTERS**RACAL-DANA INSTRUMENTS LTD.**

Duke Street, Windsor,

Berkshire SL4 1SB, United Kingdom

Telephone: Windsor (07535) 68101, TLX: 847013

RACAL-DANA INSTRUMENTS GmbH.

Hermannstrasse 29, D-6078 Neu Isenburg,

Federal Republic of Germany

Telephone: 06102-2861/2, TLX: 412896

RACAL-DANA INSTRUMENTS S.A.

18 Avenue Dutartre, 78150 Le Chesnay, France

Telephone: (3) 955-8888, TLX: 697 215

RACAL-DANA INSTRUMENTS ITALIA srl.

Via Mecenate 84/A, 20138 Milano MI, Italy

Telephone: (02) 5062767/5052686, TLX: 315697

REPAIR REQUEST FORM

To allow us to better understand your repair requests, we suggest you use the following outline and include a copy with your instrument to be sent to your local Racal-Dana repair facility.

Model Number _____ Options _____ Date _____

Serial Number _____ P. O.# _____

Company Name _____

Address _____

City _____ State _____ Zip Code _____

Contact _____ Phone Number _____

1. Describe, in detail, the problem and symptoms you are having.

2. If you are using your unit on the bus, please list the program strings used and the controller type, if possible.

3. List all input levels, and frequencies this failure occurs.

4. Indicate any repair work previously performed.

5. Please give any additional information you feel would be beneficial in facilitating a faster repair time. (I. E., modifications, etc.)

www.manualsplus.com



1013972